

ASCOTTM
SUPPLY CORPORATION



TPMS TIRE PRESSURE
MONITORING SYSTEMS
CATALOG

2014

YOUR ONE SOURCE FOR QUALITY
BRAND NAME EQUIPMENT, TOOLS
AND SUPPLIES FOR THE TIRE INDUSTRY

Ascot Supply Corporation

**Programmable
TPMS Sensors**



TPMS as Simple as...

1

**Scan and Remove
Failed Sensor**



2

Simply Copy ID



3

Install and Go



**Multi-Application
TPMS Sensors**



- **Out of the Box Solution** - pre-programmed, ready to use (just like an OE sensor).
- **Snap-In and Clamp-In Valve Options** - valve stems are interchangeable.
- **Works with All Major Scan Tools.**



TPMS Tools & Accessories

TPMS Tool Assortment

- Includes all the small TPMS tools necessary for TPMS service.



Grommet Slide

- Durable construction and easy-to-use slide allows for simple grommet removal.
- Hole allows for simple new grommet installation.



Replacement Parts Kits

Group **31**
INCORPORATED

MAKERS OF
Xtra seal

Mobile Application
Lookup



TABLE OF CONTENTS

| | |
|---|-----|
| ● TPMS RELEARN CHART | |
| TPMS Relearn Chart _____ | 4 |
| ● TPMS SENSOR ACTIVATION TOOLS | |
| Sensor Activation Tools _____ | 5 |
| ● UNIVERSAL TPMS TRANSMITTERS | |
| EZ-Sensors _____ | 13 |
| REDI-Sensors _____ | 14 |
| ● OE TPMS TRANSMITTERS | |
| Schrader TPMS Transmitters _____ | 16 |
| Dill TPMS Transmitters _____ | 18 |
| ● TPMS TOOLS, ACCESSORIES & KITS | |
| Smart Sensor Pro+ _____ | 15 |
| Multi-Application TPMS Sensors _____ | 21 |
| Tools, Accessories & Kits _____ | 22 |
| ● BANDED TPMS SYSTEMS | |
| Banded TPMS Systems & Accessories _____ | 34 |
| ● TRAINING & PROMOTIONAL MATERIALS | |
| Training & Promotional Materials, Cabinets _____ | 33 |
| ● TPMS RETROFIT KITS | |
| TPMS Retrofit Kits _____ | 35 |
| ● UNIVERSAL TPMS TRANSMITTERS APPLICATION GUIDES | |
| EZ-Sensor Application Guide _____ | 36 |
| REDI-Sensor Application Guide _____ | 45 |
| ● SCHRADER APPLICATION GUIDE | |
| Schrader 2014 TPMS Application Guide _____ | 48 |
| Manufacturer's Part Numbers _____ | 155 |
| Numerical Listing: Sensors/Transmitters _____ | 156 |
| Numerical Listing: Service Packs _____ | 164 |
| ● DILL APPLICATION GUIDE | |
| Dill 2014 TPMS Application Guide _____ | 174 |



TPMS RELEARN CHART

TIA TPMS Relearn Chart

Forget the competitor's TPMS relearn information. The TIA TIRE PRESSURE MONITORING SYSTEM (TPMS) RELEARN CHART serves as a valuable, comprehensive and quick reference guide that technicians can easily navigate through to service any vehicle, foreign and domestic, that is quipped with TPMS.

Your organization won't want to be without one! It will save you time and money the first time you use it.

FEATURES: Information on vehicles equipped with TPMS through Model Year 2009; Laminated Flip Chart designed to provide accurate information on all aspects of TPMS applications, including relearn procedures; Chart is divided into Domestic & Import vehicle sections

CHART PROVIDES THE FOLLOWING INFORMATION:

- **The type of TPMS**, whether direct or indirect
- **Three columns of data that indicate when a system relearn is necessary**, i.e. after a change in air pressure, tire rotation, or tire/sensor replacement
- **A relearn summary:** this includes a reference number that corresponds to the vehicle's procedure for initiating sensor relearn mode. The vehicle relearns are located in the back of the corresponding section, either domestic or import
- **The sensor manufacturer**
- **Replacement part numbers:** OEM sensor part number, Schrader replacement sensor part and service pack numbers, Dill replacement sensor part and kit and band numbers, Continental replacement sensor part and kit and band numbers, and NAPA replacement sensor part and service pack numbers
- **The torque specifications** for the sensor nut, torx bolt, worm gear and lug nuts are listed



469-02013
TIA TPMS
Relearn Chart

| Ascot No. | Description |
|-----------|-----------------------------|
| 469-02013 | 2013 TIA TPMS Relearn Chart |

Snapshots of what is included in the TIA TPMS Relearn Chart:

| DOMESTIC VEHICLES | | | | | | | | | | | | | | | | | | | | | | |
|-------------------|---------|---------|-----------------------|-------------------------|--------|-------------------|-----------------|---------------|------------------|------------------------|-------------------------|-------------------|--------------------|--------------------|---------------------|--|--------------|---|-----------|-----------|------------------------|----------|
| MAKE | MODEL | YEAR | D-Direct Indirect TPM | Relearn Required After: | | | Relearn Summary | Sensor Manuf. | OEM Sensor Part# | Schrader® Sensor Part# | Schrader® Service Pack# | Dill Sensor Part# | Dill Kit or Band # | NAPA® Sensor Part# | NAPA® Service Pack# | Continental Part # (optional sensors only) | | Torque Specifications: Inch lbs. (N.m.) | | | | |
| | | | | Change Air Pres. | Rotate | Repl Tire/ Sensor | | | | | | | | | | Sensor | Kit or Band# | Sensor Nut | Torx Bolt | Worm Gear | Lug Nut Ft. lbs. (N.m) | |
| Buick | Allure | 2006 | I | ✓ | ✓ | ✓ | GM-2 | Schrader | | 20158 | 20004 | | 1070K | 921011 | 920125 | | | | | | | 100(140) |
| | Allure | 2007 | D | | ✓ | ✓ | GM-6 | Siemens | 15921013 | | | 1047 | 1050K | | | | | | | | | 100(140) |
| | Allure | 2008 | D | | ✓ | ✓ | GM-11 | Schrader | | 20158 | 20004 | | 1070K | 921011 | 920125 | SES3007 | SES4369 | | | | | 100(140) |
| | Allure | 2009 | D | | ✓ | ✓ | GM-11 | Siemens | 15921013 | | | 1047 | 1050K | | | | | | | | | 100(140) |
| | Century | 1990-05 | I | ✓ | ✓ | ✓ | GM-1 | Schrader | 25920615 | 20153 | 20008 | 9153 | V5930 | 921021 | 920145 | | | | | 11.5 | | 100(140) |

IMPORT RELEARN

AC-1

Ensure all tires are inflated to the pressure listed on the tire placard. Drive vehicle at speeds above 15 mph for a minimum of 40 seconds. Sensor ID's will be learned automatically.

ALL-1

- Inflate all tires to pressure listed on tire placard.
- Hold down RESET button (on end of wiper lever) until DISPLAY TYPE is displayed.
- Press button on end of wiper lever to select SEL.
- Press RESET button.
- Press button on end of wiper lever to select TIRE PRESSURE.
- Press RESET button.
- Press button on end of wiper lever to select WHEEL CHANGE (SELECT STORE PRESSURES IF RESETTING AIR PRESSURE).
- Press RESET button. Relearn can take 30 minutes to complete.

BMW-2

Inflate all tires to pressure indicated on tire placard.

If equipped with Drive:

- Turn ignition to ON position (engine off).
- Select SETTINGS from Drive menu.
- Select VEHICLE.
- Select TPMS.
- Select RESET.

If not equipped with Drive:

- Turn ignition to ON position (engine off).
- Hold down TIRE PRESSURE WARNING or RUC button (located on instrument panel) until TPMS indicator is illuminated.
- Vehicle must be driven to complete relearn.

LEX-3

A properly formatted scan tool is required to learn new sensor IDs when replacing sensors.

LEX-4

Initialization following rotation and tire replacement:

- Inflate all tires to pressure indicated on tire placard.
- Apply parking brake and turn ignition to ON position (engine off).
- Hold down tire pressure warning reset switch until TPMS indicator blinks 3 times.
- It will take several minutes for the ECU to receive signals from the sensors and complete initialization. *A properly formatted scan tool is required to learn new sensor IDs when replacing sensors.

LEX-5

Initialization following rotation and tire replacement.

SENSOR ACTIVATION TOOLS



A. Bartec Wheelrite Tech500 All-In-One TPMS Service Tool w/ OBD and Wireless Connectivity

- Improved hardware performance
- WLAN and Bluetooth wireless communication
- New easier-to-use menu flow
- New ergonomic enclosure
- Model year 2013 coverage
- Extensive OBD coverage, including GM and Ford
- **More intuitive operation:** ANYONE in your shop can operate this tool
- **More TPMS information:** All right there in the palm of your hand
- **More ergonomic:** Easier to operate single-handedly
- **Wireless communication:** No USB connection to PC required
- Comprehensive audit report
- More on-board DTC information



The Bartec Tech500 All-In-One TPMS Service Tool in use.



469-50000
Bartec Tech500
All-In-One TPMS
Service Tool

| Ascot No. | Mfg. No. | Description |
|-----------|----------|---|
| 469-50000 | WRT500 | Tech500 All-In-One TPMS Service Tool w/ OBD and Wireless Connectivity |

B. Bartec Mitsubishi OBDII Relearn Adapter

- Relearns Mitsubishi Lancer, Mirage, Outlander & RVR by connecting to the Tech400+, Tech400SD & Tech500 Tools
- Works with old activation tools if they work on Mitsubishi sensors
- No additional tools or devices required
- Allows for "pressure drop" sensor activation, no expensive accessory devices or other activation tools are needed
- *Kit includes cable and instruction card*



469-00202
Bartec Mitsubishi
OBDII Relearn
Adapter

| Ascot No. | Mfg. No. | Description |
|-----------|-----------|---|
| 469-00202 | WRT0BD002 | Bartec Mitsubishi OBDII Relearn Adapter Kit |

C. Bartec Tech200 Base Activation Tool

- Comprehensive TPMS coverage, including 2013 models
- Wireless capability using Bluetooth
- Make-Model-Year menu (MMY)
- Lightweight, ergonomic design
- Clearly arranged 3-button key pad
- Rechargeable battery
- USB port
- Activates and reads all known OE TPM sensors
- MMY makes sure correct sensor is activated, avoids crosstalk
- Integration into TPMS HUB via Bluetooth
- Easy to operate with only 3 keys
- Low cost entry level tool



The Bartec Tech200 Base Activation Tool in use.



469-20001
Bartec Tech200
Base Activation Tool

| Ascot No. | Mfg. No. | Description |
|-----------|----------|---|
| 469-20001 | WRT200 | Tech200 Base Activation Tool |
| 469-20222 | WRT200BT | Tech200 Base Activation Tool with Bluetooth |

SENSOR ACTIVATION TOOLS (CONT.)

A



469-46001
Bartec Tech400 Smart
Sensor Programming Fixture

COMING
SOON!

A. Bartec Tech400 Smart Sensor Programming Fixture

- Integrated design, fit and function
- Combines at-the-wheel programming with industry leading OBD function
- Validates the programmed sensor prior to installation
- Intuitive and easy to use programming method
- Works on all CUB variant sensors
- All backed by the very best in class TPMS Technical Support team

| Ascot No. | Mfg. No. | Description |
|-----------|----------------|---|
| 469-46001 | WRT400SDADP001 | Bartec Tech400 Smart Sensor Programming Fixture |

B



469-56002
TPMS Pad
Bartec Tech500
Smart Sensor
Programming
Fixture

NEW
ITEM!

B. Bartec Tech500 Smart Sensor Programming Fixture

The CUB Programming fixture, when added to the Tech500 tool will give the user the ability to program ANY of the Cubelec programmable sensors.

- Combines at the wheel programming with the very best in TPMS OBDII vehicle coverage
- **Product Validation:** As soon as the sensor is programmed, the Tech500 validates the sensor per the Bartec Application Specification
- Easy to understand and use, the tool intuitively walks the technician through the steps
- Works on all Cubelec variant sensors
- Backed by the Bartec TPMS Technical Support Team

| Ascot No. | Mfg. No. | Description |
|-----------|--------------|--|
| 469-56002 | WRT500CPF002 | Tech500 Smart Sensor Programming Fixture |

C



469-50001
TPMS Pad

C. TPMS Pad

- Make-Model-Year look up (MMY)
- 2013 Model Year Coverage
- Easy to use software
- Direct reading from sensor for quick programming
- Connects to PC or LAPTOP using the standard USB cable
- Internet is NOT required
- Ideal for busy shops, frees up your TPMS activation tool
- No batteries are required
- No need to key in the TPMS ID
- No need to type in the VIN

| Ascot No. | Mfg. No. | Description |
|-----------|----------|-------------|
| 469-50001 | TPMS Pad | TPMS Pad |

D



469-50002
TPMS Hub

D. TPMS Hub

- Application driven
- Centralized point for all things TPMS
- Runs the Programming Pad
- Runs the new updater application
- Optional web connectivity for added function

| Ascot No. | Mfg. No. | Description |
|-----------|----------|-------------|
| 469-50002 | TPMS Hub | TPMS Hub |

SENSOR ACTIVATION TOOLS (CONT.)

E. Bartec Wheelrite Tech400SD TPMS Tool

- **Best Coverage:** Activate and Decode ALL known TPMS sensors
- **Accurate Repairs:** Use Make, Model, Year Look-up for accurate repairs, no guessing!
- **Easy Reference:** Displays replacement part number right on the tool
- **Better Diagnostics:** Indicates if proper sensor is installed.
- **Easy Three-Step Process:** Programs Sensor ID's through the OBD
- **On-Board Relearn procedures:** Easy reference means faster repair
- **Removable SD Card:** Update without computer or internet
- **Improved tactile feel and operation:** Raised button key pad
- **UHF Signal Detection:** checks signal of key fobs (RKE)!



The Bartec Tech400SD TPMS Tool in use.



469-40111
Bartec Wheelrite
Tech400SD



469-40112
Tech400SD
Total TPMS Kit



469-40011
One Year
Software
Update

469-40022
Two Year
Software
Update

469-40033
Two Year
Software
Update

| Ascot No. | Mfg. No. | Description |
|-----------|------------|--|
| 469-40111 | WRT400SD | Bartec Tech400SD TPMS Tool |
| 469-40112 | WRT400SDTK | Tech400SD Total TPMS Kit INCLUDES: Tech400SD Tool Kit, Mechanical Tool Kit, and Training Kit |
| 469-40011 | WRTSUL1 | One Year Software Update |
| 469-40022 | WRTSUL2 | Two Year Software Update |
| 469-40033 | WRTSUL3 | Three Year Software Update |

F. Bartec Programming Fixture

- Designed for use with the Bartec Tech400 TPMS reprogramming tool in conjunction with the EZ-Sensor
- The use of the fixture allows for the EZ-Sensor to rest securely in the correct position for relearning
- Is also included in the 469-40010 Bartec EZ-Sensor starter kit as standard procedure

| Ascot No. | Mfg. No. | Description |
|-----------|--------------|----------------------------|
| 469-40035 | WRTEZS-STK35 | Bartec Programming Fixture |



469-40035
Bartec
Programming
Fixture

E

F

SENSOR ACTIVATION TOOLS (CONT.)






469-30002
Bartec Wheelrite
Tech300SD

A. Bartec Wheelrite Tech300SD

- Replaces the Tech300+
- More compact than the Tech400+
- Rechargeable battery
- **SD Card updates:** No computer needed
- **Optional OBD Connector:** Either in kit or sold separate
- *Functions similar to Tech400+*
- Can program EZ-Sensor

Screenshots:

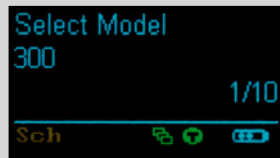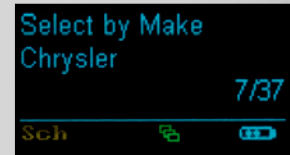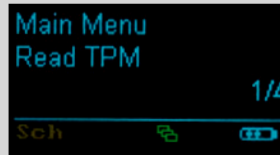

A



469-30005
Tech300SD
Upgrade Kit

| Ascot No. | Mfg. No. | Description |
|-----------|---------------|---|
| 469-30003 | WRT300PSD | Bartec Wheelrite Tech300SD Kit. Includes: Carrying case, relearn magnet, USB cable & user guide |
| 469-30004 | WRT300PSDC | Bartec Wheelrite Tech300SD Combo Kit. INCLUDES: Tech300SD Tool Kit, OBD COMS, and Cable |
| 469-30005 | WRT300POBD | Tech300SD Upgrade Kit. OBD connector for Tech300SD |
| 469-33001 | WRT300PSDSUL1 | 1 Year Software Update License Certificate (Tech300PSDC) |
| 469-33002 | WRT300PSDSUL2 | 2 Year Software Update License Certificate (Tech300PSDC) |
| 469-33003 | WRT300PSDSUL3 | 3 Year Software Update License Certificate (Tech300PSDC) |

**BARTEC WHEELRITE
TECH300SD KITS**



469-30003
Bartec Wheelrite
Tech300SD Kit



469-30004
Bartec Wheelrite
Tech300SD Combo Kit

SENSOR ACTIVATION TOOLS (CONT.)

B. Bartec EZ-Sensor Starter Kits

- Designed to provide all of the necessary startup information for EZ-Sensor users

| Ascot No. | Mfg. No. | Description |
|-----------|--------------|---|
| 469-40010 | WRTEZS-STK10 | Bartec EZ-Sensor Starter Kit The starter kit comes complete with the following tools: <ul style="list-style-type: none"> ▪ Training DVD ▪ Application Chart ▪ User Guide ▪ Quick Start Guide ▪ Programming Fixture |
| 469-40015 | WRTEZS-STK15 | Bartec EZ-Sensor Starter Kit - 2 EZ-Sensors and 2 Aluminum Stems The starter kit comes complete with the following tools: <ul style="list-style-type: none"> ▪ Training DVD ▪ Application Chart ▪ User Guide ▪ Quick Start Guide ▪ Programming Fixture ▪ EZ-Sensor Activation Certificate ▪ 2 EZ-Sensors and 2 Aluminum Replacement Stems Included |
| 469-40020 | WRTEZS-STK20 | Bartec EZ-Sensor Starter Kit - 4 EZ-Sensors and 4 Aluminum Stems The starter kit comes complete with the following tools: <ul style="list-style-type: none"> ▪ Training DVD ▪ Application Chart ▪ User Guide ▪ Quick Start Guide ▪ Programming Fixture ▪ EZ-Sensor Activation Certificate ▪ 4 EZ-Sensors and 4 Aluminum Replacement Stems Included |



Bartec EZ-Sensor Starter Kits

C. Toyota Loop Reset Tool

- Resets TPMS warning light when stuck in loop
- Plugs into OBD II connection and hold button
- No pin jumping required with the WRTRST50
- Accurate and fast

| Ascot No. | Mfg. No. | Description |
|-----------|----------|------------------------|
| 469-00450 | WRTRST50 | Toyota Loop Reset Tool |



469-00450
Toyota Loop Reset Tool

D. Mitsubishi TPMS Reset Tool

- Stand alone, one touch TPMS relearn module
- Enables Mitsubishi Lancer, Outlander & Mirage TPMS learn mode
- Fully updatable via computer
- *Compatible with all TPMS trigger tools capable of triggering Mitsubishi sensors*



| Ascot No. | Mfg. No. | Description |
|-----------|------------|----------------------------|
| 469-05701 | MitsuReset | Mitsubishi TPMS Reset Tool |



469-05701
Mitsubishi TPMS Reset Tool

E. Nissan Reset Tool

- Designed to extinguish the Tire Pressure Warning Light on 2003 & newer Nissan vehicles with TPM Reset Connector

| Ascot No. | Mfg. No. | Description |
|-----------|----------|-------------------|
| 469-71985 | 71985 | Nissan Reset Tool |



469-71985
Nissan Reset Tool

B

C

D

E

SENSOR ACTIVATION TOOLS (CONT.)

A



469-03834
Tire Pressure Monitoring
System Reset Tool



A. Tire Pressure Monitoring System Reset Tool

- The OTC TPR is a fast and simple to use stand alone TPMS activation tool
- Works on all known TPMS sensors
- Bright graphic display and simple navigation buttons enable vehicle selection for fast activation
- Automatically adjusts activation output power to eliminate cross activation of near sensors
- Register new sensor ID's on Asian vehicles
- Use the TPR to activate and decode sensor ID's and transmit them to the Genisys wirelessly
- Bluetooth wireless communication adapter included
- Quick reference reset procedures can be quickly accessed on the Genisys
- *Compatible with the entire Genisys family of scan tools*
- **Includes:** TPR handheld, DB25 wireless adapter, carry case, registration card, user manual for TPR and Genisys® interface

| Ascot No. | Mfg. No. | Description |
|-----------|----------|--|
| 469-03834 | OTC-3834 | Tire Pressure Monitoring System Reset Tool |

B



469-03835
Tire Pressure Monitoring
System Reset Tool Master Kit



B. Tire Pressure Monitoring System Reset Tool Master Kit

- Fast simple programming using OTC TPR Tool
- Eliminates the need to perform relearn procedures when replacing sensors
- No scan tool required for programming
- Replaces over 90% of current TPMS sensors!
- Save money & fit the right part
- Fast simple assembly to the wheel rim
- **Includes:** TPR handheld, DB25 wireless adapter, carry case, registration card, user manual for TPR, and Genisys interface, activation magnet, valve stem torque wrench, digital tire pressure gauge, TPMS Poster, TPMS flip charts, 11mm socket, 12mm socket, and torque tool

| Ascot No. | Mfg. No. | Description |
|-----------|----------|---|
| 469-03835 | OTC-3835 | Tire Pressure Monitoring System Reset Tool Master Kit |



SENSOR ACTIVATION TOOLS (CONT.)

C. TPR Tool with EZ-Sensor™ Programming

- Fast, simple programming using OTC TPR Tool
- Eliminates the need to perform relearn procedures when replacing sensors
- No scan tool required for programming
- EZ-Sensor replaces over 90% of current TPMS sensors!
- Save money & fit the right part
- Fast, simple assembly to the wheel rim
- **Includes:** EZ-Sensor™ programming cradle, EZ-Sensor™ User Guide, Quick Start Guide, USB Cable, EZ-Sensor™ Application Chart, EZ-Sensor™ Training Video, Software Activation Certificate, Six months of updates at www.tpmsupdates.com

| Ascot No. | Mfg. No. | Description |
|-----------|------------|--------------------------------------|
| 469-13834 | OTC-3834EZ | TPR Tool with EZ-Sensor™ Programming |



469-13834
TPR Tool with EZ-Sensor™ Programming

D. Genisys EVO® USA 2012 Kit with Tire Pressure Reset Tool

- **Includes:** Genisys EVO featuring the NEW System 5.0 with Code-Assist™ experienced-based Confirmed Fixes™ from Identifix®, NEW USA 2011 Domestic / Asian with ABS and European 2010 software including Pathfinder, Repair-Trac®, Fast fixes™ information, InfoTech Component Information software, Automated System Test™, OBD II Smart Cable, USA Domestic and ABS/Airbag OEM vehicle cables (for GM, Ford, Chrysler, Jeep, Saturn), manuals, and carrying case
- **Tire Pressure Reset tool kit includes:** TPR handheld, DB25 wireless adapter, registration card, user manual for TPR and Genisys interface
- **NOTE:** OEM cables may be required for certain vehicle system functions. Additional OEM cables are available individually or in convenient kits: Asian OEM Cable Kit 3421-94 and European OEM Cable Kit 3421-75.

| Ascot No. | Mfg. No. | Description |
|-----------|-------------|---|
| 351-03874 | OTC-3874TPR | Genisys EVO® USA 2012 Kit with Tire Pressure Reset Tool |



351-03874
Genisys EVO® USA 2012 Kit with Tire Pressure Reset Tool



C

D

SENSOR ACTIVATION TOOLS (CONT.)

A. Ateq VT55 OBDII TPMS Tool Kit

- Decodes and displays TPM sensor DATA (ID, Pressure, TPM Battery Status, Temperature, G-Force)
- Relearn procedures build on board
- Part number lookup
- Compatible with all OEM, Universal and programmable sensors
- Key fob tester
- RF detection
- Toyota, Scion, Lexus ECU unlock
- Updatable (Through PC / SD Card)
- Multilingual
- DTC retriever
- Audit report
- Kit includes the following:** VT55 diagnostic tool, OBDII module, RJ45 cable, USB cable UPDATE/Print, carrying pouch, relearn magnet, wall charger, user guide, software CD

| Ascot No. | Mfg. No. | Description |
|-----------|-----------|-------------------------------|
| 469-05501 | VT55OBDII | Ateq VT55 OBDII TPMS Tool Kit |

B. Ateq VT56 OBDII TPMS Tool Kit

- Full color 4" screen
- Icon driven intuitive learning
- Part number lookup
- OBD II for ECU reset
- Dated history file
- Programs for all popular programmable sensors
- OBD II position
- Key fob tester
- RF signal tester
- Help screens
- WIFI connection to PC
- WIFI updates
- Bluetooth connection for printing
- Barcode scanner for vehicle identification
- Docking cradle with thermal printer
- Update via USB, WIFI & SD card
- TPMS DTC retriever
- US/European/Asian vehicles
- Full relearn procedures
- Kit includes the following:** VT56 diagnostic tool, OBDII interface connector, docking station with thermal printer (optional), OBDII to VT56 ethernet cable, USB PC cable, power adapter, Update software, Quickstart user manual, Ateq hard kit carry case

| Ascot No. | Mfg. No. | Description |
|-----------|-----------|-------------------------------|
| 469-05601 | VT56OBDII | Ateq VT56 OBDII TPMS Tool Kit |

C. TPMS Transmitter Check Box

- Identify a difference between gauge and your vehicle dash reading
- Helps eliminate possible transmitter defects or failures before mounting and inflating transmitter on wheel
- Portable and easy to use
- An ideal device to ensure quality service
- Designed for use with all styles of direct TPMS transmitters
- Equipped with a regulator and gauge to ensure proper functionality

| Ascot No. | Mfg. No. | Description |
|-----------|----------|----------------------------|
| 469-03200 | OCB | TPMS Transmitter Check Box |

A



469-05501
Ateq VT55 OBDII TPMS Tool Kit

B



469-05601
Ateq VT56 OBDII TPMS Tool Kit

C



469-03200
TPMS
Transmitter
Check Box

UNIVERSAL TPMS TRANSMITTERS: EZ-SENSORS



A. EZ-Sensor Programmable TPMS Sensors

- Designed to eliminate multiple sensors required for TPMS work
- **Applications:** Covers most GM, Chrysler, Honda, Nissan, Toyota, Lexus, Scion, Ford, Lincoln, & Mercury vehicles and some Mitsubishi, Subaru & Suzuki vehicles
- Fully programmable
- 33200 EZ-Sensor features Wireless Auto Locate or WAL that allows the vehicle's TPMS system to locate and identify each TPMS sensor's specific location
- *Compatible with Bartec, Schrader and SPX/OTC programming tools*
- *Replacement aluminum valve stem*

| Ascot No. | Mfg. No. | Description |
|-----------|----------|--|
| 461-33000 | 33000 | EZ-Sensor 315 MHz Programmable TPMS Sensor |
| 461-33200 | 33200 | EZ-Sensor 433 MHz Programmable TPMS Sensor w/ Wireless Auto Locate Feature |

B. EZ-Sensor Replacement Aluminum Valve Stem

- Use Schrader Service Pack 20014

| Ascot No. | Mfg. No. | Description |
|-----------|----------|---------------------------------|
| 469-34000 | 34000 | Replacement Aluminum Valve Stem |

C. Replacement Snap-In Valve for Schrader Snap-In Transmitters

- Rubber stem & attaching screw for Schrader snap-in transmitters
- Cap & core included
- Requires T-10 Torx Tool for assembly/disassembly

| Ascot No. | Mfg. No. | Description | Qty./Box |
|-----------|----------|--|----------|
| 469-20018 | 20018 | Replacement Snap-In Valve for Schrader 20153 Transmitter | 50 |

D. EZ Tire TPMS Sensor Kit

- 2 part numbers (315 MHz to start) covering nearly 90% of the market – just like EZ-sensor™
- Schrader patented technology offers a truly programmable solution
- **Performs identically to the original OEM-equivalent sensor**
- Comes "blank" and is fully programmable to the selected Make/Model/Year
- Re-programmable multiple times
- A fast and efficient EZ-install reduces cost of servicing TPMS-equipped vehicles
- Fully programmable using many existing scan/programming tools
- **The EZ-tire kit contains:** 4 overmolded sensor units, 4 rubber housing mounts, 4 two-piece mounting tools, 1 container of adhesive (5g), 1 installation guide



EZ-SENSOR PROGRAMMABLE TPMS SENSORS



NEW ITEM!



| Ascot No. | Mfg. No. | Description |
|-----------|----------|---------------------------------|
| 461-55315 | 550315 | 315 MHz EZ Tire TPMS Sensor Kit |

REDI-Sensor™

UNIVERSAL TPMS TRANSMITTERS: REDI-SENSORS



461-07011
REDI-Sensor Universal
Transmitter, Snap-In Style



461-07001; 461-07004
REDI-Sensor Universal
Transmitter, Clamp-In Style



461-07003
315MHz REDI-Sensor
Universal Transmitter
(Clamp-In Style)

**NEW
ITEM!**



A small sampling of existing major TPMS scan tools that are compatible with the REDI-Sensor Universal Transmitter.

A. REDI-Sensor Universal Transmitter

- Installs right out of the box
- No programming required, saving you 8-10 minutes per vehicle
- Reduces replacement sensor inventory
- Adjustable valve stem design
- Fits over 90% of the market**
- No additional training required
- All REDI-Sensors are available in a rubber stem format

| Ascot No. | Mfg. No. | Description |
|-----------|----------|--|
| 461-07001 | 7001HP | 315MHz REDI-Sensor Universal Transmitter (Clamp-In Style) |
| 461-07002 | 7002 | REDI-Sensor for Honda, Hyundai, Kia, Lexus, Toyota & Scion |
| 461-07004 | 7004 | 433MHz REDI-Sensor Universal Transmitter (Clamp-In Style) |
| 461-07011 | 7001HP-R | 315MHz REDI-Sensor Universal Transmitter (Snap-In Style) |

B. 315MHz REDI-Sensor Universal Transmitter (Clamp-In Style)

- Installs right out of the box
- No additional training required
- Adjustable valve stem design
- Fits Volkswagen, Mercedes-Benz, Audi, Lexus, Volvo, Toyota, Nissan, Infiniti, Chevrolet, GMC, Hummer, Isuzu, and Subaru

| Ascot No. | Mfg. No. | Description |
|-----------|----------|---|
| 461-07003 | 7003 | 315MHz REDI-Sensor Universal Transmitter (Clamp-In Style) |

**NEW
ITEM!**

WORKS WITH EXISTING MAJOR TPMS SCAN TOOLS:

If a shop has the tools to handle OE sensors, it's ready for REDI-Sensor. Unlike other sensors that require the purchase of specialized tools and software upgrades, no additional purchases, training or investments are needed with REDI-Sensor.


It works with all major TPMS scan tools, including ATEQ, Bartec, OTC and T.I.P.S. With REDI-Sensor, technicians can use the OE scan tool procedures for TPMS service - no new service routines are required.

FASTER HUNT MODE:

REDI-Sensor saves valuable time during the vehicle relearn process, when using trigger tools that incorporate a hunt mode. REDI-Sensor uses an "intelligent design" to wake faster and deliver positive results sooner. This prevents the relearn process from timing out, which eliminates the need to redo the procedure.

BUILT TO DELIVER LONG-LIFE RELIABILITY:

Waterproof design
resists tire air moisture

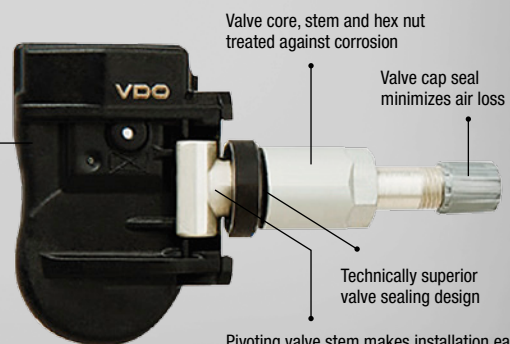

UNIVERSAL TPMS TRANSMITTERS: REDI-SENSOR ACCESSORIES

REDI-Sensor™

A. REDI-Sensor Valve Stems

| Ascot No. | Mfg. No. | Description | Qty./Box |
|-----------|----------|---|----------|
| 469-00770 | VS-70 | REDI-Sensor Replacement Valve Stem w/ All Components | 20 |
| 469-00771 | VS-70B | REDI-Sensor Valve with Black Anodized Nut and Black Cap | 20 |
| 469-00772 | VS-70S | REDI-Sensor Valve Stem with Cap and Core Assembled | 20 |

B. Dill Aluminum Replacement TPMS Stems

- Metal Replacement Clamp-In Valve for GM, Ford, Dodge Ram, Subaru & Suzuki
- Made from anodized aluminum
- T-10 screw included
- Packaged 20 per box

| Ascot No. | Mfg. No. | Description |
|-----------|----------|---|
| 469-00925 | VS-925A | Dill Aluminum Replacement TPMS Stem |
| 469-01925 | VS-925B | Dill Aluminum Replacement TPMS Stem (Black) |
| 469-02925 | VS-925C | Dill Aluminum Replacement TPMS Stem (Chrome Plated) |

C. Rubber TPMS Snap-In Replacement Valves

- Rubber stem & attaching screw for snap-in transmitter
- Cap & core included
- Requires T-10 Torx Tool for assembly/disassembly

| Ascot No. | Mfg. No. | Description | Qty./Box |
|-----------|----------|---|----------|
| 469-00090 | VS-90 | Rubber Valve Stem Kit for New Dodge and GM Transmitters | 25 |
| 469-00950 | VS-950 | Rubber Snap-In Replacement Valve for GM & Ford Transmitters | 25 |
| 469-00065 | VS-65 | Rubber Snap-In Stem for Dodge Jeep w/ Square Brass End | 25 |
| 469-01010 | VS-1010 | Rubber Snap-In Stem for Hyundai Santa Fe | 25 |
| 469-09305 | VS-930 | Dill Rubber Snap-In Replacement Valve for GM Transmitters | 25 |

D. Replacement Rubber Valve & Screw for 7001HP-R Redi-Sensor

| Ascot No. | Mfg. No. | Description | Qty./Box |
|-----------|----------|---|----------|
| 469-00080 | VS-80 | Repl. Rubber Valve & Screw for 7001HP-R Redi-Sensor | 25 |

E. TPMS Kit for REDI-Sensor

| Ascot No. | Mfg. No. | Description |
|-----------|----------|--|
| 469-07000 | 7000K | TPMS Kit for REDI-Sensor |
| 469-07020 | 7020K | TPMS Replacement Component Kit for Redi-Sensor |



REDI-SENSOR VALVE STEMS




A

DILL ALUMINUM REPLACEMENT TPMS STEMS



B

RUBBER TPMS SNAP-IN REPLACEMENT VALVES

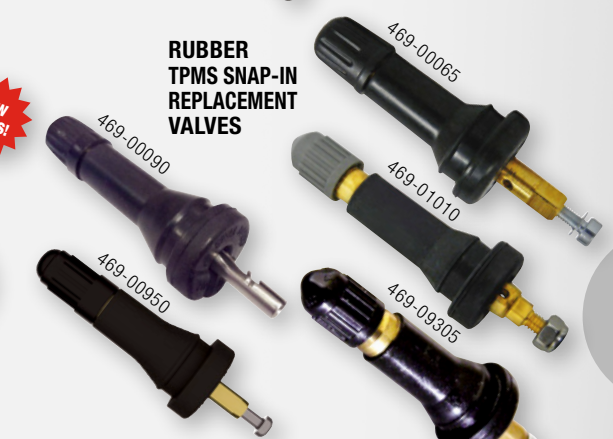

C

469-00080 Replacement Rubber Valve & Screw for 7001HP-R Redi-Sensor

D



SCHRADER TPMS TRANSMITTERS

Schrader TPMS Transmitters

- Includes: Transmitter, grommet, nut, cap & core



461-20064
Nissan Replacement
Transmitter



461-20099
Dodge Sprinter Van 2007-2009
Replacement Transmitter



461-20335
Chrysler Siemens
Replacement Transmitter

| Ascot No. | Mfg. No. | O.E. No. | Description |
|-----------|----------|---|--|
| 461-20028 | 20028 | 5208-8990AC | Chrysler Repl. Transmitter |
| 461-20034 | 20034 | MN103081 | Mitsubishi Repl. Transmitter |
| 461-20064 | 20064 | 40700-CD001 | Nissan Repl. Transmitter |
| 461-20069 | 20069 | 40700-CK002 | Nissan Repl. Transmitter For Vehicles With Steel Wheels |
| 461-20076 | 20076 | 25758220 | GM 2006 Cadillac & Corvette Repl. Transmitter |
| 461-20077 | 20077 | 4D0907275C | Audi, Bentley, Ferrari, MB, Porsche & VW Repl. Transmitter |
| 461-20078 | 20078 | 4F0907275B | Audi, Bentley, Porsche & VW Repl. Transmitter |
| 461-20079 | 20079 | 4D0907275A | Audi, BMW, MB Porsche & VW Repl. Transmitter |
| 461-20080 | 20080 | 36118378682 | BMW Repl. Transmitter |
| 461-20081 | 20081 | 28103-AG00A | Subaru Repl. Transmitter |
| 461-20082 | 20082 | 96484045 | Daewoo Repl. Transmitter |
| 461-20083 | 20083 | 36236781847 | BMW, Mini, Porsche & Rolls Royce Repl. Transmitter |
| 461-20084 | 20084 | 224551 | Ferrari, Porsche & VW Repl. Transmitter |
| 461-20085 | 20085 | 52933-4D200 | Hyundai/Kia Repl. Transmitter |
| 461-20086 | 20086 | 52933-2G200 | Hyundai/Kia Repl. Transmitter |
| 461-20087 | 20087 | 4313054J20 | Suzuki Repl. Transmitter |
| 461-20088 | 20088 | 1K0907253D & E | Audi & VW Repl. Transmitter |
| 461-20089 | 20089 | 68038945AA | Dodge Sprinter Van 2007-2009 Repl. Transmitter |
| 461-20090 | 20090 | XR855950 & C2C25519 | Jaguar & Land Rover Repl. Transmitter |
| 461-20091 | 20091 | LR018860 | Jaguar & Land Rover Repl. Transmitter |
| 461-20092 | 20092 | 529332M000 | Kia Repl. Transmitter |
| 461-20093 | 20093 | GN3A-37-140B | Mazda Repl. Transmitter |
| 461-20094 | 20094 | 25407917 | Mercedes Repl. Transmitter |
| 461-20095 | 20095 | 25408017 | Mercedes Repl. Transmitter |
| 461-20096 | 20096 | 4L2T-1A150-BA | Ford Small Truck Repl. Transmitter |
| 461-20097 | 20097 | 31280297 | Volvo Repl. Transmitter |
| 461-20098 | 20098 | 42753-STK-A04 | Acura, Honda Repl. Transmitter |
| 461-20099 | 20099 | 42752SWA306 | Honda Repl. Transmitter |
| 461-20100 | 20100 | 42753-TP6-A82 | Honda 2010 Crosstour Repl. Transmitter |
| 461-20103 | 20103 | 4F0-907-275D | Beru Repl. Transmitter Only |
| 461-20107 | 20107 | 15114379 | GM Large Truck Repl. Transmitter |
| 461-20115 | 20115 | 15136883 | GM 2004 Large SUV Repl. Transmitter |
| 461-20116 | 20116 | 25774005 | GM Small Truck Repl. Transmitter |
| 461-20117 | 20117 | 25773946 | GM Cadillac & Corvette Repl. Transmitter |
| 461-20131 | 20131 | 15122618 | Hummer Repl. Transmitter |
| 461-20135 | 20135 | 5L1Z-1A150-AA | Ford Large Truck Repl. Transmitter |
| 461-20153 | 20153 | 70503153 | GM Snap-In Type Repl. Transmitter - Complete Unit |
| 461-20156 | 20156 | 8651700 | Volvo Repl. Transmitter |
| 461-20158 | 20158 | 15268606, 10394110 | GM 2006 Repl. Transmitter |
| 461-20159 | 20159 | 13227143 | Saab Repl. Transmitter |
| 461-20161 | 20161 | 40700-CK-001 | Nissan Repl. Transmitter For Vehicles With Alloy Wheels |
| 461-20315 | 20315 | 9L3Z1189A | Ford 09/10 Snap-In Style Repl. Transmitter Complete Unit |
| 461-20335 | 20335 | 04727392AD, 5127-335AB, 5127-335AD, SE57243 | Chrysler Siemens Repl. Transmitter |
| 461-20398 | 20398 | 56029398AB | Chrysler/Jeep Repl. Transmitter |
| 461-20720 | 20720 | 42756TK4 A01 | Acura Repl. Transmitter |
| 461-28004 | 28004 | 04815132AB | Chrysler Prowler Repl. Transmitter |

Schrader TPMS Transmitters continue on the next page ➔



SCHRADER TPMS TRANSMITTERS (CONT.)

| Ascot No. | Mfg. No. | O.E. No. | Description |
|-----------|----------|------------------------|--|
| 461-28006 | 28006 | 10438853 | 97-00 Corvette Repl. Transmitter |
| 461-28078 | 28078 | 24437708 | Saab Repl. Transmitter |
| 461-28081 | 28081 | 36106790054 | BMW Repl. Transmitter |
| 461-28082 | 28082 | 36146752128 | BMW, Land Rover Repl. Transmitter |
| 461-28087 | 28087 | 99760602120 | Porsche Repl. Transmitter |
| 461-28096 | 28096 | 4250A225 | Mitsubishi Repl. Transmitter |
| 461-28129 | 28129 | 4250A030 | Mitsubishi Repl. Transmitter |
| 461-28167 | 28167 | 40700JA01A | Nissan Repl. Transmitter O.E. 40700-JA01A |
| 461-28203 | 28203 | 28103AG01A | Subaru Snap-In Repl. Transmitter OE 28103AG01A |
| 461-28204 | 28204 | 40700JA01B | Nissan Repl. Transmitter O.E. 40700-JA01B |
| 461-28206 | 28206 | 20922900 | GM/Chevy Repl. Transmitter |
| 461-28210 | 28210 | 40700JK00B | Nissan/Infiniti Repl. Transmitter |
| 461-28214 | 28214 | 45421518 | Mercedes Gen Alpha WALA Repl. Transmitter |
| 461-28291 | 28291 | 56029400AB | Chrysler Repl. Transmitter |
| 461-28300 | 28300 | 426070C010 | Toyota Repl. Transmitter |
| 461-28305 | 28305 | 426070C020 | Toyota Repl. Transmitter |
| 461-28308 | 28308 | 56053036AA | Chrysler Snap-In Repl. Transmitter |
| 461-28310 | 28310 | 4260724010 | Lexus Repl. Transmitter |
| 461-28315 | 28315 | 4260724020 | Lexus Repl. Transmitter |
| 461-28320 | 28320 | 4260724030 | Lexus Repl. Transmitter |
| 461-28325 | 28325 | 426724040 | Lexus Repl. Transmitter |
| 461-28335 | 28335 | 426724040 | Lexus & Toyota Repl. Transmitter |
| 461-28342 | 28342 | 40700 1PA0A | Nissan Repl. Transmitter |
| 461-28345 | 28345 | 4260735010 | Lexus & Toyota Repl. Transmitter |
| 461-28355 | 28355 | 42607AD020 | Toyota Repl. Transmitter |
| 461-28360 | 28360 | 4260706011 | Toyota Repl. Transmitter |
| 461-28362 | 28362 | 31200923 | Vovlo Repl. Transmitter |
| 461-28365 | 28365 | 4260733011 | Lexus, Scion, Toyota Repl. Transmitter |
| 461-28370 | 28370 | 4260733021 | Lexus & Toyota Repl. Transmitter |
| 461-28380 | 28380 | 42607AD010 | Toyota Repl. Transmitter |
| 461-28385 | 28385 | 6F2Z1A189A | Ford Banded Repl. Transmitter |
| 461-28390 | 28390 | 7L1Z1A189A | High-Pressure Ford Banded Repl. Transmitter |
| 461-28395 | 28395 | 8C2Z1A189A | Ford Banded Repl. Transmitter |
| 461-28423 | 28423 | 20964159 | Camaro ZL1 Repl. Transmitter |
| 461-28434 | 28434 | 56029319AC | Chrysler Snap-In Repl. Transmitter |
| 461-28461 | 28461 | 56029319AC, 68137699AA | Chrysler Snap-In Repl. Transmitter |
| 461-28505 | 28505 | 52933-2V000 | Hyundai Snap-In Repl. Transmitter |
| 461-28586 | 28586 | 68193586AA | Dodge Snap-In Repl. Transmitter |
| 461-28670 | 28670 | 426070C050 | Toyota Repl. Transmitter |
| 461-28720 | 28720 | 42753SNAA83 | Honda Acura Repl. Transmitter |
| 461-28849 | 28849 | 529332F000 | Hyundai Kia Repl. Transmitter |
| 461-28981 | 28981 | 56029398AB | Acura, Honda Repl. Transmitter |
| 461-28982 | 28982 | 06421-S9V-A01 | Honda Repl. Transmitter |
| 461-28983 | 28983 | 958104D100 | Hyundai Repl. Transmitter |

**NEW
ITEMS!**

**NEW
ITEM!**



461-20398
Chrysler/Jeep
Replacement Transmitter



461-28081
BMW Replacement
Transmitter



461-28308
Chrysler Snap-In
Replacement Transmitter



DILL TPMS TRANSMITTERS

A. Dill TPMS Transmitters

- Includes: Transmitter, grommet, nut, cap & core

461-01048
Lear Ford
Banded
Transmitter



461-11048
High Pressure
Ford Banded
Transmitter



461-01051
Siemens Chrysler
Replacement
Transmitter



461-01057
Entire Acura/Honda
Replacement Transmitter



**NEW
ITEM!**

| Ascot No. | Mfg. No. | O.E. No. | Description |
|-----------|----------|--|---|
| 461-01027 | 1027 | 36236779490 | Lear BMW Repl. Transmitter |
| 461-01028 | 1028 | 529334D200 | Lear Hyundai/Kia Repl. Transmitter |
| 461-01029 | 1029 | 529332F000 | Entire Kia Spectra/Rio Repl. Transmitter |
| 461-01041 | 1041 | Check VIN | Volkswagen Repl. Transmitter w/ O-Ring Nut |
| 461-01042 | 1042 | 68006771AA | Dodge Sprinter Repl. Transmitter |
| 461-01043 | 1043 | 68001698AA | Siemens 2008 Chrysler Repl. Transmitter |
| 461-01044 | 1044 | 30666931, 6G92-1A159-BB | 2007-2008 Volvo Repl. Transmitter |
| 461-01045 | 1045 | LR032833 | 2008-2011 Land Rover Replacement Transmitter - 315 MHz |
| 461-01046 | 1046 | Check VIN | Siemens Land Rover/Jaguar Repl. Transmitter - 433 MHz |
| 461-01047 | 1047 | 10394110 | Siemens 2007-2008 Clamp-In Repl. Transmitter |
| 461-01048 | 1048 | 6F221Z189A | Lear Ford Banded Repl. Transmitter |
| 461-01049 | 1049 | Check VIN | Siemens Mercedes Repl. Transmitter - 433 MHz |
| 461-01051 | 1051 | 4250A225 | Siemens Chrysler Repl. Transmitter |
| 461-01052 | 1052 | Check VIN | Siemens 2004 Chrysler Repl. Transmitter |
| 461-01053 | 1053 | Check VIN | Siemens Volkswagen Repl. Transmitter |
| 461-01054 | 1054 | Check VIN | Siemens Mercedes Repl. Transmitter |
| 461-01055 | 1055 | Check VIN | Siemens Land Rover/Jaguar Repl. Transmitter |
| 461-01056 | 1056 | GN3A-37-140B | Siemens Mazda Repl. Transmitter |
| 461-01057 | 1057 | 06421-S3V-A02 | Entire Acura/Honda Repl. Transmitter |
| 461-01058 | 1058 | 0642SCVA00 | Entire Hyundai/Kia Repl. Transmitter |
| 461-01059 | 1059 | 06421S9VA01 | Entire Honda Repl. Transmitter |
| 461-01068 | 1068 | 59233-2G200 | Hyundai/Kia Repl. Transmitter |
| 461-01203 | 1203 | 42607-0C010/AD010 | Toyota Repl. Transmitter |
| 461-01204 | 1204A | 42607-33021 | Aftermarket Pacific/Toyota Repl. Transmitter |
| 461-01205 | 1205 | 42607-35010 | Toyota Older 4Runner, Lexus GX-470 Repl. Transmitter |
| 461-01207 | 1207 | 42607-0C040/0C060 | Toyota Replacement Transmitter |
| 461-01208 | 1208 | 42753-SWA-316 | Honda Accord/CRV/Fit Repl. Transmitter |
| 461-01209 | 1209 | 42753-STK-A04 | Honda Pilot/Some Acura Repl. Transmitter |
| 461-01212 | 1212 | 42753-SNA-A83 | Honda Civic Repl. Transmitter |
| 461-01214 | 1214 | 42753-TK4-A01 | Honda/Acura Repl. Transmitter |
| 461-01216 | 1216 | 40700-1LA0A, 40700-1LA0B, 40700-1LA0C | Nissan Repl. Transmitter |
| 461-01217 | 1217-WH | 42607-24010 | Lexus SC 430 White Replacement Transmitter |
| 461-01218 | 1218 | 42607-06020 | 2012 Toyota Camry, Yari Replacement Transmitter |
| 461-01219 | 1219 | 42753-SZA-A12 | 2009-2012 Honda Pilot w/ Steel Wheels Replacement Transmitter |
| 461-02112 | 2112 | 6004985 | Tesla Replacement Transmitter |
| 461-05507 | 5507 | 52933-2M000, 52933-2L500, 52933-2L700 | Hyundai/Kia Repl. Transmitter |
| 461-05511 | 5511 | 42753-TP6-A82, 42753-TP6-A82-M1 | Honda/Acura Repl. Transmitter |
| 461-05512 | 5512 | 42753-TX4-A51 | 2013 Acura RDX Replacement Transmitter |
| 461-05513 | 5513 | 42753-TX6-A81 | 2013 Acura ILX Replacement Transmitter |
| 461-05555 | 5555 | 4070-3AN0A | Nissan Replacement Transmitter |
| 461-05556 | 5556 | 40700-3JA0A | 2013 Nissan Altima/Pathfinder Replacement Transmitter |
| 461-05557 | 5557 | 40700-3AN1A | Nissan Replacement Transmitter |
| 461-05775 | 5775 | 68193586AA | 2013 Dodge Dart/Cadillac ATS Replacement Transmitter |

Dill TPMS Transmitters continue on the next page ➔



DILL TPMS TRANSMITTERS (CONT.)

3 NEW ITEMS!

| Ascot No. | Mfg. No. | O.E. No. | Description |
|-----------|----------|--------------------|---|
| 461-06815 | 6815 | 68157568AB | 2014 Dodge Ram/Jeep Grand Cherokee Replacement Transmitter |
| 461-06825 | 6825 | 68239725AA | Snap-In Rubber Stem and Sensor for Inner Dual on Dodge Ram |
| 461-06829 | 6829 | 68239729AA | Clamp-In Stem and Sensor for Outer Alloy on Dodge Ram |
| 461-08004 | 8004 | 4815132AB, 4815132 | Chrysler/Dodge/Jeep Repl. Transmitter |
| 461-08006 | 8006 | 10438853 | 1997-2000 Corvette Repl. Transmitter |
| 461-09001 | 9001 | A0008223306 | HUF RDE 003 Repl. Transmitter for Audi/Mercedes - 433MHz |
| 461-09002 | 9002 | 36118378682 | HUF RDE 002 Repl. Transmitter for BMW 3/5/7 Series - 433 MHz |
| 461-09003 | 9003 | 36146752128 | HUF RDE 003 Repl. Transmitter for BMW X5/Land Rover - 433MHz |
| 461-09004 | 9004 | A0008223406 | HUF RDE 004 Repl. Transmitter for Mercedes |
| 461-09005 | 9005 | 7L0907275 | HUF RDE 005 Cayenne/Touareg Replacement Transmitter - 433 MHz |
| 461-09007 | 9007 | 4F0907275 | HUF RDE 007 Repl. Transmitter for Audi A6 - 433 MHz |
| 461-09008 | 9008 | 997 606 021 20 | Porsche 911 Repl. Transmitter |
| 461-09010 | 9010 | N/A | Prevost/Volvo/Nova Bus & ITEC Truck Replacement Transmitter |
| 461-09011 | 9011 | 4F0907275D | 2010 Audi Repl. Transmitter |
| 461-09012 | 9012 | 3610679 054 | 2010 BMW, Mini Cooper Repl. Transmitter |
| 461-09013 | 9013 | 3AA 907 275-B | 2013 Volkswagen CC Replacement Transmitter |
| 461-09017 | 9017 | 36 10 6 798 872 | 2013 BMW 3-Series Replacement Transmitter |
| 461-09204 | 9204 | 40700-1AA0D | Nissan Replacement Transmitter |
| 461-09315 | 9315-625 | 9L3Z-1A-189A | Ford Replacement Transmitter w/ VS-919 Stem |
| 461-09398 | 9398 | 56029398AB | Chrysler Snap-In Replacement Transmitter |
| 461-09481 | 9481 | 56029481AB | 2012 Jeep Liberty, Wrangler Replacement Transmitter |
| 461-09505 | 9505 | 52933-2V000 | Hyundai Velostar, Azera Replacement Transmitter |
| 461-11048 | 1048-HP | 8C2Z1A189A | Lear High Pressure Ford Banded Repl. Transmitter |
| 461-11204 | 1204 | 42607-33021 | Toyota/Lexus Replacement Transmitter |
| 461-11206 | 1206A | 42607-0C050 | Aftermarket Pacific/Toyota Repl. Transmitter |
| 461-11217 | 1217-BL | 42607-24020 | Lexus SC 430 Blue Replacement Transmitter |
| 461-21217 | 1217-RD | 42607-24030 | Lexus SC 430 Red Replacement Transmitter |
| 461-31217 | 1217-YL | 42607-24040 | Lexus SC 430 Yellow Replacement Transmitter |



461-01204
Aftermarket
Pacific/Toyota
Replacement
Transmitter



461-06815
2014 Dodge Ram/
Jeep Grand Cherokee
Replacement Transmitter



461-09011
2010 Audi
Replacement
Transmitter

B. HUF Tire Pressure Monitoring System (TPMS) Transmitters

- Valve insert & transmitter sold separately
- Two-piece design to adapt to rim configurations
- For use with most European vehicles equipped with TPMS. Call for application information.



| Ascot No. | Mfg. No. | Description |
|-----------|----------|------------------------------------|
| 461-10001 | RDE001 | Audi, MB Replacement Transmitter |
| 461-10002 | RDE002 | BMW Replacement Transmitter |
| 461-10003 | RDE003 | Land Rover Replacement Transmitter |

| Ascot No. | Mfg. No. | Description |
|-----------|----------|---------------------------------|
| 461-10005 | RDE005 | Select Porsche & VW Transmitter |
| 461-10007 | RDE007 | Audi A4 Replacement Transmitter |

B



SMART SENSOR PRO+



469-17144
Smart Sensor Pro+
Programming/
Scanning Tool

REPLACEMENT SENSORS & STEMS FOR THE SMART SENSOR PRO+



461-17431

469-17438

461-17432

469-17439

461-17433

469-17436

461-17434

A. Smart Sensor Pro+ Programming/Scanning Tool

- Quickly & easily program Smart Sensor “blank” sensors to emulate the protocol
- Program a Smart Sensor in seconds
- Copies the original sensor ID to Smart Sensor
- Recognized by specific vehicles
- Scans OE sensors
- Upgradeable!
- *Replacement sensors and stems available*



The Smart Sensor Pro+ Programming/Scanning Tool with Replacement Sensors* (available separately).

| Ascot No. | Mfg. No. | Description |
|-----------|----------|---|
| 469-17144 | 17-144 | Smart Sensor Pro+ Programming/Scanning Tool |

B. Replacement Sensors and Replacement Stems for the Smart Sensor Pro+

- 315 MHz (green) and 433 MHz (brown) are available
- 90% market coverage with 2 sensors
- Easy to use

| Ascot No. | Mfg. No. | Description |
|-----------|----------|--|
| 461-17431 | 17-43011 | 315 MHz Smart Sensor Snap-In (Green) |
| 461-17432 | 17-43012 | 433 MHz Smart Sensor Snap-In (Brown) |
| 461-17433 | 17-43013 | 315 MHz Replacement Sensor (Green) |
| 461-17434 | 17-43014 | 433 MHz Replacement Sensor (Brown) |
| 469-17436 | 17-43016 | Replacement Smart Sensor Rubber Stem Snap-In Valve |
| 469-17438 | 17-43018 | Black Replacement Stem |
| 469-17439 | 17-43019 | Aluminum Replacement Stem |

A

B



MULTI-APPLICATION TPMS SENSORS

A. Multipro Multi-Protocol TPMS Sensors

- **Out of the box solution:** Pre-programmed, ready to use (just like an OE sensor)
- **Both snap-in and clamp-in valve options:** Valve stems are interchangeable
- Can be triggered, read and relearned with all major TPMS scan tools
- Patented technology
- Validated to meet OE standards

| Ascot No. | Mfg. No. | Description |
|-----------|----------|--|
| 461-17451 | 17-45001 | 315 MHz GM Snap-In Multipro-1 Sensor |
| 461-17452 | 17-45002 | 315 MHz Ford Snap-In Multipro-2 Sensor |
| 461-17463 | 17-45003 | 433 MHz Ford Snap-In Multipro-3 Sensor |
| 461-17454 | 17-45004 | 315 MHz Toyota/Nissan Clamp-In Multipro-4 Sensor |

| Ascot No. | Mfg. No. | Description |
|-----------|------------|--|
| 461-17455 | 17-45005 | 315 MHz Honda Clamp-In Multipro-5 Sensor |
| 461-17456 | 17-45006 | 315 MHz Hyundai/Kia Clamp-In Multipro-6 Sensor |
| 469-17498 | 17-45098 | Replacement Snap-In Valve for Multipro Sensor |
| 469-17499 | 17-45099 | Replacement Clamp-In Valve for Multipro Sensor |
| 469-17224 | 17-20204AK | Replacement Parts Kit for Multipro Sensor |



461-17451
315MHz GM Snap-In
Multipro-1 Sensor

461-17454
315MHz Toyota/
Nissan Clamp-In
Multipro-4 Sensor

469-17498
Replacement
Snap-In Valve for
Multipro Sensor

469-17499
Replacement
Clamp-In Valve for
Multipro Sensor

A



TOOLS, ACCESSORIES & KITS

A

SCHRADER TPMS ACCESSORY KITS

469-20020
Replacement
Stem for Chrysler,
Dodge & Jeep
Replacement
Transmitters



A. Schrader Accessory Kits

- The OEM requires that the four sealing components be replaced when re-installing a TPMS sensor. The replacement components are supplied in TPMS accessory kits, which are sensor specific.
- **Each TPMS accessory kit contains:** 1 Nut, 1 Valve Core, 1 Cap, 1 Grommet

B

469-20097
Small Assortment Kit



| Ascot No. | Mfg. No. | Description |
|-----------|----------|---|
| 469-20002 | 20002 | Accessory Kit For Ford Transmitters (Replaces 469-29601 & 469-23501) |
| 469-20003 | 20003 | Accessory Kit For Chrysler Transmitters (Replaces 469-21701 & 469-22801) |
| 469-20004 | 20004 | Accessory Kit For GM Transmitters (Replaces 469-20701 & 469-21601) |
| 469-20005 | 20005 | Accessory Kit For Steel Wheel Nissan Transmitters |
| 469-20006 | 20006 | Accessory Kit For Hummer Transmitters |
| 469-20007 | 20007 | Accessory Kit For Alloy Wheel Nissan Transmitters |
| 469-20009 | 20009 | Accessory Kit for Suzuki Replacement Transmitter |
| 469-20010 | 20010 | Accessory Kit for Prowler Replacement Transmitter |
| 469-20011 | 20011 | Accessory Kit for Subaru Replacement Transmitter |
| 469-20012 | 20012 | Accessory Kit for Corvette Replacement Transmitter |
| 469-20013 | 20013 | Accessory Kit for Dodge Nitro Transmitters |
| 469-20014 | 20014 | Accessory Kit for Nissan Transmitters |
| 469-20015 | 20015 | Accessory Kit for GM/TRW Transmitters |
| 469-20016 | 20016 | Accessory Kit for Mercedes Transmitters |
| 469-20017 | 20017 | Accessory Kit for Volkswagen/Siemens Transmitters |
| 469-20018 | 20018 | Replacement Snap-In Valve, Box of 50 |
| 469-20019 | 20019 | Accessory Kit for Honda/Acura Transmitters |
| 469-20020 | 20020 | TPMS Service Pack - Stem Only - Chrysler, Dodge, Jeep |
| 469-20021 | 20021 | Accessory Kit for TRW Transmitters - No Valve |
| 469-20022 | 20022 | Accessory Kit for Hyundai/Kia Transmitters |
| 469-20023 | 20023 | Accessory Kit for Beru Stems - No Valve |
| 469-20030 | 20030 | Accessory Kit for Chrysler/Siemens Transmitters |
| 469-20031 | 20031 | Accessory Kit for Pacific Transmitters |
| 469-20032 | 20032 | Accessory Kit for Toyota/Pacific Transmitters |
| 469-20035 | 20035 | Accessory Kit for TRW Long Valve Transmitters |
| 469-20036 | 20036 | Accessory Kit for TRW Short Valve Transmitters |
| 469-20043 | 20043 | Continental Rubber Snap-In Valve |
| 469-22008 | 22008 | Assembled Chrome Replacement Snap-In Valve for Schrader 20153 Transmitter |

B. Schrader Accessory Kit Assortments

- Contains all the parts you will need when servicing tires and wheels that are equipped with Schrader Original Equipment pressure monitoring transmitter valves. All components are individually packaged for easy identification by vehicle application and are stored in a handy plastic box.

469-20597
Master Accessory
Kit Assortment



| Ascot No. | Mfg. No. | Description |
|-----------|----------|---|
| 469-20097 | 20097 | Small Assortment Kit. Includes: 30 Bags (5 ea) Accessory Kits for Each Transmitter Size, 25 Plastic Valve Caps and Core Tool |
| 469-20597 | 20597 | TPMS Master Accessory Kit Assortment. Includes: 8 each of Accessory Kits 20002-20007, 20030-20031, 4 each of Accessory Kits 20035 & 20036, 100 Cores and 25 Plastic Caps |
| 469-20598 | 20598 | TPMS Service Pack Assortment. Includes: 8 each of service packs 20002, 20003, 20004, 20008, 20013, 20014, 20020, 20021, 20023, 20030, 20032 and 20036 |

TOOLS, ACCESSORIES & KITS (CONT.)

C. Dill TPMS Accessory Kits

| Ascot No. | Mfg. No. | Description |
|-----------|-----------|---|
| 469-00035 | VS-35 | Bent Aluminum Stem for Dodge Applications |
| 469-00065 | VS-65 | Rubber Snap-In Stem for Dodge Jeep w/ Square Brass End |
| 469-00919 | VS-919 | For use in light truck applications fitted with rims with a 0.625 diameter rim hole using the Ford, GM, and Chrysler snap in TPMS sensor design |
| 469-00925 | VS-925A | Aluminum Metal Replacement Valve for GM Snap-In |
| 469-00950 | VS-950 | Rubber Snap-In Replacement Valve for GM & Ford Transmitters. Box of 25 |
| 469-01010 | VS-1010 | Rubber Snap-In Stem for Hyundai Santa Fe |
| 469-01030 | 1030K | Siemens Kit for VW (Fits 1053 Sensor) |
| 469-01031 | 1031K | VW Kit for Special Wheel Package |
| 469-01040 | 1040K | Siemens Mercedes Assembled Valve |
| 469-01050 | 1050K | Siemens Kit for Chrysler |
| 469-01060 | 1060K | Compatible with Schrader 20001/20002/ 20135AK/20096AK |
| 469-01070 | 1070K | Compatible with Schrader 20004/20116AK/ 20115AK/20107AK |
| 469-01080 | 1080K | Compatible with Schrader 20003/20007/ 20117AK/20028AK |
| 469-01077 | 1077K | Accessory Kit for 8006 Sensor, 97-00 Corvette |
| 469-01090 | 1090K | Compatible with Beru Sensors |
| 469-01096 | 1096 | Entire Valve (Schrader 20036) for Hyundai, Kia, Honda |
| 469-01097 | 1097 | Entire Valve (Schrader 20035) for Hyundai, Kia, Honda |
| 469-01098 | 1098K | Dodge Sprinter Replacement Valve |
| 469-01100 | 1100K | Compatible with Pacific Sensors for Toyota/Lexus |
| 469-01110 | 1110K | Compatible with Pacific Sensors for Toyota |
| 469-01130 | 1130K | Compatible with Schrader 20005 |
| 469-01416 | TP416 | Replacement Stem for 1204A/1206A for Toyota |
| 469-02040 | 2040K | Kit for Honda Civic |
| 469-02045 | 2045K | Kit for Honda/Acura |
| 469-04925 | VS-925P-4 | TPMS Plug for Wheels w/ Two Valve Holes |
| 469-09251 | VS-925C | Chrome Replacement Valve for GM Snap-In |
| 469-09252 | VS-925B | Black Nut/Black Cap Metal Replacement Valve for GM |
| 469-09304 | 930-SC-4 | 4-Pack of Chrome Sleeves & Caps That Fit the TPMS Snap-In Valve |
| 469-09305 | VS-930 | Rubber Snap-In Replacement Valve for GM Transmitters. Box of 25 |
| 469-11120 | 1120K | Compatible with Pacific Sensors for Lexus |
| 469-20025 | 2000K | Compatible with Entire Sensors |
| 469-20030 | 2030K | Compatible with Schrader Sensors for Chrysler, Dodge |
| 469-21010 | 2010K | Compatible with Schrader Sensors for Volvo |
| 469-21020 | 2020K | Early 2007 GM Kit for Entire Sensors |
| 469-90662 | 9066-B | Replacement Ball Joint for 9066 Valve Stem |

NEW ITEM!

NEW ITEM!

NEW ITEM!

NEW ITEM!

NEW ITEM!



DILL TPMS ACCESSORY KITS



C



TOOLS, ACCESSORIES & KITS (CONT.)



A 469-07100
Dill TPMS
Startup
Assortment



B 469-11215
Complete
Dill Universal
Sensor
Package



C 469-30000
Universal
Master TPMS
Transmitter
Hardware &
Tool Service Set



D 469-07300
Dill TPMS
Replacement
Stem
Assortment

A. Dill TPMS Startup Assortment

- **Contains:** 82 kits and 4 chrome sleeves
- **Tools included:** Torque Screwdriver, Fishing Tool and 4-way TPMS tool

| Kit Number | Quantity | Kit Number | Quantity |
|------------|----------|--------------------|-------------|
| 1030K | 4 | 2010K | 4 |
| 1050K | 6 | 2020K | 4 |
| 1060K | 6 | 2030K | 4 |
| 1070K | 6 | 2040K | 4 |
| 1080K | 6 | VS-80 | 4 |
| 1090K | 4 | VS-950 | 6 |
| 1100K | 6 | 1 Pack Valve Caps | 20 per pack |
| 1110K | 6 | 1 Pack Valve Cores | 20 per pack |
| 1130K | 6 | Chrome Sleeves | 4 |
| 2000K | 6 | | |

| Ascot No. | Mfg. No. | Description |
|-----------|----------|---------------------------------------|
| 469-07100 | 7100 | Dill TPMS Master Accessory Assortment |

B. Complete Dill Universal Sensor Package

- **Includes:** 12 Universal Sensors, 128 Assorted Service Kits, TPMS Tool Kit (8100)

| Ascot No. | Mfg. No. | Description |
|-----------|----------|--|
| 469-11215 | 1215 | Complete Dill Universal Sensor Package |

C. Universal Master TPMS Transmitter Hardware & Tool Service Set

- Versatile 152 piece assortment (15 unique kits)
- Covers over 55 different OEM sensor models and 90% of US vehicles
- **Tools included:** A Sensor Service Tool, Ratcheting Torque Wrench, 2 Deep Sockets, 2 Torque Drivers and bits

| Ascot No. | Mfg. No. | Description |
|-----------|----------|---------------------------|
| 469-30000 | 30000 | Universal Master TPMS Set |

D. Dill TPMS Replacement Stem Assortment

- **Contains 2 each of the following replacement stems:** 1092, 1093, 1094, 1095, 1096, 1097, 1098 & VS-965
- **Contains 4 each of the following replacement stems:** 1040K, VS-950, VS-1010, 9066K, VS-925A, VS-925B, VS-925C, VS-70

| Ascot No. | Mfg. No. | Description |
|-----------|----------|---------------------------------------|
| 469-07300 | 7300 | Dill TPMS Replaceable Stem Assortment |



TOOLS, ACCESSORIES & KITS (CONT.)

E. Complete Replacement Kit for Chrysler/Dodge TPMS Applications

- Complete Replacement Kit includes the following:
Aluminum TPMS Valve Stem w/ Grommet, Valve Nut, Valve Core

| Ascot No. | Mfg. No. | Description |
|-----------|----------|--|
| 469-90660 | 9066-K | Dill Chrysler TPMS Complete Stem Replacement Kit |



469-90660
Dill Chrysler TPMS Complete Stem Replacement Kit

F. Replacement Stem for Chrysler/Dodge TPMS Applications

| Ascot No. | Mfg. No. | Description |
|-----------|----------|--|
| 469-90661 | 9066-1 | Dill Chrysler TPMS Replacement Stem Only |



469-90661
Dill Chrysler TPMS Replacement Stem Only

G. Schrader TPMS Valve Caps

| Ascot No. | Mfg. No. | Description | Qty./Box |
|-----------|----------|--|----------|
| 468-00050 | 20395 | Plastic Valve Caps | 100 |
| 468-20495 | 20495 | Aluminum Valve Caps | 100 |
| 468-20595 | 20595 | Black TPMS Plastic Sealing Valve Caps for Snap-In Transmitters | 100 |
| 468-20695 | 20695 | Green TPMS Plastic Sealing Valve Caps for Snap-In Transmitters | 100 |
| 468-59019 | 59-0019 | Green Nitrogen Indicating Aluminum Valve Cap (100 per bag) | 100 |
| 468-59021 | 59-0021 | Chrome-Plated Brass Valve Caps | 100 |
| 468-59023 | 59-0023 | Universal Nitrogen Caps | 100 |



VALVE CAPS

468-20595

468-20495

468-00050

468-59019

468-59021

H. Rubber TPMS Snap-In Replacement Valves

- Rubber stem and attaching screw for snap-in transmitters
- Cap & core included
- Requires T-10 Torx Tool for assembly/disassembly

| Ascot No. | Mfg. No. | Description | Qty./Box |
|-----------|----------|---|----------|
| 469-00950 | VS-950 | Rubber Snap-In Replacement Valve for GM & Ford Transmitters | 25 |
| 469-20018 | 20018 | Replacement Snap-in Valve for Schrader transmitters | 50 |



469-20018
Replacement Snap-In Valve for Schrader Transmitters

E

F

G

H

TOOLS, ACCESSORIES & KITS (CONT.)

AFTERMARKET TPMS ACCESSORY KITS



A. Aftermarket TPMS Accessory Kits



469-17208
GM TPMS Rubber
Snap-in Valve



469-17210
TPMS Parts Kit for
Volvo Applications



469-17211
TPMS Parts Kit for
Subaru Applications

| Ascot No. | Mfg. No. | Description |
|-----------|------------|--|
| 468-17490 | 17-490T | TPMS High Temp (Red) Valve Core Nickel Plated |
| 468-17491 | 17-490TY | TPMS High Temp Valve Core, Nickel Plated, YELLOW Band |
| 468-17492 | 17-492L-1 | Long Skirted Black Plastic Cap with Seal for 17-20008 |
| 468-17493 | 17-493NP | Chrome Plated Plastic Cap, Green Top |
| 468-17592 | 17-492T-1 | Gray Plastic TPMS Valve Cap with Red Silicone Seal |
| 468-17593 | 17-493P | Chrome Plated Plastic Cap |
| 468-17692 | 17-492LG-1 | Long Skirted GREEN Plastic Cap with Seal for 17-20008 |
| 469-17107 | 17-20107AK | TPMS Parts Kit for GM Applications |
| 469-17198 | 17-20198AK | TPMS Parts Kit for Dodge Sprinter Applications |
| 469-17205 | 17-20005AK | TPMS Parts Kit for Nissan Applications |
| 469-17206 | 17-20006AK | TPMS Parts Kit for GMC, Hummer, Isuzu Applications |
| 469-17207 | 17-20007AK | TPMS Parts Kit for Nissan, Infiniti Applications |
| 469-17208 | 17-20008 | GM TPMS Rubber Snap-In Valve |
| 469-17209 | 17-20009AK | TPMS Parts Kit for Saab, Suzuki Applications |
| 469-17210 | 17-20010AK | TPMS Parts Kit for Volvo Applications |
| 469-17211 | 17-20011AK | TPMS Parts Kit for Subaru Applications |
| 469-17212 | 17-20012AK | TPMS Parts Kit for Prowler, Corvette Applications |
| 469-17213 | 17-20013AK | TPMS Parts Kit for Dodge, Jeep, Chrysler Applications |
| 469-17214 | 17-20014AK | TPMS Parts Kit for Nissan, Infiniti Applications |
| 469-17215 | 17-20015AK | TPMS Parts Kit for GM with TRW Clamp-In Sensor |
| 469-17216 | 17-20016AK | TPMS Parts Kit for Mercedes, Smart Applications |
| 469-17218 | 17-20018 | TPMS Ford Rubber Snap-In Valve |
| 469-17221 | 17-20201AK | TPMS Parts Kit for Chrysler, GM Applications |
| 469-17222 | 17-20202AK | TPMS Parts Kit for Audi, Mercedes, Volkswagen Applications |
| 469-17223 | 17-20203AK | TPMS Parts Kit for Audi, Mercedes Application |
| 469-17224 | 17-20204AK | TPMS Parts Kit for Acura, Honda, Kia Applications |
| 469-17226 | 17-20206AK | TPMS Parts Kit for Hyundai, Honda, Kia Applications |
| 469-17227 | 17-20207AK | TPMS Parts Kit for Volkswagen Applications |
| 469-17228 | 17-20028AK | TPMS Parts Kit for Chrysler, Dodge, Mitsubishi Applications |
| 469-17235 | 17-20035AK | TPMS Parts Kit for Honda Applications |
| 469-17236 | 17-20036AK | TPMS Parts Kit for Acura, Honda, Kia Applications |
| 469-17272 | 17-20720AK | TPMS Parts Kit for Conti OE Sensors & Redi-Sensor |
| 469-17296 | 17-20096AK | TPMS Parts Kit for Ford Applications |
| 469-17311 | 17-20211AK | TPMS Parts Kit for Misc. Import Applications |
| 469-17316 | 17-20216AK | TPMS Parts Kit for Lexus/Toyota Applications |
| 469-17317 | 17-20217AK | TPMS Parts Kit for Lexus/Toyota Applications |
| 469-17320 | 17-20020 | TPMS Stem Only for Chrysler, Dodge, Mercedes |
| 469-17321 | 17-20221AK | TPMS Parts Kit for Lexus SC430 Applications |
| 469-17420 | 17-20020AK | TPMS Parts Kit + Stem for Chrysler, Dodge, Mercedes Applications |
| 469-17539 | 17-50399 | TPMS Snap-In Valve, Hyundai |

A

TOOLS, ACCESSORIES & KITS (CONT.)

B. Schrader TPMS Valve Core

- Electroless Nickel-Plated valve core
- All valve caps packaged 100 per box

| Ascot No. | Mfg. No. | Description |
|-----------|----------|--------------------------|
| 468-20055 | 20055 | Schrader TPMS Valve Core |

C. Beru TPMS Valve Inserts

- Original equipment valve insert for the Beru Tire Safety System
- *Each Insert comes complete with cap, core, grommet & grommet nut*
- Colored bottom to differentiate inserts
- **Applications:** Audi, Bentley, BMW, Ferrari, Land Rover, Maserati, Maybach, Mercedes-Benz, Porsche, Volkswagen
- *Requires TX-20EZ torx tool for assembly/disassembly*

| Ascot No. | Mfg. No. | Description |
|-----------|----------|------------------|
| 461-59307 | 59.0342 | Green Insert |
| 461-59337 | 59.0340 | Silver Insert |
| 461-59357 | 59.0346 | Orange Insert |
| 461-59387 | 59.0344 | Black Insert |
| 469-15415 | 15535 | Torx Screwdriver |

D. Dill TPMS Valve Caps & Cores

- All valve caps and cores packaged 100 per box

| Ascot No. | Mfg. No. | Description | Qty./Box |
|-----------|----------|---|----------|
| 468-01001 | 100-TP | Electroless Nickel Plated Valve Core | 100 |
| 468-06300 | 630N | Plastic TPMS Valve Cap | 100 |
| 468-00635 | 635 | Plastic Cap for VS-930 TPMS Snap-In Valve | 100 |
| 468-00650 | 650 | Small Plastic TPMS Valve Cap | 100 |
| 468-00680 | 680 | N2 Aluminum cap for TPMS | 100 |
| 468-00690 | 690 | N2 Plastic cap for TPMS | 100 |

E. TPMS Torque Wrenches and Sockets

- Perfect for tightening grommet nut to manufacturer specifications
- Periodic calibration recommended

| Ascot No. | Mfg. No. | Description |
|-----------|----------|---|
| 168-01501 | 1501MRMH | 1/4" Drive 20-150 In./Lbs. Torque Wrench |
| 167-12110 | 1211D | 1/4" Drive x 11 mm x 12 mm Chrome Flip Socket |
| 169-01002 | 1002E | 1/4" Drive x 2" Chrome Extension |
| 168-72100 | 72100 | 3/8" Drive, 20 - 200 In./Lbs. Torque Wrench |
| 168-72120 | 72120 | 3/8" Drive, 25 - 250 In./Lbs. Torque Wrench |
| 162-27211 | 27211 | 3/8" Drive x 11 mm Socket |
| 162-27212 | 27212 | 3/8" Drive x 12mm Socket |



468-20055
Electroless
Nickel Plated
Valve Cores



**BERU TPMS
VALVE INSERTS**



**DILL TPMS
VALVE CAPS
& CORES**

468-01001
Electroless
Nickel Plated
Valve Core

468-06300
Plastic TPMS
Valve Cap

468-00635
Plastic Cap for
VS-930 TPMS
Snap-In Valve

468-00650
Small Plastic
TPMS Valve Cap



**TPMS TORQUE
WRENCHES
& SOCKETS**

B

C

D

E

TOOLS, ACCESSORIES & KITS (CONT.)

A



469-00044
Valve Core
Torque Tool

A. Valve Core Torque Tool

- Preset torque guarantees correct setting every time on all cores
- Can be used to install and remove cores in standard valves
- Calibrated to 4 in./lbs. of torque
- Meets the Tire & Rim Association (TRA) specifications for installing valve cores on TPMS applications

| Ascot No. | Mfg. No. | Description |
|-----------|----------|------------------------|
| 469-00044 | TPMS-4VC | Valve Core Torque Tool |

B



469-20140
T-10 Torque Tool

T-10 TORQUE TOOLS

B. T-10 Torque Tools

- Installs replacement snap-in valve to Schrader snap-in transmitters
- Preset to 12 in./lbs.

| Ascot No. | Mfg. No. | Description |
|-----------|----------|-------------------------------------|
| 469-20140 | 20140 | T-10 Torque Tool |
| 469-15415 | 15415 | T-10 Torque Tool w/ Replaceable Tip |
| 469-25415 | 15415-1 | Replacement T-10 Tip |

C



469-15415
T-10 Torque Tool
with ReplaceableTip

C. T-20 Torque Tool with Replaceable Tip

- Installs replacement Beru snap-in valves
- Preset to 35 in./lbs.



| Ascot No. | Mfg. No. | Description |
|-----------|----------|-------------------------------------|
| 469-15535 | 15535 | T-20 Torque Tool w/ Replaceable Tip |
| 469-25535 | 15535-1 | Replacement T-20 Tip |


D



469-19860
Tire Deflator Set for
TPMS Valve Stems

D. Tire Deflator Set for TPMS Valve Stems

- Simply replace a standard sized valve cap with this handy tool and the special design will depress the pin in the valve core
- Large openings on the sides of the tool allow air to escape quickly from the tire
- Tools are marked so tires can be returned to their original position on the vehicle so TPMS will not need to be reset
- Also saves time since the valve core has not been removed from the sensor
- Set of 4

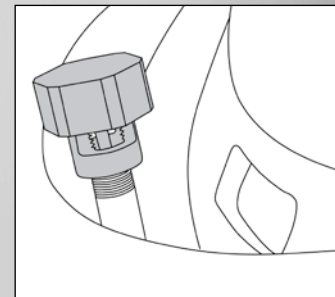


| Ascot No. | Mfg. No. | Description |
|-----------|----------|--|
| 469-19860 | 19860 | Tire Deflator Set for TPMS Valve Stems |

TOOLS, ACCESSORIES & KITS (CONT.)

E. Tire Deflator/Valve Core Remover

- Screws on TPMS valve stems to deflate the tire without removing the valve core

| Ascot No. | Mfg. No. | Description |
|-----------|----------|----------------------------------|
| 469-00021 | VT-21 | Tire Deflator/Valve Core Remover |

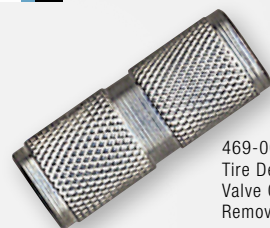

469-00021
Tire Deflator/
Valve Core
Remover

F. Valve Core Tools: Screwdriver Type & Standard Bore Long Valve

- Has a plastic screwdriver handle for better grip and leverage

| Ascot No. | Mfg. No. | Description |
|-----------|----------|------------------------------------|
| 469-00607 | TL-615 | Screwdriver Type Valve Core Tool |
| 469-00612 | TL-612 | Standard Bore Long Valve Core Tool |



469-00607
Screwdriver Type
Valve Core Tool

469-00612
Standard Bore
Long Valve
Core Tool

G. Electronic TPMS Torque Wrench

- **Range:** 12-120 in./lbs.
- **Accuracy:** ± 2%
- Green light for power on, red light and buzzer for reaching target signal, red flash for overload signal
- Torque set quickly with unique slide bar on the scale
- Rotate to 90° position to torque and leverage
- Indexing head allows for use straight (screwdriver position) to spin nut down quickly
- Torque limit LED flashes with audible beep
- Power switch with LED indicator
- Uses coin style batteries
- Approximately 8.5" long

| Ascot No. | Mfg. No. | Description |
|-----------|----------|-------------------------------|
| 168-38325 | 3833-25 | Electronic TPMS Torque Wrench |



168-38325
Electronic TPMS
Torque Wrench

H. Speed Torque Tools for TPMS

- Never adjust a TPMS torque wrench again
- Durable and long-lasting
- **No more torque errors:** It is either "Hi" or "Low"
- Ergonomically designed hand grip
- Open cross chamber on the 5565 allows for extra leverage bar



| Ascot No. | Mfg. No. | Description |
|-----------|----------|---|
| 469-05540 | 5540 | TPMS Speed Torque Wrench: Preset at 40 In./Lbs. |
| 469-05565 | 5565 | TPMS Speed Torque Wrench: Preset at 65 In./Lbs. |



469-05540
TPMS Speed Torque
Wrench (Preset at
40 In./Lbs.)

469-05565
TPMS Speed Torque
Wrench (Preset at
65 In./Lbs.)

E

F

G

H

TOOLS, ACCESSORIES & KITS (CONT.)

A



469-04700
Grommet Removal Tool



A. Grommet Removal Tool

- Makes grommet and metal washer installation/removal easy and safe

| Ascot No. | Mfg. No. | Description |
|-----------|----------|----------------------|
| 469-04700 | 4700 | Grommet Removal Tool |

B



469-20144
Grommet
Installation/
Removal Tool

B. Grommet Installation/Removal Tool

| Ascot No. | Mfg. No. | Description |
|-----------|----------|-----------------------------------|
| 469-20144 | 20144 | Grommet Installation/Removal Tool |

C



319-72521
1/4" Socket
Driver

C. 1/4" Socket Driver

- 6" Overall Length, 2-1/2" Shank Length
- Durable screwdriver handle and a chrome vanadium shank
- Ideal for use with the TPMS 11mm x 12mm flip sockets
- **MADE IN THE USA**

| Ascot No. | Mfg. No. | Description |
|-----------|----------|--------------------|
| 319-72521 | 7252100 | 1/4" Socket Driver |

D



469-20250
Core /Cap
Removal Tool

D. Core/Cap Removal Tool

| Ascot No. | Mfg. No. | Description |
|-----------|----------|-----------------------|
| 469-20250 | 20250 | Core/Cap Removal Tool |

E



469-08910
TPMS Valve System
Fishing Tool

E. TPMS Valve System Fishing Tool

- Secures TPMS sensor to wheel during demount
- One handle end can be used as a deflator; the other as a core remover
- 3" Overall length

| Ascot No. | Mfg. No. | Description |
|-----------|----------|-------------------------|
| 469-08910 | 08910 | TPMS Valve Fishing Tool |

TOOLS, ACCESSORIES & KITS (CONT.)

F. Bartec Mechanical Tool Kit

- Valve Core Torque Driver
- T-10 Torque Driver
- T-20 Torque Driver
- 3-Way Fishing Tool
- Grommet Tool
- Torque Wrench
- TPMS Toyota Reset Tool

All fitted in a plastic case

| Ascot No. | Mfg. No. | Description |
|-----------|----------|----------------------------|
| 469-10300 | WRTMT103 | Bartec Mechanical Tool Kit |



469-10300
Bartec Mechanical
Tool Kit

G. Dill TPMS Master Tool Kit

- Accurately and quickly install and remove any TPMS component
- **No more torque errors:** Simplest TPMS set available

Contents of kit below:



| Dill No. | Type | Description |
|------------------|-------------------------|--|
| 4700 | TPMS Grommet tool | Easily remove and install TPMS valve stem grommets |
| 5540 | Speed Torque 40 IN-LB | Fast and accurate TPMS installer for 45 in./lbs. and below Service Kits |
| 5565 | Speed Torque 65 IN-LB | Fast and accurate TPMS installer for 46 in./lbs. and above Service Kits |
| (w/ 5540 & 5565) | Drive Sockets | 11mm and 12mm deep well sockets |
| 5414 | Valve Core Torque Tool | Installs valve cores to recommended torque (3.5 in./lbs.) |
| 5415 | Torque Screwdriver | Torque T-10 screw installation, 12.5 in./lbs. (i.e. VS-950 rubber stem). |
| 5417 | Beru Valve Holding Tool | Holds Beru valve in place for easy installation |
| 5535 | Torque Screwdriver | Torque T-20 screw installation, 35 in./lbs. (i.e. VS-80 rubber stem) |
| 8910 | 3-way Fishing Tool | Retains sensor in a secure position, deflates, adjusts the core |
| NA | T-bar | May be used for extra leverage with the speed torque tools |
| N/A | Case | Hard plastic case to keep all of your items secure |

| Ascot No. | Mfg. No. | Description |
|-----------|----------|---------------------------|
| 469-08200 | 8200 | Dill TPMS Master Tool Kit |



469-08200
Dill TPMS
Master Tool Kit

H. Digital Tire Inflator Gauge

- Range: 0-175 PSI
- Accurate to +/- 1.2 psi up to 59 psi; +/- 2.3 psi 59-145 psi; 3.6 psi more than 145 psi
- Covered with rubber sleeve for extra comfort and durability
- One button operation
- 3 in 1 function: inflate, deflate and measure tire pressure
- Long-life battery with low battery warning signal—Extra battery included
- Clip-on chuck with swivel hose to prevent kinking

| Ascot No. | Mfg. No. | Description |
|-----------|----------|---|
| 477-00130 | H-30 | Digital Tire Inflator Gauge (21" Hose) |
| 477-00136 | H-30-6 | Digital Tire Inflator Gauge (6' Hose): <ul style="list-style-type: none"> ▪ 1-Year warranty ▪ Equivalent to Rema H300532P |



Digital Tire
Inflator Gauge
477-00130 (21" Hose)
477-00136 (6' Hose)

BANDED TPMS SYSTEMS & ACCESSORIES

A



469-01026
Plastic
Repl.
Clip

469-02723
Cradle with Clip

469-01426
Adjustable Band
for Banded
TPMS Sensors

B



461-01048
Lear Ford
Banded
Transmitter

469-05105
Complete Banded
Transmitter Package

C



461-11048
High Pressure
Ford Banded
Transmitter

469-15105
Ford Complete Banded High
Pressure Sensor Package

D



Dill OEM
Replacement Bands
469-19318: 18" Band
469-19320: 20" Band
469-19322: 22" Band

A. TPMS Band Transmitter Accessories

- TPMS Band is adjustable to accommodate 14" - 26" wheels
- Plastic clip included with TPMS Cradle
- For use on vehicles equipped with banded transmitters

| Ascot No. | Mfg. No. | Description |
|-----------|----------|--|
| 469-01426 | TPSTRAP | 14" - 26" Adjustable Band for Banded TPMS Sensors |
| 469-02723 | TPCRADLE | Cradle with Clip for Banded TPMS Sensors |
| 469-01026 | 1026 | Plastic Replacement Clip for TPMS Replacement Cradle |

B. Ford Complete Banded Transmitter Package

- Includes:** 461-01048 transmitter, 469-02723 cradle/clip & 469-01426 band
- Equivalent to Dill part no. 5105**
- Replacement transmitter for Ford OE #6F2Z1A189A**
- Fits most popular 2006 - 2008 Ford vehicles

| Ascot No. | Mfg. No. | Description |
|-----------|----------|-------------------------------------|
| 469-05105 | 5105 | Complete Banded Transmitter Package |

C. Ford Complete Banded High Pressure Sensor Package

- Includes:** 461-11048 transmitter w/ cradle and clip & 469-01426 band
- Equivalent to Dill part no. 5105HP**
- Applications:** Pre-June Ford F250/350/450 Super Duty Trucks
- Replacement transmitter for Ford OE # 8C2Z-1A189A**
- Shipped together in a plastic bag

| Ascot No. | Mfg. No. | Description |
|-----------|----------|---|
| 469-15105 | 5105HP | Ford Complete Banded High Pressure Sensor Package |

D. Band Transmitter for Ford

| Ascot No. | Mfg. No. | OE Part No. | Description |
|-----------|----------|-------------|------------------------------|
| 461-01048 | 1048 | 6F2Z1A189A | Lear Ford Banded Transmitter |

E. High Pressure Ford Banded Transmitter

| Ascot No. | Mfg. No. | OE Part No. | Description |
|-----------|----------|-------------|---------------------------------------|
| 461-11048 | 1048-HP | 8C2Z1A189A | High Pressure Ford Banded Transmitter |

F. Dill OEM Replacement Bands

| Ascot No. | Mfg. No. | Description |
|-----------|----------|--------------------------|
| 469-19318 | 1193-18 | 18" OEM Replacement Band |
| 469-19320 | 1193-20 | 20" OEM Replacement Band |
| 469-19322 | 1193-22 | 22" OEM Replacement Band |

TRAINING & PROMOTIONAL MATERIALS, CABINETS

A. TPMS Training Package

TRAINING PACKAGE INCLUDES:

- 90 minute, in-depth TPMS Training DVD
- Mitchell TPMS Service Guide
- TPMS Course Book (with test & certification application)
- CD Video Demos of each Bartec TPMS Tool

| Ascot No. | Mfg. No. | Description |
|-----------|----------|---|
| 469-11112 | WRTRKIT3 | TPMS Training Package |
| 469-11113 | WRTRKIT4 | TPMS Training Package - Spanish Version |



469-11112
TPMS Training Package

B. Schrader TPMS Training DVD

- Available in both English and Spanish versions. Call for more details

| Ascot No. | Mfg. No. | Description |
|-----------|----------|--------------------------------|
| 469-21355 | 21355 | Training DVD - English Version |
| 469-21357 | 21357 | Training DVD - Spanish Version |



469-21355
Schrader TPMS Training DVD

C. TPMS Consumer Kit

TPMS CONSUMER KIT INCLUDES:



- Informative Counter Mat
- "How TPMS Works" Tri-Fold (50 pieces)
- "What Every Consumer Should Know" Tri-Fold (50 pieces)
- Tri-Fold Counter Top Display
- 2013 Product Bulletin
- Mouse Pad
- 2' x 3' Wall or Window Poster
- 2' x 8' Hanging Window Banner
- Talking TPMS Reference Book



| Ascot No. | Mfg. No. | Description |
|-----------|-----------|-------------------|
| 469-60001 | WRTCNK001 | TPMS Consumer Kit |

469-60001
TPMS Consumer Kit

| REPLACEMENT PARTS | | |
|-------------------|------------|---|
| 469-60010 | WRTCNK0010 | TPMS Consumer Kit Refill: "How TPMS Works" Tri-Fold (25/pack) |
| 469-60015 | WRTCNK0015 | TPMS Consumer Kit Refill: "What Every Consumer Should Know" Tri-Fold (25 pieces per pack) |
| 469-60020 | WRTCNK0020 | Tri-Fold Countertop Display |
| 469-60025 | WRTCNK0025 | Single 2' x 3' TPMS Poster |
| 469-60030 | WRTCNK0030 | Counter Mat |
| 469-60035 | WRTCNK0035 | Mouse Pad |
| 469-60040 | WRTCNK0040 | Talking TPMS Instruction Handbook |



TPMS Countertop Displays

TRAINING & PROMOTIONAL MATERIALS, CABINETS (CONT.)

A. TPMS Countertop Displays

- Three-dimensional countertop display to help educate consumers on TPMS
- Dummy sensor included as a visual reference
- Display explains in common terms the individual components that are involved in the installation of sensors and why these components should be replaced each time the tire is disassembled
- Provides a photograph of the universal "horseshoe" symbol that indicates the existence of TPMS
- Some assembly required
- Packaged 1 display per box

| Ascot No. | Mfg. No. | Description |
|-----------|----------|--|
| 469-61589 | 61589 | TPMS Countertop Display w/ Dummy Transmitter |
| 469-61599 | 61599 | Spanish TPMS Countertop Display w/ Dummy Transmitter |



469-22006
Schrader TPMS Consumer Brochure



717-00400
Clear Plastic Brochure Holder

B. TPMS Tri-Fold Consumer Brochure, Brochure Holder

| Ascot No. | Mfg. No. | Description |
|-----------|-----------|---------------------------------|
| 469-22006 | 469-22006 | Schrader TPMS Consumer Brochure |
| 717-00400 | W40A | Clear Plastic Brochure Holder |

C. Consumer Awareness Counter Mat

| Ascot No. | Mfg. No. | Description |
|-----------|----------|--------------------------------|
| 469-07011 | N/A | Consumer Awareness Counter Mat |

D. Dill TPMS Cabinets

- The 5112-A TPMS Kit Cabinet comes with an assortment of service kits that fit the vehicles you see in your shop

| Ascot No. | Mfg. No. | Description | Dimensions |
|-----------|----------|--|------------------|
| 469-05112 | 5112-A | Counter-Top Style TPMS Cabinet w/ Assortment of Service Kits | 12" x 15" x 3.5" |



469-05112
Counter-Top Style TPMS Cabinet



TPMS RETROFIT KITS



A. Schrader TPMS Retrofit Kits

- For installation on vehicles not equipped with OE TPMS Systems
- Stand-alone kit includes dash mounted display
- Four wheel mounted transmitters and installation instructions

| Ascot No. | Mfg. No. | Description |
|-----------|----------|--------------------------------------|
| 469-20154 | 20154 | Replacement Sensor for Retrofit Kits |
| 469-20256 | 20256 | Battery Operated |
| 469-20257 | 20257 | Hard-Wired |



469-20256
Battery Operated Schrader TPMS Retrofit Kit

B. Dill Trailer TPMS System

- Designed to be installed directly into trailer tires
- Provides accurate trailer tire air pressures and temperatures
- A warning will trigger if pressure falls below the set pressure
- Ability to set baseline pressure to desired PSI level
- Valve options for 0.453", 0.625", and 9.7mm rim holes
- Cigarette lighter adapter or hard-wired options



Transmitters



469-20257
Hard-Wired Schrader TPMS Retrofit Kit



Valve options for 0.453", 0.625", and 7.7mm rim holes



The display on the Dill Trailer TPMS System



469-01508
Dill Trailer TPMS System with Eight Sensors

| Ascot No. | Mfg. No. | Description |
|-----------|----------|---|
| 469-01502 | 1502-453 | Dill Trailer TPMS System With Two Sensors |
| 469-01504 | 1504-453 | Dill Trailer TPMS System With Four Sensors |
| 469-01506 | 1506-453 | Dill Trailer TPMS System with Six Sensors |
| 469-01508 | 1508-453 | Dill Trailer TPMS System with Eight Sensors |
| 469-01510 | 1510-453 | Dill Trailer TPMS System with Ten Sensors |

EZ-SENSOR 2014 TPMS APPLICATION GUIDE

■ VEHICLE APPLICATION COVERAGE: Part No. 33000, 33100 & 33200

| | Model | Model Year | EZ-Sensor Part # | OE Sensor Part # |
|-----------|-----------|-------------|------------------|------------------|
| Acura | CSX | 2008-2011 | 33000 | 42753-SNA-A83 |
| | | 2012 | 33000 | 42753-TR0-A81 |
| Audi | A6 | 2002-2004 | 33000 | 4D0 907 275D |
| | | 2000-2002 | 33000 | 4D0 907 275D |
| | A8 | 2003 | 33000 | 4D0 907 275D |
| | | 2003 | 33100/33200 | 4D0 907 275C |
| | | 2004-2011 | 33100/33200 | 4D0 907 275C |
| | Allroad | 2001-2005 | 33000 | 4D0 907 275D |
| | RS6 | 2003 | 33100/33200 | 4D0 907 275C |
| | S4 | 2002-2003 | 33000 | 4D0 907 275D |
| | S8 | 2000-2002 | 33000 | 4D0 907 275D |
| | | 2003 | 33000 | 4D0 907 275D |
| 2003 | | 33100/33200 | 4D0 907 275C | |
| 2004-2007 | | 33100/33200 | 4D0 907 275C | |
| 2008-2009 | | 33100/33200 | 4D0 907 275C | |
| Bentley | GT | 2003-2004 | 33100/33200 | 4D0 907 275C |
| | | 2005-2005 | 33100/33200 | 4D0 907 275C |
| BMW | 3 Series | 2000 | 33000 | 36 11 8 378 681 |
| | | 2001-2002 | 33000 | 36 11 8 378 681 |
| | | 2001-2002 | 33100/33200 | 36 11 8 378 682 |
| | | 2003-2006 | 33100/33200 | 36 11 8 378 682 |
| | 5 Series | 2000-2001 | 33000 | 36 11 8 378 681 |
| | | 2002 | 33000 | 36 11 8 378 681 |
| | | 2002 | 33100/33200 | 36 11 8 378 682 |
| | | 2003-2005 | 33100/33200 | 36 11 8 378 682 |
| | 7 Series | 2000-2001 | 33000 | 36 11 8 378 681 |
| | | 2002-2003 | 33100/33200 | 36 11 8 378 682 |
| M3 | 2002-2003 | 33100/33200 | 36 11 8 378 682 | |
| M5 | 2002-2003 | 33100/33200 | 36 11 8 378 682 | |
| X5 | 2000-2003 | 33100/33200 | 36 14 6 752 128 | |
| Buick | Allure | 2007 | 33000 | 15921013 |
| | | 2008 | 33000 | 15921013 |
| | | 2009 | 33000 | 13586335 |
| | | 2010-2011 | 33000 | 13586335 |
| | Enclave | 2008 | 33000 | 15921013 |
| | | 2009-2011 | 33000 | 13586335 |
| | | 2012 | 33000 | 13586335 |
| | 2013-2014 | 2013-2014 | 33000 | 22853741 |
| | | 2013-2014 | 33000 | 22854866 |
| | LaCrosse | 2007 | 33000 | 15921013 |
| | | 2008 | 33000 | 15921013 |
| | | 2009 | 33000 | 13586335 |
| | | 2010 | 33000 | 13586335 |
| 2011-2012 | | 33000 | 13586335 | |
| 2013-2014 | | 33000 | 22854866 | |

| | Model | Model Year | EZ-Sensor Part # | OE Sensor Part # |
|---------------|-----------|------------|------------------|------------------|
| Buick (cont.) | LeSabre | 2007 | 33000 | 13586335 |
| | | 2008-2011 | 33000 | 13586335 |
| | Lucerne | 2007 | 33000 | 13586335 |
| | | 2008-2011 | 33000 | 13586335 |
| | Rainier | 2007 | 33000 | 13586335 |
| | Regal | 2011 | 33000 | 13586335 |
| | | 2012 | 33000 | 20925924 |
| | | 2013-2014 | 33000 | 22854866 |
| | Verano | 2012 | 33000 | 20925924 |
| | | 2013-2014 | 33000 | 22854866 |
| Cadillac | ATS | 2014 | 33000 | 13581558 |
| | CTS | 2008-2011 | 33000 | 13586335 |
| | | 2012 | 33000 | 20922900 |
| | | 2013 | 33000 | 22853741 |
| | | 2014 | 33000 | 13581558 |
| | CTS-V | 2012-2013 | 33000 | 20925924 |
| | DTS | 2006 | 33000 | 15268606 |
| | | 2007 | 33000 | 13586335 |
| | 2008-2011 | 2008-2011 | 33000 | 13586335 |
| | | 2014 | 33000 | 22854866 |
| | | 2014 | 33000 | 22854866 |
| | Escalade | 2004 | 33000 | 15136883 |
| | | 2005-2006 | 33000 | 15114379 |
| 2007* | | 33000 | 15825475 | |
| 2007** | | 33000 | 13586335 | |
| 2008-2012 | | 33000 | 13586335 | |
| 2013 | 2013 | 33000 | 22853741 | |
| | 2013 | 33000 | 22853741 | |
| | 2014 | 33000 | 13581558 | |
| | 2014 | 33000 | 13581558 | |
| SRX | 2007-2009 | 33000 | 13586335 | |
| | 2010-2011 | 33000 | 13586335 | |
| | 2012 | 33000 | 20925924 | |
| | 2013 | 33000 | 22853741 | |
| | 2013 | 33000 | 22853741 | |
| | 2014 | 33000 | 22854866 | |
| STS | 2005-2007 | 33000 | 25758220 | |
| | 2008 | 33000 | 25758220 | |
| | 2009* | 33000 | 15268606 | |
| | 2009** | 33000 | 13586335 | |
| | 2010 | 33000 | 13586335 | |
| | 2011 | 33000 | 13586335 | |
| XLR | 2004-2011 | 33000 | 25758220 | |
| | 2013-2014 | 33000 | 22854866 | |
| Chevrolet | Avalanche | 2004 | 33000 | 15136883 |
| | | 2005-2006 | 33000 | 15114379 |
| | 2007* | 33000 | 15825475 | |
| | 2007** | 33000 | 13586335 | |
| | 2008-2012 | 33000 | 13586335 | |
| | 2013 | 33000 | 22853741 | |

VEHICLE APPLICATION COVERAGE:
Part No. 33000, 33100 & 33200

EZ-SENSOR 2014 TPMS APPLICATION GUIDE

| Model | Model Year | EZ-Sensor Part # | OE Sensor Part # | |
|-------------------|------------|------------------|------------------|----------|
| Chevrolet (cont.) | Aveo | 2007-2011 | 33000 | 13586335 |
| | Camaro | 2010-2011 | 33000 | 13586335 |
| | | 2012 | 33000 | 20922900 |
| | | 2013-2014 | 33000 | 22854866 |
| | | Caprice | 2013 | 33000 |
| | Captiva | 2012 | 33000 | 13586335 |
| | Cobalt | 2008 | 33000 | 15921013 |
| | | 2009* | 33000 | 15921013 |
| | | 2009** | 33000 | 13586335 |
| | | 2010 | 33000 | 13586335 |
| | Colorado | 2007-2012 | 33000 | 15122618 |
| | Corvette | 2005-2009 | 33000 | 25758220 |
| 2010-2011 | | 33000 | 15268606 | |
| 2012 | | 33000 | 20925924 | |
| 2013 | | 33000 | 15268606 | |
| 2014 | | 33200 | 13581560 | |
| Corvette C6 | 2005-2009 | 33000 | 25758220 | |
| Corvette Z06 | 2005-2009 | 33000 | 25758220 | |
| | 2010-2011 | 33000 | 15268606 | |
| | 2012 | 33000 | 20925924 | |
| Cruze | 2011 | 33000 | 13586335 | |
| | 2012 | 33000 | 20922900 | |
| | 2013-2014 | 33000 | 22854866 | |
| Equinox | 2007 | 33000 | 15921013 | |
| | 2008-2009 | 33000 | 15921013 | |
| | 2010-2011 | 33000 | 13586335 | |
| | 2012 | 33000 | 20922900 | |
| | 2013-2014 | 33000 | 22854866 | |
| Express | 2008-2009 | 33000 | 15921013 | |
| | 2010-2011 | 33000 | 13586335 | |
| | 2012-2014 | 33000 | 13586335 | |
| HHR | 2008 | 33000 | 15268606 | |
| | 2009* | 33000 | 15268606 | |
| | 2009** | 33000 | 13586335 | |
| | 2010-2011 | 33000 | 13586335 | |
| Impala | 2006 | 33000 | 15268606 | |
| | 2007* | 33000 | 15268606 | |
| | 2007** | 33000 | 13586335 | |
| | 2008-2010 | 33000 | 13586335 | |
| | 2011-2012 | 33000 | 13586335 | |
| | 2013 | 33000 | 22853741 | |
| | 2014 | 33000 | 22854866 | |
| Malibu | 2008* | 33000 | 15921013 | |
| | 2008** | 33000 | 13586335 | |
| | 2009 | 33000 | 13586335 | |
| | 2010-2012 | 33000 | 13586335 | |
| | 2013-2014 | 33000 | 22854866 | |

| Model | Model Year | EZ-Sensor Part # | OE Sensor Part # | | |
|-------------------|-------------|------------------|------------------|-------------|------------|
| Chevrolet (cont.) | Monte Carlo | 2006 | 33000 | 15268606 | |
| | | 2007* | 33000 | 15268606 | |
| | | 2007** | 33000 | 13586335 | |
| | Orlando | 2012-2014 | 33000 | 13586335 | |
| | Silverado | 2004-2004 | 33000 | 15136883 | |
| | | 2005-2006 | 33000 | 15114379 | |
| | | 2007** | 33000 | 13586335 | |
| | | 2007* (TRW) | 33000 | 15825475 | |
| | | 2008-2013 | 33000 | 13586335 | |
| | 2014 | 33000 | 13581558 | | |
| | Sonic | 2012 | 33000 | 20922900 | |
| | | 2013-2014 | 33000 | 22854866 | |
| Spark | 2013-2014 | 33000 | 20922900 | | |
| SparkEV | 2014 | 33000 | 22854866 | | |
| Suburban | 2004 | 33000 | 15136883 | | |
| | 2005-2006 | 33000 | 15114379 | | |
| | 2007** | 33000 | 13586335 | | |
| | 2007* (TRW) | 33000 | 15825475 | | |
| | 2008-2011 | 33000 | 13586335 | | |
| 2012-2013 | 33000 | 13586335 | | | |
| 2014 | 33000 | 13581558 | | | |
| Tahoe | 2004 | 33000 | 15136883 | | |
| | 2005-2006 | 33000 | 15114379 | | |
| | 2007** | 33000 | 13586335 | | |
| | 2007* (TRW) | 33000 | 15825475 | | |
| | 2008-2011 | 33000 | 13586335 | | |
| 2012-2013 | 33000 | 13586335 | | | |
| 2014 | 33000 | 13581558 | | | |
| Traverse | 2009-2011 | 33000 | 13586335 | | |
| | 2012 | 33000 | 13586335 | | |
| | 2013-2014 | 33000 | 22853741 | | |
| Trax | 2013-2014 | 33000 | 22854866 | | |
| Uplander | 2008-2009 | 33000 | 15268606 | | |
| Van | 2008-2011 | 33000 | 15921013 | | |
| | Volt | 2010-2011 | 33000 | 13586335 | |
| | | 2012 | 33000 | 20922900 | |
| | | 2013-2014 | 33000 | 22854866 | |
| Chrysler | 300 | 2005-2006 | 33000 | 68001696AB | |
| | | 2007 | 33000 | 68001696AB | |
| | | 2007 | 33100/33200 | 68078768AA | |
| | | 2008 | 33100/33200 | 68078768AA | |
| | | 2009-2009 | 33200 | 56029400AC | |
| | | 2010 | 33200 | 56029398AB | |
| | | 2011-2014 | 33200 | 56029398AB | |
| | | 300 SRT | 2010-2011 | 33200 | 56029400AC |
| | | 300M | 2002-2004 | 33100/33200 | 52088990AD |
| | | Aspen | 2007-2007 | 33000 | 68001696AB |
| 2008-2011 | 33000 | | 56029465AB | | |

*Snap-in **Clamp-in

EZ-SENSOR 2014 TPMS APPLICATION GUIDE

■ VEHICLE APPLICATION COVERAGE:
Part No. 33000, 33100 & 33200

| | Model | Model Year | EZ-Sensor Part # | OE Sensor Part # |
|------------------|----------------|-----------------------------|------------------|------------------|
| Chrysler (cont.) | Concorde | 2002-2004 | 33100/33200 | 52088990AD |
| | Crossfire | 2004-2004 | 33100/33200 | 52088990AD |
| | | 2005-2011 (Conti Sensor) | 33000 | 68001696AB |
| | | 2005-2011 (SCH Sensor) | 33100/33200 | 52088990AD |
| | Intrepid | 2002-2004 | 33100/33200 | 52088990AD |
| | Pacifica | 2003-2003 | 33100/33200 | 52088990AD |
| | | 2004 | 33100/33200 | 52088990AD |
| | | 2006-2008 | 33000 | 68001696AB |
| | Prowler | 2002 | 33100/33200 | 52088990AD |
| | PT Cruiser | 2008-2010 | 33000 | 68001696AB |
| | Sebring | 2007-2007 | 33000 | 68001696AB |
| | | 2008-2009 | 33000 | 68001696AB |
| | | 2008-2009 | 33100/33200 | 68078768AA |
| | | 2010 | 33000 | 68001696AB |
| | Town & Country | 2002-2003 | 33100/33200 | 52088990AD |
| | | 2006 | 33000 | 68001696AB |
| 2007 | | 33000 | 68001696AB | |
| 2008 | | 33000 | 68001696AB | |
| 2008 | | 33100/33200 | 68078768AA | |
| Voyager | 2009-2010 | 33100/33200 | 68078768AA | |
| | 2011-2014 | 33200 | 56029398AB | |
| | 2002-2003 | 33100/33200 | 52088990AD | |
| | 2007-2012 | 33000 | 68001696AB | |
| | 2007-2012 | 33000 | 68001696AB | |
| Dodge | Caravan | 2002-2003 | 33100/33200 | 52088990AD |
| | | 2006 | 33000 | 68001696AB |
| | | 2007 | 33000 | 68001696AB |
| | Charger | 2005-2006 | 33000 | 68001696AB |
| | | 2007 | 33000 | 68001696AB |
| | | 2008 | 33100/33200 | 68078768AA |
| | | 2009 | 33200 | 56029400AC |
| | Charger SRT | 2010 | 33200 | 56029398AB |
| | | 2011-2014 | 33200 | 56029398AB |
| | | 2009-2010 | 33200 | 56029400AC |
| 2011-2014 | | 33200 | 56029398AB | |
| Dakota | 2008-2010* | 33000 | 56029319AB | |
| | 2008-2010** | 33000 | 56029479AA | |
| | 2011 | 33000 | 56029479AA | |
| Durango | 2007-2008 | 33000 | 68001696AB | |
| | 2009-2010 | 33000 | 56029465AB | |
| | 2011-2014 | 33200 | 56029398AB | |
| Grand Caravan | 2002-2003 | 33100/33200 | 52088990AD | |
| | 2006-2006 | 33000 | 68001696AB | |
| | 2007 | 33000 | 68001696AB | |
| | 2008-2010 | 33100/33200 | 68078768AA | |
| | 2011-2014 | 33200 | 56029398AB | |

| | Model | Model Year | EZ-Sensor Part # | OE Sensor Part # |
|---------------|----------------|-------------|------------------|------------------|
| Dodge (cont.) | Intrepid | 2002-2004 | 33100/33200 | 52088990AD |
| | Journey | 2009-2010 | 33100/33200 | 68078768AA |
| | | 2011-2014 | 33200 | 56029398AB |
| | Magnum | 2005-2006 | 33000 | 68001696AB |
| | | 2007-2007 | 33000 | 68001696AB |
| | | 2008 | 33100/33200 | 68078768AA |
| | | 2009-2009 | 33200 | 56029400AC |
| | Nitro | 2010-2011 | 33200 | 56029398AB |
| | | 2007-2008 | 33000 | 68001696AB |
| | | 2009-2012 | 33000 | 56029465AB |
| | RAM 1500 | 2008 | 33000 | 56029319AB |
| | | 2009-2009 | 33000 | 56029319AB |
| | | 2009-2009 | 33100/33200 | 68078768AA |
| | | 2010-2013 | 33200 | 56029398AB |
| | RAM 2500 | 2010-2013 | 33200 | 56029398AB |
| | Sprinter | 2007-2009 | 33000 | 68038945AA |
| Stratus | 2007 | 33000 | 68001696AB | |
| Viper | 2003-2011 | 33100/33200 | 52088990AD | |
| | 2013-2014 | 33200 | 56029400AC | |
| Fiat | 500 (ALL) | 2011-2014 | 33200 | 56029398AB |
| Ford | C-Max | 2012 | 33000 | CM5T-1A180-AA |
| | | 2013-2014 | 33000 | DE8T-1A180-AA |
| | Crown Victoria | 2006-2011 | 33000 | 6F2Z-1A189A |
| | E-150 | 2007-2009 | 33000 | 8C2Z-1A189A |
| | | 2010 | 33000 | 8C2Z-1A189A |
| | | 2010 | 33000 | CM5T-1A180-AA |
| | | 2011-2012 | 33000 | CM5T-1A180-AA |
| | E-250 | 2013-2014 | 33000 | DE8T-1A180-AA |
| | | 2007-2009 | 33000 | 8C2Z-1A189A |
| | | 2010 | 33000 | 8C2Z-1A189A |
| | | 2010 | 33000 | CM5T-1A180-AA |
| | E-350 SD | 2011-2012 | 33000 | CM5T-1A180-AA |
| | | 2013-2014 | 33000 | DE8T-1A180-AA |
| | | 2007-2009 | 33000 | 8C2Z-1A189A |
| | | 2010 | 33000 | 8C2Z-1A189A |
| | Edge | 2010 | 33000 | CM5T-1A180-AA |
| 2011-2012 | | 33000 | CM5T-1A180-AA | |
| 2013-2014 | | 33000 | DE8T-1A180-AA | |
| 2007-2010 | | 33000 | 6F2Z-1A189A | |
| Escape | 2007-2010 | 33000 | 7L1Z-1A189A | |
| | 2011-2013 | 33000 | CM5T-1A180-AA | |
| | 2013-2014 | 33000 | DE8T-1A180-AA | |
| | 2005-2008 | 33000 | 6F2Z-1A189A | |
| Escape | 2009-2012 | 33000 | CM5T-1A180-AA | |
| | 2013 | 33000 | CM5T-1A180-AA | |
| | 2014 | 33000 | DE8T-1A180-AA | |

VEHICLE APPLICATION COVERAGE:
Part No. 33000, 33100 & 33200

EZ-SENSOR 2014 TPMS APPLICATION GUIDE

| Model | Model Year | EZ-Sensor Part # | OE Sensor Part # |
|-----------------------|------------|------------------|------------------|
| Exp Sport Trac | 2006-2010 | 33000 | 6F2Z-1A189A |
| Expedition | 2003-2004 | 33100/33200 | 4L2Z-1A150-BA |
| | 2007-2010 | 33000 | 6F2Z-1A189A |
| | 2007-2010 | 33000 | 7L1Z-1A189A |
| | 2011-2013 | 33000 | CM5T-1A180-AA |
| | 2014 | 33000 | DE8T-1A180-AA |
| Explorer | 2002-2005 | 33100/33200 | 4L2Z-1A150-BA |
| | 2006-2010 | 33000 | 6F2Z-1A189A |
| | 2011-2012 | 33000 | CM5T-1A180-AA |
| | 2013-2014 | 33000 | DE8T-1A180-AA |
| F-150 | 2007-2008 | 33000 | 6F2Z-1A189A |
| | 2009-2010 | 33000 | CM5T-1A180-AA |
| | 2011-2012 | 33000 | CM5T-1A180-AA |
| | 2013-2014 | 33000 | DE8T-1A180-AA |
| F-150 Heavy Duty | 2008 | 33000 | 8C2Z-1A189A |
| F-250 SD | 2008-2009 | 33000 | 8C2Z-1A189A |
| | 2010 | 33000 | 8C2Z-1A189A |
| | 2010 | 33000 | CM5T-1A180-AA |
| | 2011-2012 | 33000 | CM5T-1A180-AA |
| | 2013-2014 | 33000 | DE8T-1A180-AA |
| F-350 SD | 2008-2009 | 33000 | 8C2Z-1A189A |
| | 2010 | 33000 | 8C2Z-1A189A |
| | 2010 | 33000 | CM5T-1A180-AA |
| | 2011-2012 | 33000 | CM5T-1A180-AA |
| | 2013-2014 | 33000 | DE8T-1A180-AA |
| Fiesta | 2011-2012 | 33000 | CM5T-1A180-AA |
| | 2013-2014 | 33000 | DE8T-1A180-AA |
| Five Hundred | 2006-2007 | 33000 | 6F2Z-1A189A |
| Flex | 2009-2010 | 33000 | 7L1Z-1A189A |
| | 2011-2013 | 33000 | CM5T-1A180-AA |
| | 2013-2014 | 33000 | DE8T-1A180-AA |
| Focus | 2007 | 33000 | 6F2Z-1A189A |
| | 2008-2009 | 33000 | 7L1Z-1A189A |
| | 2010-2011 | 33000 | CM5T-1A180-AA |
| | 2012-2014 | 33000 | DE8T-1A180-AA |
| Freestar | 2006-2007 | 33000 | 6F2Z-1A189A |
| Fusion | 2007-2009 | 33000 | 6F2Z-1A189A |
| | 2010-2012 | 33000 | CM5T-1A180-AA |
| | 2013 | 33000 | CM5T-1A180-AA |
| | 2014 | 33000 | DE8T-1A180-AA |
| Grand Marquis | 2007-2011 | 33000 | 6F2Z-1A189A |
| Interceptor Crown Vic | 2006-2011 | 33000 | 6F2Z-1A189A |
| Interceptor Explorer | 2011-2013 | 33000 | CM5T-1A180-AA |
| Interceptor Taurus | 2011-2013 | 33000 | CM5T-1A180-AA |
| Mustang | 2007-2009 | 33000 | 6F2Z-1A189A |
| | 2010-2014 | 33000 | CM5T-1A180-AA |

| Model | Model Year | EZ-Sensor Part # | OE Sensor Part # |
|-----------------|--------------------------|------------------|------------------|
| Ranger | 2007-2011 | 33000 | 6F2Z-1A189A |
| Shelby GT500 | 2012 | 33000 | CM5T-1A180-AA |
| | 2013-2014 | 33100/33200 | DR3V-1A180-BA |
| Taurus | 2008-2009 | 33000 | 7L1Z-1A189A |
| | 2010*** | 33000 | 7L1Z-1A189A |
| | 2010** | 33000 | CM5T-1A180-AA |
| | 2011-2012 | 33000 | CM5T-1A180-AA |
| | 2013-2014 | 33000 | DE8T-1A180-AA |
| Taurus X | 2008-2009 | 33000 | 7L1Z-1A189A |
| Transit | 2014 | 33000 | DE8T-1A180-AA |
| Transit Connect | 2010-2012 | 33000 | CM5T-1A180-AA |
| | 2013-2014 | 33000 | DE8T-1A180-AA |
| Acadia | 2007-2008 | 33000 | 15921013 |
| | 2009-2011 | 33000 | 13586335 |
| | 2012 | 33000 | 13586335 |
| | 2013-2014 | 33000 | 22853741 |
| Canyon | 2007-2012 | 33000 | 15122618 |
| Savana | 2008-2009 | 33000 | 15921013 |
| | 2010-2012 | 33000 | 13586335 |
| | 2013-2014 | 33000 | 22853741 |
| | 2014 | 33000 | 15136883 |
| Sierra All | 2004 | 33000 | 15136883 |
| | 2005-2006 | 33000 | 15114379 |
| | 2007* (SCH Sensor) | 33000 | 15114379 |
| | 2007** | 33000 | 13586335 |
| | 2007* (TRW) | 33000 | 15825475 |
| | 2008-2013 | 33000 | 13586335 |
| Terrain | 2014 | 33000 | 13581558 |
| | 2010-2012 | 33000 | 13586335 |
| Yukon All | 2013-2014 | 33000 | 22854866 |
| | 2004 | 33000 | 15136883 |
| Yukon All | 2005-2006 | 33000 | 15114379 |
| | 2007** | 33000 | 13586335 |
| | 2007* (TRW) | 33000 | 15825475 |
| | 2008-2013 | 33000 | 13586335 |
| | 2014 | 33000 | 13581558 |
| | 2014 | 33000 | 13581558 |
| Accord | 2008-2012 | 33000 | 42753-SWA-316 |
| Civic | 2008-2011 | 33000 | 42753-SNA-A83 |
| | 2012-2014 | 33000 | 42753-TRO-A81 |
| CR-V | 2007-2011 (Alloy Wheels) | 33000 | 42753-SWA-316 |
| | 2007-2011 (Steel Wheels) | 33000 | 42753-SWA-315 |
| CR-Z | 2011-2014 | 33000 | 42753-SNA-A83 |
| Element | 2009-2011 | 33000 | 42753-SNA-A83 |
| Fit | 2008 | 33000 | 42753-SWA-316 |
| | 2009-2013 | 33000 | 42753-SNA-A83 |
| Insight | 2010-2014 | 33000 | 42753-SNA-A83 |
| Odyssey | 2011-2014 | 33000 | 42753-SNA-A83 |
| Odyssey Tour | 2011-2013 | 33000 | 42753-SNA-A83 |
| S2000 | 2008-2009 | 33000 | 42753-S2A-315 |

*Snap-in **Clamp-in

EZ-SENSOR 2014 TPMS APPLICATION GUIDE

▪ VEHICLE APPLICATION COVERAGE:
Part No. 33000, 33100 & 33200

| | Model | Model Year | EZ-Sensor Part # | OE Sensor Part # |
|----------|-----------------|----------------|------------------|------------------|
| Hummer | H2 | 2008-2009 | 33000 | 13586335 |
| | H3 | 2006-2010 | 33000 | 15122618 |
| | H3T | 2006-2010 | 33000 | 15122618 |
| Hyundai | Accent | 2008-2011 | 33000 | 52933_2F000 |
| | | 2012-2014 | 33000 | 52933-2M000 |
| | Azera | 2007-2013 | 33000 | 52933-2G200 |
| | Elantra | 2007-2010 | 33000 | 52933-2G200 |
| | Elantra Touring | 2010-2012 | 33000 | 52933-2M000 |
| | Equus | 2014 | 33000 | 52933-A5000 |
| | Genesis Coupe | 2010-2012 | 33000 | 52933-2M000 |
| | Santa Fe | 2008 (Lo Line) | 33000 | 52933-2G200 |
| | | 2009 | 33000 | 52933-2G200 |
| | | 2010-2012 | 33000 | 52933-0W100 |
| | | 2013-2013 | 33000 | 52933-A5000 |
| | Sonata | 2008 (FM) | 33000 | 52933_2F000 |
| | | 2009-2010 | 33000 | 52933_2F000 |
| | | 2011-2013 | 33000 | 52933-2M000 |
| | Tucson | 2010-2013 | 33000 | 52933_2F000 |
| Veracruz | 2008 (Lo Line) | 33000 | 52933-2G200 | |
| | 2009-2012 | 33000 | 52933-2G200 | |
| Infiniti | EX35 | 2008 | 33000 | 40700-CD001 |
| | | 2009-2010 | 33000 | 40700-JK00B |
| | | 2010.5-2013 | 33000 | 40700-1LA0A |
| | | 2010.5-2013 | 33000 | 40700-1LA0A |
| | EX37 | 2011-2012 | 33000 | 40700-1LA0A |
| | | 2011-2012 | 33000 | 40700-1LA0A |
| | FX35 | 2003-2004 | 33000 | 40700-CD001 |
| | | 2005-2008 | 33000 | 40700-CD001 |
| | | 2009-2010 | 33000 | 40700-JK00B |
| | | 2010.5-2013 | 33000 | 40700-1LA0A |
| | | 2010.5-2013 | 33000 | 40700-1LA0A |
| | FX37 | 2013 | 33000 | 40700-1LA0A |
| | | 2013 | 33000 | 40700-1LA0A |
| | FX45 | 2003-2004 | 33000 | 40700-CD001 |
| | | 2005-2008 | 33000 | 40700-CD001 |
| FX50 | 2009-2010 | 33000 | 40700-JK00B | |
| | 2010.5-2013 | 33000 | 40700-1LA0A | |
| | 2010.5-2013 | 33000 | 40700-1LA0A | |
| G25 | 2011-2013 | 33000 | 40700-1LA0A | |
| | 2011-2013 | 33000 | 40700-1LA0A | |
| G35 | 2003-2004 | 33000 | 40700-CD001 | |
| | 2005-2006 | 33000 | 40700-CD001 | |
| | 2007 | 33000 | 40700-JA00C | |
| | 2008 | 33000 | 40700-JK00B | |
| G37 | 2008-2010 | 33000 | 40700-JK00B | |
| | 2010.5-2013 | 33000 | 40700-1LA0A | |
| | 2010.5-2013 | 33000 | 40700-1LA0A | |
| M35 | 2003-2008 | 33000 | 40700-CD001 | |
| | 2009-2012 | 33000 | 40700-JA00C | |
| M35 H | 2012 | 33000 | 40700-1LA0A | |
| | 2012 | 33000 | 40700-1LA0A | |

| | Model | Model Year | EZ-Sensor Part # | OE Sensor Part # |
|------------------|----------------|--------------------------|------------------|------------------|
| Infiniti (cont.) | M37 | 2011-2013 | 33000 | 40700-1LA0A |
| | | 2011-2013 | 33000 | 40700-1LA0A |
| | M45 | 2003-2008 | 33000 | 40700-CD001 |
| | | 2009-2010 | 33000 | 40700-JA00C |
| | M56 | 2011-2013 | 33000 | 40700-1LA0A |
| | | 2011-2013 | 33000 | 40700-1LA0A |
| | Q45 | 2003-2004 | 33000 | 40700-CD001 |
| | | 2005-2006 | 33000 | 40700-CD001 |
| | QX4 | 2003 | 33000 | 40700-CD001 |
| | QX56 | 2004-2004 | 33000 | 40700-CK002 |
| | | 2005-2006 (Alloy Wheels) | 33000 | 40700-CK001 |
| | | 2005-2006 (Steel Wheels) | 33000 | 40700-CK002 |
| 2007 | | 33000 | 40700-CK002 | |
| 2008-2010 | | 33000 | 40700-JA00C | |
| 2011-2013 | | 33000 | 40700-1LA0A | |
| Isuzu | i-290 | 2007-2009 | 33000 | 15122618 |
| | | 2007-2009 | 33000 | 15122618 |
| | Rodeo | 2004 | 33100/33200 | 52088990AD |
| | Commander | 2006 | 33000 | 68001696AB |
| | | 2007 | 33000 | 56053036AA |
| | | 2008-2011 | 33100/33200 | 68078768AA |
| | Compass | 2007-2011 | 33000 | 68001696AB |
| | | 2013 | 33000 | 68001696AB |
| | Grand Cherokee | 2002-2004 | 33100/33200 | 52088990AD |
| | | 2005-2006 | 33000 | 68001696AB |
| | | 2007 | 33000 | 56053036AA |
| | | 2008-2010 | 33100/33200 | 68078768AA |
| 2011-2014 | | 33200 | 56029398AB | |
| Jeep | Liberty | 2002-2004 | 33100/33200 | 52088990AD |
| | | 2005-2006 | 33000 | 68001696AB |
| | | 2007-2008 | 33000 | 68001696AB |
| | | 2009 | 33000 | 56029465AB |
| | | 2009 | 33100/33200 | 68078768AA |
| | | 2010-2012 | 33000 | 56029465AB |
| | Patriot | 2007-2012 | 33000 | 68001696AB |
| | Wrangler | 2007-2008 | 33000 | 68001696AB |
| | | 2009 | 33100/33200 | 68078768AA |
| 2009 | | 33000 | 56029479AA | |
| Kia | Borrego | 2009-2011 | 33000 | 52933_2F000 |
| | | 2014 | 33000 | 52933-A5000 |
| | Forte | 2010-2013 | 33000 | 52933-2M000 |
| | Optima | 2006-2010 | 33000 | 52933-2G200 |
| | | 2011-2013 | 33000 | 52933-2M000 |
| | Rio | 2007-2011 | 33000 | 52933_2F000 |
| | Rondo | 2006-2011 | 33000 | 52933-2G200 |

VEHICLE APPLICATION COVERAGE:
Part No. 33000, 33100 & 33200

EZ-SENSOR 2014 TPMS APPLICATION GUIDE

| | Model | Model Year | EZ-Sensor Part # | OE Sensor Part # |
|-------------|-------------|--------------|------------------|------------------|
| Kia (cont.) | Sedona | 2009-2013 | 33000 | 52933-2G200 |
| | Sorento | 2011-2013 | 33000 | 52933-2M000 |
| | | 2014 | 33000 | 52933-A5000 |
| | Soul | 2010-2013 | 33000 | 52933-2M000 |
| | Spectra | 2007-2011 | 33000 | 52933_2F000 |
| Sportage | 2009-2010 | 33000 | 52933_2F000 | |
| | 2011-2013 | 33000 | 52933_2F000 | |
| Land Rover | LR3 | 2002-2005 | 33100/33200 | LR031761 |
| | Range Rover | 2003-2005 | 33100/33200 | LR031761 |
| Lexus | CT 200H | 2011-2013 | 33000 | 42607-33021 |
| | ES 300H | 2013 | 33000 | 42607-06020 |
| | ES 350 | 2007-2013 | 33000 | 42607-33021 |
| | GS 300 | 2005-2011 | 33000 | 42607-33021 |
| | GS 350 | 2007-2012 | 33000 | 42607-33021 |
| | | 2013 | 33100/33200 | 42607-02030 |
| | GS 430 | 2005 | 33000 | 42607-30030 |
| | | 2006 (Early) | 33000 | 42607-30030 |
| | | 2006 (Late) | 33000 | 42607-33021 |
| | | 2007 | 33000 | 42607-33021 |
| | GS 450H | 2007-2012 | 33000 | 42607-33021 |
| | GS 460 | 2008-2012 | 33000 | 42607-33021 |
| | | 2010-2013 | 33000 | 42607-33021 |
| | GX 470 | 2004-2005 | 33000 | 42607-35010 |
| | | 2006 (Early) | 33000 | 42607-30030 |
| | | 2006 (Late) | 33000 | 42607-33021 |
| | | 2007-2009 | 33000 | 42607-33021 |
| | IS 250 | 2006-2013 | 33000 | 42607-33021 |
| | IS 300H | 2006-2013 | 33000 | 42607-33021 |
| | IS 350 | 2006-2013 | 33000 | 42607-33021 |
| | IS C | 2006-2012 | 33000 | 42607-33021 |
| | IS F | 2006-2013 | 33000 | 42607-33021 |
| | LFA | 2012-2013 | 33000 | 42607-33021 |
| | LS 460 | 2007-2012 | 33000 | 42607-33021 |
| | | 2013 | 33000 | 42607-06020 |
| | LS 600H | 2008-2013 | 33000 | 42607-33021 |
| | LX 470 | 2005-2007 | 33000 | 42607-33021 |
| | LX 570 | 2008-2012 | 33000 | 42607-33021 |
| | | 2013-2013 | 33000 | 42607-33021 |
| | RX 330 | 2006 | 33000 | 42607-33021 |
| | RX 350 | 2007-2012 | 33000 | 42607-33021 |
| | RX 400H | 2007-2012 | 33000 | 42607-33021 |
| RX 450H | 2010-2012 | 33000 | 42607-33021 | |
| | 2013 | 33000 | 42607-33021 | |
| Lincoln | Aviator | 2003-2005 | 33100/33200 | 4L2Z-1A150-BA |
| | CUV | 2014 | 33000 | DE8T-1A180-AA |
| | Mark LT | 2007-2008 | 33000 | 6F2Z-1A189A |
| | | 2009 | 33000 | CM5T-1A180-AA |
| | | 2013-2014 | 33000 | DE8T-1A180-AA |
| | MKS | 2009-2010 | 33000 | 7L1Z-1A189A |
| | | 2011-2012 | 33000 | CM5T-1A180-AA |
| 2013-2014 | | 33000 | DE8T-1A180-AA | |

| | Model | Model Year | EZ-Sensor Part # | OE Sensor Part # |
|-------------------------------|-----------------------|---------------------------|------------------|------------------|
| Lincoln (cont.) | MKT | 2010 | 33000 | 7L1Z-1A189A |
| | | 2011-2013 | 33000 | CM5T-1A180-AA |
| | | 2013-2014 | 33000 | DE8T-1A180-AA |
| | MKX | 2007-2010 (Chrome Wheels) | 33000 | 6F2Z-1A189A |
| 2007-2010 (w/o Chrome Wheels) | | 33000 | 7L1Z-1A189A | |
| MKZ | 2011-2013 | 33000 | CM5T-1A180-AA | |
| | 2013-2014 | 33000 | DE8T-1A180-AA | |
| | 2007-2009 | 33000 | 6F2Z-1A189A | |
| | 2010-2013 | 33000 | CM5T-1A180-AA | |
| Navigator | 2014 | 33000 | DE8T-1A180-AA | |
| | 2003-2004 | 33100/33200 | 4L2Z-1A150-BA | |
| | 2007-2010 | 33000 | 7L1Z-1A189A | |
| | 2011-2012 | 33000 | CM5T-1A180-AA | |
| Town Car | 2013-2014 | 33000 | DE8T-1A180-AA | |
| | 2006-2011 | 33000 | 6F2Z-1A189A | |
| | 2007-2010 | 33000 | CM5T-1A180-AA | |
| Maserati | Quattroporte | 2004-2008 | 33100/33200 | 224549 |
| Maybach | 57 | 2003-2011 | 33000 | A 005 542 24 18 |
| | 62 | 2003-2011 | 33000 | A 005 542 24 18 |
| | 57 S | 2006-2011 | 33000 | A 005 542 24 18 |
| | 62 S | 2003-2011 | 33000 | A 005 542 24 18 |
| Landaulet | 2009-2011 | 33000 | A 005 542 24 18 | |
| Mazda | B Pickup | 2007-2008 | 33000 | 6F2Z-1A189A |
| | Tribute | 2006-2008 | 33000 | 6F2Z-1A189A |
| | | 2009-2011 | 33000 | CM5T-1A180-AA |
| Mercedes-Benz | C250 | 2012-2013 | 33200 | A 000 905 7200 |
| | C300 | 2008-2013 | 33200 | A 000 905 7200 |
| | C350 | 2008-2013 | 33200 | A 000 905 7200 |
| | C63 AMG | 2008-2013 | 33200 | A 000 905 7200 |
| | CL500/CL55 AMG | 2000-2006 | 33000 | A 005 542 24 18 |
| | CL500/CL55AMG/CL63AMG | 2010-2012 | 33200 | A 000 905 7200 |
| | CL550 | 2010-2012 | 33200 | A 000 905 7200 |
| | CL600 | 2010-2012 | 33200 | A 000 905 7200 |
| | CL65 AMG | 2010-2012 | 33200 | A 000 905 7200 |
| | CLK350 | 2006-2009 | 33200 | A 000 905 7200 |
| | CLK500 | 2006-2006 | 33200 | A 000 905 7200 |
| | CLK55 AMG | 2006-2006 | 33200 | A 000 905 7200 |
| | CLK550 | 2007-2009 | 33200 | A 000 905 7200 |
| | CLK63 AMG | 2007-2008 | 33200 | A 000 905 7200 |
| | CLS550 | 2012 | 33200 | A 000 905 7200 |
| | CLS63 AMG | 2012 | 33200 | A 000 905 7200 |
| | E350 | 2010-2012 | 33200 | A 000 905 7200 |
| E550 | 2010-2012 | 33200 | A 000 905 7200 | |
| E63 AMG | 2010-2012 | 33200 | A 000 905 7200 | |

*Snap-in **Clamp-in

EZ-SENSOR ²⁰¹⁴ TPMS APPLICATION GUIDE

▪ VEHICLE APPLICATION COVERAGE:
Part No. 33000, 33100 & 33200

| Model | Model Year | EZ-Sensor Part # | OE Sensor Part # | | |
|--------------------------|---------------|--------------------------|------------------|-----------------|---------------|
| Mercedes-Benz (cont.) | G500 | 2008 | 33200 | A 000 905 7200 | |
| | G55 AMG | 2008-2011 | 33200 | A 000 905 7200 | |
| | G550 | 2009-2013 | 33200 | A 000 905 7200 | |
| | GL350 | 2010-2013 | 33200 | A 000 905 7200 | |
| | GL450 | 2010-2012 | 33200 | A 000 905 7200 | |
| | GL550 | 2010-2012 | 33200 | A 000 905 7200 | |
| | GL63 AMG | 2013 | 33200 | A 000 905 7200 | |
| | GLK350 | 2010-2013 | 33200 | A 000 905 7200 | |
| | ML350 | 2010-2012 | 33200 | A 000 905 7200 | |
| | ML450 | 2010-2011 | 33200 | A 000 905 7200 | |
| | ML550 | 2010-2012 | 33200 | A 003 540 02 17 | |
| | ML63 AMG | 2010-2011 | 33200 | A 000 905 7200 | |
| | R350 | 2010-2012 | 33200 | A 000 905 7200 | |
| | S350 | 2012-2013 | 33200 | A 000 905 7200 | |
| | S400 | 2011-2012 | 33200 | A 000 905 7200 | |
| | S430/S500 | 2000-2006 | 33000 | A 005 542 24 18 | |
| | | 2000-2006 | 33100/33200 | A 005 542 23 18 | |
| | S550 | 2011-2012 | 33200 | A 000 905 7200 | |
| | S600 | 2011-2012 | 33200 | A 000 905 7200 | |
| | S63 AMG | 2010-2012 | 33200 | A 000 905 7200 | |
| | SLK250 | 2012-2013 | 33200 | A 000 905 7200 | |
| | SLK280 | 2008 | 33200 | A 000 905 7200 | |
| | SLK300 | 2009-2011 | 33200 | A 000 905 7200 | |
| | SLK350 | 2008-2012 | 33200 | A 000 905 7200 | |
| | SLK55 AMG | 2008-2010 | 33200 | A 000 905 7200 | |
| | SLS AMG | 2011 | 33200 | A 000 905 7200 | |
| | Sprinter 2500 | 2010-2012 | 33000 | 68038945AA | |
| | Sprinter 3500 | 2010-2012 | 33000 | 68038945AA | |
| | Mercury | Grand Marquis | 2006-2011 | 33000 | 6F2Z-1A189A |
| | | Mariner | 2006-2008 | 33000 | 6F2Z-1A189A |
| | | | 2009-2011 | 33000 | CM5T-1A180-AA |
| | | Milan | 2008-2009 | 33000 | 6F2Z-1A189A |
| | | | 2010-2011 | 33000 | CM5T-1A180-AA |
| Montego | | 2006-2007 | 33000 | 6F2Z-1A189A | |
| Monterey | | 2006-2007 | 33000 | 6F2Z-1A189A | |
| Mountaineer | | 2002-2005 | 33100/33200 | 4L2Z-1A150-BA | |
| | | 2006-2010 | 33000 | 6F2Z-1A189A | |
| Sable | | 2008-2009 | 33000 | 7L1Z-1A189A | |
| Mitsubishi | Eclipse | 2006-2007 (Alloy Wheels) | 33000 | MN103081 | |
| | | 2006-2007 (Steel Wheels) | 33000 | 4250A030 | |
| | | 2008-2010 | 33000 | MN103081 | |
| | | 2011-2012 (Alloy Wheels) | 33000 | 4250B877 | |
| | | 2011-2012 (Steel Wheels) | 33000 | 4250B875 | |
| | Endeavor | 2004-2006 | 33100/33200 | MN103033 | |
| | | 2007 | 33000 | MN103081 | |
| | | 2007 | 33100/33200 | MN103033 | |
| | | 2008-2010 | 33000 | MN103081 | |
| | | 2011-2012 (Alloy Wheels) | 33000 | 4250B877 | |
| 2011-2012 (Steel Wheels) | 33000 | 4250B875 | | | |

| Model | Model Year | EZ-Sensor Part # | OE Sensor Part # | |
|----------------------|--------------------------|--------------------------|------------------|-------------|
| Mitsubishi (cont.) | Galant | 2004-2006 | 33100/33200 | MN103033 |
| | | 2007-2009 (Alloy Wheels) | 33000 | MN103081 |
| | | 2007-2009 (Steel Wheels) | 33000 | 4250A030 |
| | | 2010 | 33000 | MN103081 |
| | | 2011-2013 (Alloy Wheels) | 33000 | 4250B877 |
| | 2011-2013 (Steel Wheels) | 33000 | 4250B875 | |
| | Lancer | 2008-2010 | 33000 | 4250B975 |
| | | 2011-2014 | 33000 | 4250B975 |
| | Mirage | 2014 | 33000 | 4250B975 |
| | Montero | 2003-2006 | 33000 | MN103081 |
| | Outlander | 2007-2010 | 33000 | 4250B975 |
| | | 2011-2014 | 33000 | 4250B975 |
| | Raider | 2008-2009 | 33000 | 56029319AB |
| | RVR | 2011-2014 | 33000 | 4250B975 |
| | 350Z | 2003 | 33000 | 40700-CD001 |
| 2004-2006 | | 33000 | 40700-CD001 | |
| 2007-2008 | | 33000 | 40700-JA00C | |
| 370Z | 2009-2010 | 33000 | 40700-JK00C | |
| | 2010.5-2013 | 33000 | 40700-1LA0A | |
| | 2010.5-2013 | 33000 | 40700-1LA0A | |
| Altima | 2006-2012 | 33000 | 40700-1AA0D | |
| Armada | 2005-2006 (Alloy Wheels) | 33000 | 40700-CK001 | |
| | 2005-2006 (Steel Wheels) | 33000 | 40700-CK002 | |
| | 2007-2008 | 33000 | 40700-CK001 | |
| | 2009-2013 | 33000 | 40700-1AA0D | |
| Cube | 2009 | 33000 | 40700-JA00C | |
| | 2010-2010 | 33000 | 40700-1AA0C | |
| | 2011-2013 (ikey) | 33000 | 40700-1LA0A | |
| | 2011-2013 (ikey) | 33000 | 40700-1LA0A | |
| | 2011-2013 (non-ikey) | 33000 | 40700-1AA0C | |
| Frontier | 2003-2004 | 33000 | 40700-CD001 | |
| | 2005-2007 (Alloy Wheels) | 33000 | 40700-CK001 | |
| | 2005-2007 (Steel Wheels) | 33000 | 40700-CK002 | |
| | 2008 (Alloy Wheels) | 33000 | 40700-CK001 | |
| | 2008 (Steel Wheels) | 33000 | 40700-JA00C | |
| | 2009-2013 | 33000 | 40700-1AA0D | |
| | GT-R | 2009-2014 | 33000 | 40700-JA00C |
| | Juke | 2011-2013 (ikey) | 33000 | 40700-1LA0A |
| 2011-2013 (ikey) | | 33000 | 40700-1LA0A | |
| 2011-2013 (non-ikey) | | 33000 | 40700-1AA0C | |

VEHICLE APPLICATION COVERAGE:
Part No. 33000, 33100 & 33200

EZ-SENSOR 2014 TPMS APPLICATION GUIDE

| Model | Model Year | EZ-Sensor Part # | OE Sensor Part # |
|------------|-----------------------------|------------------|------------------|
| Leaf | 2011-2012 | 33000 | 40700-1LA0A |
| | 2011-2012 | 33000 | 40700-1LA0A |
| Maxima | 2006 | 33000 | 40700-CK001 |
| | 2007 (Alloy Wheels) | 33000 | 40700-CK001 |
| | 2007 (Steel Wheels) | 33000 | 40700-1AA0D |
| | 2008-2013 | 33000 | 40700-1AA0D |
| Maxima GCC | 2013 | 33100/33200 | 40700-1AY0A |
| Murano | 2003-2006 | 33000 | 40700-CD001 |
| | 2007-2009 | 33000 | 40700-1AA0D |
| | 2010-2012 | 33000 | 40700-1AA0C |
| Pathfinder | 2003 | 33000 | 40700-CD001 |
| | 2004 (Alloy Wheels) | 33000 | 40700-CD001 |
| | 2004 (Steel Wheels) | 33000 | 40700-CK002 |
| | 2005-2006 | 33000 | 40700-CK001 |
| | 2007-2012 | 33000 | 40700-1AA0D |
| | Quest | 2004-2004 | 33000 |
| Quest | 2005-2007 (Alloy Wheels) | 33000 | 40700-CK001 |
| | 2005-2007 (Steel Wheels) | 33000 | 40700-CK002 |
| | 2008-2009 | 33000 | 40700-1AA0D |
| | 2011-2013 | 33000 | 40700-1LA0A |
| Rogue | 2008-2013 | 33000 | 40700-JA00C |
| Sentra | 2007-2008 (Alloy Wheels) | 33000 | 40700-CK001 |
| | 2007-2008 (Steel Wheels) | 33000 | 40700-1AA0D |
| | 2009-2012 | 33000 | 40700-1AA0D |
| Titan | 2004 | 33000 | 40700-CK002 |
| | 2005-2007 (Alloy Wheels) | 33000 | 40700-CK001 |
| | 2005-2007 (Steel Wheels) | 33000 | 40700-CK002 |
| | 2008 (Alloy Wheels) | 33000 | 40700-CD001 |
| | 2008 (Steel Wheels) | 33000 | 40700-1AA0D |
| Versa | 2009-2013 | 33000 | 40700-1AA0D |
| | 2007-2008 (Alloy Wheels) | 33000 | 40700-CK001 |
| | 2007-2008 (Steel Wheels) | 33000 | 40700-1AA0D |
| | 2009-2011 | 33000 | 40700-1AA0D |
| Xterra | 2012 | 33000 | 40700-1AA0C |
| | 2003-2004 | 33000 | 40700-CD001 |
| | 2005 | 33000 | 40700-CK001 |
| | 2006 (Alloy Wheels) | 33000 | 40700-CK001 |
| Xterra | 2006 (Steel Wheels) | 33000 | 40700-CK002 |
| | 2007-2013 | 33000 | 40700-1AA0D |

Nissan (cont.)

| Model | Model Year | EZ-Sensor Part # | OE Sensor Part # | |
|--------------|------------|------------------|----------------------|-----------------|
| Pontiac | G3 | 2009-2010 | 33000 | 13586335 |
| | G5 | 2008 | 33000 | 15921013 |
| | | 2009-2010 | 33000 | 13586335 |
| | G6 | 2008* | 33000 | 15921013 |
| | | 2008** | 33000 | 13586335 |
| | | 2009-2010 | 33000 | 13586335 |
| | G8 | 2008-2009 | 33000 | 13586335 |
| | Grand Prix | 2007 | 33000 | 15921013 |
| | | 2008* | 33000 | 15921013 |
| | | 2008** | 33000 | 13586335 |
| | Montana | 2008 | 33000 | 15268606 |
| Solstice | 2008-2010 | 33000 | 15921013 | |
| Torrent | 2007-2009 | 33000 | 10394110 | |
| Vibe | 2008-2010 | 33000 | 88974915 | |
| Wave | 2008-2009 | 33000 | 13586335 | |
| Porsche | 911 | 2005-2012 | 33100/33200 | 99760602101 |
| | Boxster | 2005-2011 | 33100/33200 | 99760602101 |
| | Carrera | 2004-2011 | 33100/33200 | 99760602101 |
| | Cayenne | 2002-2006 | 33100/33200 | 99760602101 |
| | Cayman | 2006-2011 | 33100/33200 | 99760602101 |
| Saturn | Astra | 2010 | 33000 | 13586335 |
| | Aura | 2007 | 33000 | 15921013 |
| | | 2008* | 33000 | 15921013 |
| | | 2008** | 33000 | 13586335 |
| | | 2009-2010 | 33000 | 13586335 |
| | Lambda | 2007-2008 | 33000 | 15268606 |
| | Outlook | 2007-2008 | 33000 | 15921013 |
| | | 2009-2010 | 33000 | 13586335 |
| Sky | 2008-2009 | 33000 | 15921013 | |
| Vue | 2007-2010 | 33000 | 13586335 | |
| Scion | FR-S | 2013 | 33000 | 42607-06020 |
| | iQ | 2012-2013 | 33000 | 42607-33011 |
| | tC | 2006-2014 | 33000 | 42607-33011 |
| | xB | 2007-2013 | 33000 | 42607-33011 |
| Smart | xD | 2008-2013 | 33000 | 42607-33011 |
| | | Fortwo | 2008 (SCH Sensor) | 33200 |
| Subaru | Fortwo | 2009-2012 | 33200 | A 003 540 02 17 |
| | | B9 Tribeca | 2006-2011 | 33000 |
| | BRZ | 2013-2014 | 33000 | 42607-06020 |
| | Forester | 2008-2013 | 33000 | 28103AG01C |
| | Impreza | 2008-2013 | 33000 | 28103AG01C |
| | Legacy | 2004-2007 | 33000 | 28103AG00A |
| | | 2008-2014 | 33000 | 28103AG01C |
| | Outback | 2004-2007 | 33000 | 28103AG00A |
| | | 2008-2014 | 33000 | 28103AG01C |
| Tribeca | 2008-2014 | 33000 | 28103AG01C | |
| XV Crosstrek | 2013 | 33000 | 28103AG01C | |

*Snap-in **Clamp-in

EZ-SENSOR ²⁰¹⁴ TPMS APPLICATION GUIDE

▪ VEHICLE APPLICATION COVERAGE:
Part No. 33000, 33100 & 33200

| | Model | Model Year | EZ-Sensor Part # | OE Sensor Part # |
|--------------------------|-------------------|--------------------------|------------------|------------------|
| Suzuki | Equator | 2009-2013 | 33000 | 43211-82Z00 |
| | Forenza | 2007-2008 | 33000 | 43130-85Z03 |
| | Grand Vitara | 2007-2013 | 33000 | 43130-54J21 |
| | Reno | 2007-2008 | 33000 | 43130-85Z00 |
| | SX-4 | 2007-2013 | 33000 | 43130-54J21 |
| | XL-7 | 2005-2006 | 33000 | 43130-54J21 |
| Toyota | 4Runner | 2007-2011 | 33000 | 43130-78J00 |
| | | 2004-2005 | 33000 | 42607-35010 |
| | | 2006 (Early) | 33000 | 42607-35010 |
| | | 2006 (Late) | 33000 | 42607-33011 |
| | | 2007-2012 | 33000 | 42607-33011 |
| | Avalon | 2013 | 33000 | 42607-33021 |
| | | 2007-2012 | 33000 | 42607-06011 |
| | Camry | 2013-2014 | 33000 | 42607-06020 |
| | | 2007-2011 (Mfg in Japan) | 33000 | 42607-33011 |
| | Camry Hybrid | 2007-2011 (Mfg in USA) | 33000 | 42607-06011 |
| | | 2012-2014 | 33000 | 42607-06020 |
| | | 2008-2011 | 33000 | 42607-33011 |
| | Corolla | 2014 | 33000 | 42607-06020 |
| | | 2007-2013 (Mfg in Japan) | 33000 | 42607-33011 |
| | | 2007-2013 (Mfg in USA) | 33000 | 42607-06011 |
| | FJ Cruiser | 2014 | 33000 | 42607-06020 |
| | | 2008-2012 | 33000 | 42607-33011 |
| | Highlander | 2013 | 33000 | 42607-33011 |
| | | 2007-2012 | 33000 | 42607-33011 |
| | Highlander Hybrid | 2013 | 33000 | 42607-06011 |
| | | 2008-2012 | 33000 | 42607-33011 |
| | Land Cruiser | 2014 | 33000 | 42607-33011 |
| | | 2007 (Early) | 33000 | 42607-33021 |
| | | 2007 (Late) | 33000 | 42607-33011 |
| | | 2005-2005 | 33000 | 42607-33011 |
| | | 2006-2006 | 33000 | 42607-33021 |
| | Matrix | 2007 (Early) | 33000 | 42607-33021 |
| 2007-2013 (Mfg in Japan) | | 33000 | 42607-33011 | |
| 2007-2013 (Mfg in USA) | | 33000 | 42607-06011 | |
| Prius | 2005-2013 | 33000 | 42607-33011 | |
| Prius C | 2012 | 33000 | 42607-52020 | |
| | 2014-2014 | 33000 | 42607-52020 | |
| Prius V | 2012 | 33000 | 42607-33011 | |
| RAV4 | 2006-2006 | 33000 | 42607-33011 | |
| | 2007-2012 | 33000 | 42607-33021 | |

| | Model | Model Year | EZ-Sensor Part # | OE Sensor Part # |
|----------------|------------|-------------------------------|------------------|------------------|
| Toyota (cont.) | RAV4 EV | 2012 | 33000 | 42607-06011 |
| | Sequoia | 2004-2007 (Alloy Wheels) | 33000 | 42607-0C020 |
| | | 2004-2007 (Steel Wheels) | 33000 | 42607-0C010 |
| | | 2008 (Alloy Wheels) | 33000 | 42607-08010 |
| | | 2008 (Steel Wheels) | 33000 | 42607-0C060 |
| | | 2009-2013 | 33000 | 42607-08010 |
| | Sienna | 2006-2014 | 33000 | 42607-08010 |
| | Solara | 2006-2011 | 33000 | 42607-06011 |
| | Tacoma | 2006 (Early) (Alloy Wheels) | 33000 | 42607-AD020 |
| | | 2005 (Alloy Wheels) | 33000 | 42607-AD020 |
| | | 2006 (Late) (Alloy Wheels) | 33000 | 42607-06011 |
| | | 2006 (Steel Wheels) | 33000 | 42607-04010 |
| | | 2007-2013 (Alloy Wheels) | 33000 | 42607-06011 |
| | Tundra | 2007-2013 (Steel Wheels) | 33000 | 42607-04010 |
| | | 2005 (Alloy Wheels) | 33000 | 42607-0C020 |
| | | 2005 (Steel Wheels) | 33000 | 42607-0C010 |
| | | 2006 (Pacific) (Alloy Wheels) | 33000 | 42607-0C020 |
| | | 2006 (Pacific) (Steel Wheels) | 33000 | 42607-0C010 |
| | Venza | 2006 (TRW) (Alloy Wheels) | 33000 | 42607-08010 |
| | | 2006 (TRW) (Steel Wheels) | 33000 | 42607-0C060 |
| | | 2007-2014 (Alloy Wheels) | 33000 | 42607-08010 |
| | | 2007-2014 (Steel Wheels) | 33000 | 42607-0C060 |
| | | 2009-2013 | 33000 | 42607-06011 |
| | Yaris | 2008-2011 | 33000 | 42607-33011 |
| | | 2012 | 33000 | 42607-06020 |
| | | 2013 | 33000 | 42607-06011 |
| | Volkswagen | Phaeton | 2002-2006 | 33100/33200 |
| Touareg | | 2002-2006 | 33100/33200 | 7L0 907 275B |
| VPG | MV-1 | 2012-2013 | 33000 | CM5T-1A180-AA |

REDI-SENSOR 2014 TPMS APPLICATION GUIDE

■ VEHICLE APPLICATION COVERAGE: Part No. 7001HP, 7001HPR, 7002, 7003 & 7004

| Model | REDI-Sensor # | Dill Sensor # | OE Sensor # | Model | REDI-Sensor # | Dill Sensor # | OE Sensor # | | |
|--|---------------|---------------|---------------|---|---------------|---------------|---------------|------------------|------------|
| Buick, Cadillac, Chevrolet, GMC, Hummer, Isuzu, Mazda, Pontiac, Saab, Saturn, Suzuki | 7001HP | 1047 | 10394110 | Chrysler, Dodge, Jeep, Mitsubishi, Suzuki | 7001HP | 1051 | 68001696AA | | |
| | | 9158 | 15921013 | | | 68001696AB | | | |
| | | | 15268606 | | | 9066 | 56053030AA | | |
| | | | 15825475 | | | | 56053030AB | | |
| | | | 20964159 | | | | 56053030AC | | |
| | | | 20925924 | | | | 56053066AA | | |
| | | | 43130-78J00 | | | | 56053036AA | | |
| | | | 43130-78J10 | | | | 5139640AA | | |
| | | | 43130-78J21 | | | | 56029465AA | | |
| | | | 7001HPR | | | | 9153 | 25920615 | 56029465AB |
| | | | | | | | | 12768826 | 56029465AC |
| | | 25799331* | | | | | | 5142340AA | |
| | | 15922396 | | | | 425 0A 225 | | | |
| | 15202272 | 425 0B 668 | | | | | | | |
| | 20923680 | 425 0B 975 | | | | | | | |
| | 15123145 | 43130-57L00 | | | | | | | |
| | 15254101 | 68078861AA | | | | | | | |
| | 20922900 | (56029526AA) | | | | | | | |
| | 20922901 | 1052 | | | | 5127335AA-AF | | | |
| | 22854866 | | | | | 4727392AA-AE | | | |
| | 13586335 | 7001HPR | | | | 9154 | | 56029319AA-AC | |
| | 13581558 | | | | | | | 68137699AA | |
| | 13589255 | 7001HPR | | | | 9315 | | 56029479AA-AB | |
| | 92186507 | | | | | | | 9L3Z-1A189-AA-AF | |
| | 25789964 | | | | | | | 9L3T-1A180-AA-AF | |
| | 25809220 | | | | | | | 9L3Z-1A189-A | |
| | 22959744 | | | | | | | 9L3T-1A150-BD | |
| | 22853741 | | | | DR3Z-1A189-A | | | | |
| | 43130-85Z00 | | ZZDA-37-140 | | | | | | |
| | 43130-85Z01 | | SPo00437 | | | | | | |
| | 43130-85Z03 | | DE8T-1A180-AA | | | | | | |
| | 7001HP | | 1056 | | FE01-37-140A | | BB5Z-1A-189A | | |
| | | | | | GN3A-37-140A | | CM5T-1A180-AA | | |
| GN3A-37-140B | | | | CM5T-1A150-AA | | | | | |
| GS1D-37-140 | | | | 7001HP | 9135 | | 5L1Z-1A150-AA | | |
| BHA4-37-140 | | | | | | | 5L1Z-1A150-AB | | |
| BBP3-37-140B | | | | | | | 5L7T-1A150-AA | | |
| BBM2-37-140B | | | | 7001HPR | 1048 | | 6F2Z-1A189A | | |
| 9116 | | | | | | | 25774006** | 6F2A-1A176AE | |
| | | 25763677 | | | | 6L2T-1A150-AA | | | |
| | | 25774007 | | | | 6F2T-1A150AE | | | |
| 9076 | 15163068 | ZZC2-37-14X | | | | | | | |
| | 25758220 | ZZC1-37-140 | | | | | | | |
| | 25758221 | 7L1Z-1A189A | | | | | | | |
| | 25740352 | 7001HPR | 1048-HP | 8C2Z-1A189-A | | | | | |
| | 10306573 | | | 8C2T-1A150-BA | | | | | |
| | 10354988 | | | | | | | | |

*Aveo-5 not Included. **Must drive vehicle following relearn procedure.
7001HP/HPR replaces 164 OEM part numbers, 21 Dill.

Application guides subject to change without notice. Please refer to the manufacturer's websites for the most up-to-date application data.

REDI-SENSOR 2014 TPMS APPLICATION GUIDE

VEHICLE APPLICATION COVERAGE:
Part No. 7001HP, 7001HPR, 7002, 7003 & 7004

| Model | REDI-Sensor # | Dill Sensor # | OE Sensor # | |
|------------------|---------------|--------------------|-------------|-------------|
| Hyundai, KIA | 7001HP | 5507 | 52933-2L500 | |
| | | | 52933-2M000 | |
| | | | 52933-2M500 | |
| | | | 52933-2M550 | |
| | | | 52933-3N000 | |
| | | | 52933-A5000 | |
| | | | 52933-2L700 | |
| Mitsubishi | 7001HP | 9034 | MN103081 | |
| | | | 90518281 | |
| | | | 425 0B 877 | |
| | | 9069 | 425 0A 030 | |
| | | | 425 0B 875 | |
| Nissan, Infiniti | 7001HP | 9204 | 40700-JK00B | |
| | | | 40700-JK00A | |
| | | | 40700-JA00C | |
| | | | 40700-JA01B | |
| | | | 40700-JA02B | |
| | | | 40700-JA00B | |
| | | | 40700-JA01A | |
| | | | 40700-1AA0B | |
| | | | 40700-1AA0C | |
| | | | 40700-1AA0D | |
| | | | 40700-1AA0E | |
| | | | 40700-JA01C | |
| | | | 40700-JK01A | |
| | | | 40700-JK00E | |
| | 40700-JK00C | | | |
| | 7001HP | 5555 | 40700-3AN0A | 40700-3AN0B |
| | | | | 9064 |
| | | 9069 | 40700-CK002 | |
| | | 9161 | 40700-CK001 | |
| | | Jaguar, Land Rover | 7001HP | 1055 |
| LRO 18860 | | | | |
| RQH 500460 | | | | |
| RQH 500461 | | | | |
| C2C41656 | | | | |
| C2C40476 | | | | |
| LRO 10533 | | | | |
| LRO 21936 | | | | |

| Model | REDI-Sensor # | Dill Sensor # | OE Sensor # | |
|--|---------------|---------------|------------------|---------------|
| Chrysler, Dodge, Isuzu, Jeep, Mitsubishi, VW | 7004 | 1043 | 68001698AA-AB | |
| | | | 7B0 907 253 | |
| | | | 7B0 907 253A | |
| | | | 7B0 907 253C | |
| | | | 56029359AA-AC | |
| | | | 56029527AA | |
| | | | 56053031AA-AE | |
| | | | 68078768AA | |
| | | | 9028 | 52088990AA-AD |
| | | | 425 0C 196 | |
| Ford, Lincoln, Mazda, Mercury, Volvo | 7004 | 9096 | 4L2Z-1A150-BA | |
| | | | 4L2T-1A150-BA | |
| | | | 1044 | 31302096 |
| | | | | 31302096-0 |
| | | | 8G92-1A159-AB | |
| | | | 30666931 | |
| | | | 30666931-0 | |
| | | | 30681555 | |
| | | | 30681555-0 | |
| | | | 31280297 | |
| 31280297-0 | | | | |
| 6G92-1A159-BB | | | | |
| Acura, Honda | 7002 | 1212 | 42753-SNA-A81 | |
| | | | 42753-SNA-A83 | |
| | | | 42753-SNA-A82 | |
| | | | 42753-TRO-A81 | |
| | | | 42753-TR3-A81 | |
| | | | 5511 | 42753-TP6-A82 |
| | | | 42753-TP6-A82-M1 | |
| | | | 5513 | 42753-TX6-A81 |
| | | | 1208 | 42753-SWA-315 |
| | | | 42753-SWA-316 | |
| 42753-SWA-A03 | | | | |
| 42753-SWA-A04 | | | | |
| 42753-SWA-A53 | | | | |
| 42753-SWA-A54 | | | | |
| 42753-SWA-305 | | | | |
| 42753-SWA-306 | | | | |
| 42753-S2A-305 | | | | |
| 42753-S2A-315 | | | | |
| 1058 | 06421-SCV-A00 | | | |

VEHICLE APPLICATION COVERAGE:
Part No. 7001HP, 7001HPR, 7002, 7003 & 7004

REDI-SENSOR 2014 TPMS APPLICATION GUIDE

| Model | REDI-Sensor # | Dill Sensor # | OE Sensor # | | |
|----------------------|---------------|----------------------|---------------|-------------|-------------|
| Acura, Honda (cont.) | 7002 | 1210 | 06421-SCV-A01 | | |
| | | | 06421-SCV-305 | | |
| | | | 42753-SHJ-A82 | | |
| | | | 42753-SHJ-306 | | |
| Hyundai, KIA | 7002 | 1029 | 52933-2F000 | | |
| | | | 1058 | 52933-3E000 | |
| | | | | 42933-2E000 | |
| | | | | 52933-1FA00 | |
| | | 1068 | 52933-1F000 | | |
| | | | 52933-1G000 | | |
| | | | 52933-0W100 | | |
| | | | 52933-2G200 | | |
| | | | 52933-2G000 | | |
| | | | 52933-3L100 | | |
| | | — | 52933-3X200 | | |
| | | — | 52933-3X300 | | |
| | | Lexus, Scion, Toyota | 7002 | 1203 | 42607-0C010 |
| | | | | | 42607-AD010 |
| 42607-04010 | | | | | |
| 1204 | 42607-33021 | | | | |
| | 1205 | | | 42607-30030 | |
| 42607-33011 | | | | | |
| 42607-06011 | | | | | |
| 42607-0C020 | | | | | |
| 42607-0E011 | | | | | |
| 42607-AD020 | | | | | |
| 42607-75010 | | | | | |
| 42607-34020 | | | | | |
| 42607-35010 | | | | | |
| 42607-35030 | | | | | |
| 42607-02010 | | | | | |
| 42607-06010 | | | | | |
| 42607-33010 | | | | | |
| 42607-33020 | | | | | |
| 42607-52010 | | | | | |
| 1206 | 42607-0C030 | | | | |
| 1207 | 42607-0C040 | | | | |
| | 42607-0C050 | | | | |
| | 42607-0C060 | | | | |
| | 42607-0C070 | | | | |
| | 42607-0C080 | | | | |
| | 42607-08010 | | | | |

| Model | REDI-Sensor # | Dill Sensor # | OE Sensor # | | | |
|---------------------------------|---------------|---------------|------------------|------|------|-------------|
| VW | 7003 | 1041 | 1K0 907 253E | | | |
| | | | 1K0 907 253A | | | |
| | | 1053 | 1K0 907 253D | | | |
| | | | 1K0 907 255A | | | |
| | | | 1K0 907 255C | | | |
| | | | 1K0 907 255D | | | |
| Mercedes-Benz | 7003 | 1054 | 002 540 5417 | | | |
| | | | 002 540 6617 | | | |
| | | | 002 540 6817 | | | |
| | | | 002 540 7917 | | | |
| | | | 004 542 5618 | | | |
| | | | 004 542 1518 | | | |
| | | | 002 540 9417 | | | |
| | | | 004 542 9718 | | | |
| | | | Nissan, Infiniti | 7003 | 1216 | 40700-1LA0A |
| | | | | | | 40700-1LA0B |
| 40700-1LA0C | | | | | | |
| 40700-1LA0D | | | | | | |
| 40700-1LA0E | | | | | | |
| Toyota, Lexus, Scion | 7003 | 1218 | 42607-30060 | | | |
| | | | 42607-30070 | | | |
| | | | 42607-06020 | | | |
| | | | 42607-52020 | | | |
| | | | 42607-52030 | | | |
| | | | SU003-00754 | | | |
| Buick, Cadillac, Chevrolet, GMC | 7003 | 9107 | 15114379 | | | |
| | | | 15163069 | | | |
| | | 9131 | 15102575 | | | |
| | | | 15122618 | | | |
| Volvo | 7003 | 9156 | 20927604 | | | |
| | | | 312009230 | | | |
| | | | 31200923 | | | |
| | | | 313020960 | | | |
| | | | 307483540 | | | |
| | | | 86517000 | | | |
| | | | 8651700 | | | |
| | | | 307489910 | | | |
| | | | 30748991 | | | |
| | | | Subaru | 7003 | 9081 | 28103AG00A |
| 28103AG00B | | | | | | |
| 9203 | 28103AG01A | | | | | |
| | 28103AG01B | | | | | |
| | 28103AG01C | | | | | |
| | 28103SA001 | | | | | |
| 28103SA002 | | | | | | |

7002 replaces 60 OEM part numbers, 14 Dill. 7003 replaces 45 OEM part numbers, 10 Dill.

Application guides subject to change without notice. Please refer to the manufacturer's websites for the most up-to-date application data.

SCHRADER 2014 TPMS APPLICATION GUIDE

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|-------------|------------------------|----------------|---------------------|----------------------------|
| 2014 | | | | |
| ILX | Sensor | - | | |
| | Service Pack | - | | |
| ILX Hybrid | Sensor | - | | |
| | Service Pack | - | | |
| MDX, RDX | Sensor | - | 28128 ^{††} | 71, 8 |
| RLX | Sensor | - | | |
| TSX | Sensor | - | 20098 | 35, 4 |
| 2013 | | | | |
| ILX | Sensor [†] | - | | |
| | Service Pack | - | | |
| ILX Hybrid | Sensor | - | | |
| | Service Pack | - | | |
| MDX | Sensor | - | 20098 [♦] | 35, 4 |
| RDX | Sensor | - | 28128 ^{††} | 71, 8 |
| TL | Sensor | - | 20720 | 35, 4 |
| | Service Pack | - | 20019 | 35, 4 |
| TSX | Sensor | - | 20098 | 35, 4 |
| ZDX | Sensor | - | 20720 | 35, 4 |
| | Service Pack | - | 20019 | 35, 4 |
| 2012 | | | | |
| CSX | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| MDX, RDX | Sensor | - | 20098 | 35, 4 |
| | Sensor | - | 20098 | 35, 4 |
| RL | Sensor | - | 28981 | 35, 4 |
| | Service Pack | Includes Valve | 20036 | 35, 4 |
| TL | Sensor | - | 20720 | 35, 4 |
| | Service Pack | - | 20019 | 35, 4 |
| TSX | Sensor | - | 20098 | 35, 4 |
| ZDX | Sensor | - | 20720 | 35, 4 |
| | Service Pack | - | 20019 | 35, 4 |
| 2011 | | | | |
| CSX | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|---------------------|------------------------|----------------|--------|----------------------------|
| 2011 (cont.) | | | | |
| CSX (cont.) | Sensor | - | 28720 | 35, 4 |
| | Service Pack | - | 20019 | 35, 4 |
| MDX, RDX | Sensor | - | 20098 | 35, 4 |
| | Sensor | - | 20098 | 35, 4 |
| RL | Sensor | - | 28981 | 35, 4 |
| | Service Pack | Includes Valve | 20036 | 35, 4 |
| TL | Sensor | - | 20720 | 35, 4 |
| | Service Pack | - | 20019 | 35, 4 |
| TSX | Sensor | - | 20098 | 35, 4 |
| ZDX | Sensor | - | 20720 | 35, 4 |
| | Service Pack | - | 20019 | 35, 4 |
| 2010 | | | | |
| CSX | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | Sensor | - | 28720 | 35, 4 |
| | Service Pack | - | 20019 | 35, 4 |
| MDX, RDX | Sensor | - | 20098 | 35, 4 |
| | Sensor | - | 20098 | 35, 4 |
| RL | Sensor | - | 28981 | 35, 4 |
| | Service Pack | Includes Valve | 20036 | 35, 4 |
| TL | Sensor | - | 20720 | 35, 4 |
| | Service Pack | - | 20019 | 35, 4 |
| TSX | Sensor | - | 20098 | 35, 4 |
| ZDX | Sensor | - | 20720 | 35, 4 |
| | Service Pack | - | 20019 | 35, 4 |
| 2009 | | | | |
| CSX | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | Sensor | - | 28720 | 35, 4 |
| | Service Pack | - | 20019 | 35, 4 |
| MDX, RDX | Sensor | - | 20098 | 35, 4 |
| | Sensor | - | 20098 | 35, 4 |
| RL | Sensor | - | 28981 | 35, 4 |
| | Service Pack | Includes Valve | 20036 | 35, 4 |
| TL | Sensor | - | 20720 | 35, 4 |
| | Service Pack | - | 20019 | 35, 4 |
| TSX | Sensor | - | 20098 | 35, 4 |

* Programming Tool Required † Continental Sensor †† Continental TG1C Sensor ♦ Pacific Sensor

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|----------------|------------------------|---------------------------|--------|-------------------------------|---------------------|--------------|---------------------------|---------------------------|-------------------------------|-------|
| 2008 | | | | | 2011 (cont.) | | | | | |
| CSX | EZ-Sensor | - | 33000* | 11.5, 1.3 | Q5 | Sensor | - | 20088 | 71, 8 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | - | 20017 | 71, 8 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Q7 | Sensor | Includes Transmitter Only | 20077 | 35, 4 | |
| | Sensor | - | 28720 | 35, 4 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| | Service Pack | - | 20019 | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| | MDX, RDX | Sensor | - | 20098 | | 35, 4 | Service Pack | W/48mm Green Insert | 20038 | 35, 4 |
| Sensor | | - | 20098 | 35, 4 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| RL, TL | Sensor | - | 28981 | 35, 4 | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | |
| | Service Pack | Includes Valve | 20036 | 35, 4 | R8 | Sensor | - | 20103 | 35, 4 | |
| TSX | Sensor | - | 20098 | 35, 4 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| | 2007 | | | | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| MDX, RDX | Sensor | - | 20098 | 35, 4 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| | Sensor | - | 20098 | 35, 4 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| RL, TL | Sensor | - | 28981 | 35, 4 | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | |
| | Service Pack | Includes Valve | 20036 | 35, 4 | S4, S5 | Sensor | - | 20088 | 71, 8 | |
| TSX | Sensor | - | 20098 | 35, 4 | | Service Pack | - | 20017 | 71, 8 | |
| | 2006-2005 | | | | | S6 | Sensor | Includes Transmitter Only | 20077 | 35, 4 |
| MDX, RL, TL | Sensor | - | 28981 | 35, 4 | Service Pack | | Does Not Include Valve | 20023 | 35, 4 | |
| | Service Pack | Includes Valve | 20036 | 35, 4 | Service Pack | | W/43mm Silver Insert | 20037 | 35, 4 | |
| 2004 | | | | | Service Pack | | W/48mm Green Insert | 20038 | 35, 4 | |
| MDX | Sensor | - | 28981 | 35, 4 | Service Pack | | W/49mm Black Insert | 20039 | 35, 4 | |
| | Service Pack | Includes Valve | 20036 | 35, 4 | Service Pack | | W/51mm Orange Insert | 20040 | 35, 4 | |
| 2014 | | | | | TT | Sensor | - | 20088 | 71, 8 | |
| R8 | Sensor | Includes Transmitter Only | | | | Service Pack | - | 20017 | 71, 8 | |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | 2010 | | | | |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | A3, A4, A5 | Sensor | - | 20088 | 71, 8 |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | | Service Pack | - | 20017 | 71, 8 |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | A6 | Sensor | Includes Transmitter Only | 20103 | 35, 4 |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | Service Pack | | Does Not Include Valve | 20023 | 35, 4 | |
| 2012 | | | | | Service Pack | | W/43mm Silver Insert | 20037 | 35, 4 | |
| A3, A4, A5, Q5 | Sensor | - | 20088 | 71, 8 | Service Pack | | W/48mm Green Insert | 20038 | 35, 4 | |
| | Service Pack | - | 20017 | 71, 8 | Service Pack | | W/49mm Black Insert | 20039 | 35, 4 | |
| Q7, R8 | Sensor | Includes Transmitter Only | 20103 | 35, 4 | Service Pack | | W/51mm Orange Insert | 20040 | 35, 4 | |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | A8 | Sensor | Includes Transmitter Only | 20077 | 35, 4 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| S5 | Sensor | - | 20088 | 71, 8 | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | |
| | Service Pack | - | 20017 | 71, 8 | Q5 | Sensor | - | 20088 | 71, 8 | |
| 2011 | | | | | | Service Pack | - | 20017 | 71, 8 | |
| A3, A4, A5 | Sensor | - | 20088 | 71, 8 | Q7, R8 | Sensor | Includes Transmitter Only | 20103 | 35, 4 | |
| | Service Pack | - | 20017 | 71, 8 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| A6 | Sensor | Includes Transmitter Only | 20077 | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | S4, S5 | Sensor | - | 20088 | 71, 8 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | Service Pack | - | 20017 | 71, 8 | |

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|---------------------|----------------------|---|---------------------------|-------------------------------|-----------------|----------------------|---------------------------|---------------------------|-------------------------------|-------|
| 2010 (cont.) | | | | | 2008 | | | | | |
| S6 | Sensor | Includes Transmitter Only | 20103 | 35, 4 | A3 | Sensor | - | 20088 | 71, 8 | |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | Service Pack | - | 20017 | 71, 8 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | A4 | Sensor | Includes Transmitter Only | 20078 | 35, 4 | |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| Service Pack | - | - | - | Service Pack | | W/49mm Black Insert | 20039 | 35, 4 | | |
| Service Pack | - | - | - | Service Pack | | W/51mm Orange Insert | 20040 | 35, 4 | | |
| TT | Sensor | - | 20088 | 71, 8 | A5 | Sensor | - | 20088 | 71, 8 | |
| | Service Pack | - | 20017 | 71, 8 | | Service Pack | - | 20017 | 71, 8 | |
| 2009 | | | | | 2007 | | | | | |
| A3, A4, A5 | Sensor | - | 20088 | 71, 8 | A4, A6 | Sensor | Includes Transmitter Only | 20078 | 35, 4 | |
| | Service Pack | - | 20017 | 71, 8 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| A6 | Sensor | Includes Transmitter Only; Exc. Quattro | 20078 | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| | Sensor | Includes Transmitter Only; Quattro | 20103 | 35, 4 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | A8 | Sensor | Includes Transmitter Only | 20077 | 35, 4 | |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | Service Pack | | W/43mm Silver Insert | 20037 | 35, 4 | | |
| A8 | Sensor | Includes Transmitter Only | 20077 | 35, 4 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | Q7, R8, RS4, S4 | Sensor | Includes Transmitter Only | 20078 | 35, 4 | |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| Q5 | Sensor | - | 20088 | 71, 8 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| | Service Pack | - | 20017 | 71, 8 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| | Q7, R8, S4 | Sensor | Includes Transmitter Only | 20078 | | 35, 4 | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 |
| | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | S5 | Sensor | - | 20088 | 71, 8 |
| | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | Service Pack | - | 20017 | 71, 8 |
| | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | S6 | Sensor | Includes Transmitter Only | 20078 | 35, 4 |
| Service Pack | | W/49mm Black Insert | 20039 | 35, 4 | Service Pack | | Does Not Include Valve | 20023 | 35, 4 | |
| Service Pack | | W/51mm Orange Insert | 20040 | 35, 4 | Service Pack | | W/43mm Silver Insert | 20037 | 35, 4 | |
| S5 | Sensor | - | 20088 | 71, 8 | Service Pack | | W/48mm Green Insert | 20038 | 35, 4 | |
| | Service Pack | - | 20017 | 71, 8 | Service Pack | | W/49mm Black Insert | 20039 | 35, 4 | |
| S6 | Sensor | Includes Transmitter Only | 20078 | 35, 4 | Service Pack | | W/51mm Orange Insert | 20040 | 35, 4 | |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | S8 | Sensor | Includes Transmitter Only | 20077 | 35, 4 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| Service Pack | - | - | - | Service Pack | | W/51mm Orange Insert | 20040 | 35, 4 | | |
| S8 | Sensor | Includes Transmitter Only | 20077 | 35, 4 | TT | Sensor | - | 20088 | 71, 8 | |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | Service Pack | - | 20017 | 71, 8 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | 2007 | | | | | |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | A4, A6 | Sensor | Includes Transmitter Only | 20078 | 35, 4 | |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| TT | Sensor | - | 20088 | 71, 8 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| | Service Pack | - | 20017 | 71, 8 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| | | | | | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | |

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|---------------------|----------------------|---------------------------|--------|-------------------------------|---------------------|----------------------|---------------------------|---------------------------|-------------------------------|
| 2007 (cont.) | | | | | 2005 (cont.) | | | | |
| A8 | Sensor | Includes Transmitter Only | 20077 | 35, 4 | Allroad Quattro | Sensor | Includes Transmitter Only | 20079 | 35, 4 |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 |
| Q7 RS4, S4, S6 | Sensor | Includes Transmitter Only | 20078 | 35, 4 | | S4 | Sensor | Includes Transmitter Only | 20078 |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | Service Pack | | Does Not Include Valve | 20023 | 35, 4 |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | Service Pack | | W/43mm Silver Insert | 20037 | 35, 4 |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | Service Pack | | W/48mm Green Insert | 20038 | 35, 4 |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | Service Pack | | W/49mm Black Insert | 20039 | 35, 4 |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | Service Pack | | W/51mm Orange Insert | 20040 | 35, 4 |
| S8 | Sensor | Includes Transmitter Only | 20077 | 35, 4 | 2004 | | | | |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | A4 | Sensor | Includes Transmitter Only | 20078 | 35, 4 |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 |
| Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | Service Pack | | W/51mm Orange Insert | 20040 | 35, 4 | |
| 2006 | | | | | A8 | Sensor | Includes Transmitter Only | 20077 | 35, 4 |
| A4, A6 | Sensor | Includes Transmitter Only | 20078 | 35, 4 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | |
| A8 | Sensor | Includes Transmitter Only | 20077 | 35, 4 | Allroad Quattro | Sensor | Includes Transmitter Only | 20079 | 35, 4 |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 |
| S4 | Sensor | Includes Transmitter Only | 20078 | 35, 4 | S4 | Sensor | Includes Transmitter Only | 20078 | 35, 4 |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 |
| 2005 | | | | | 2003 | | | | |
| A4, A6 | Sensor | Includes Transmitter Only | 20078 | 35, 4 | A4 | Sensor | Includes Transmitter Only | 20078 | 35, 4 |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 |
| A8 | Sensor | Includes Transmitter Only | 20077 | 35, 4 | | | | | |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | | | | |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | | | | |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | | | | |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | | | | |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | | | | |

Audi (cont.)

Audi (cont.)

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|-------------------------|------------------------------|---|---------------------------|-------------------------------|------------------------------|------------------------------|---------------------------|---------------------------|-------------------------------|-------|
| 2003 (cont.) | | | | | 2013 | | | | | |
| A8 | Sensor | Includes Transmitter Only; Chassis No. 4E3000001 & After | 20077 | 35, 4 | Azure, Continental, Mulsanne | Sensor | Includes Transmitter Only | 20103 | 35, 4 | |
| | Sensor | Includes Transmitter Only; Chassis No. 4D3004999 & Before | 20079 | 35, 4 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | 2012 | | | | | |
| | Allroad Quattro | Sensor | Includes Transmitter Only | 20079 | 35, 4 | Azure, Continental, Mulsanne | Sensor | Includes Transmitter Only | 20103 | 35, 4 |
| Service Pack | | Does Not Include Valve | 20023 | 35, 4 | Service Pack | | Does Not Include Valve | 20023 | 35, 4 | |
| Service Pack | | W/43mm Silver Insert | 20037 | 35, 4 | Service Pack | | W/43mm Silver Insert | 20037 | 35, 4 | |
| Service Pack | | W/48mm Green Insert | 20038 | 35, 4 | Service Pack | | W/48mm Green Insert | 20038 | 35, 4 | |
| Service Pack | | W/49mm Black Insert | 20039 | 35, 4 | Service Pack | | W/49mm Black Insert | 20039 | 35, 4 | |
| Service Pack | | W/51mm Orange Insert | 20040 | 35, 4 | Service Pack | | W/51mm Orange Insert | 20040 | 35, 4 | |
| S8 | Sensor | Includes Transmitter Only; Chassis No. 4E3000001 & After | 20077 | 35, 4 | 2011 | | | | | |
| | Sensor | Includes Transmitter Only; Chassis No. 4D3004999 & Before | 20079 | 35, 4 | Mulsanne | Sensor | Includes Transmitter Only | 20103 | 35, 4 | |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | |
| | 2002 | | | | | 2010 | | | | |
| A4 | Sensor | Includes Transmitter Only | 20078 | 35, 4 | Continental | Sensor | Includes Transmitter Only | 20078 | 35, 4 | |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | |
| A8, Allroad Quattro, S8 | Sensor | Includes Transmitter Only | 20079 | 35, 4 | 2009 | | | | | |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | Azure | Sensor | Includes Transmitter Only | 20103 | 35, 4 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | Service Pack | | W/51mm Orange Insert | 20040 | 35, 4 | | |
| 2001 | | | | | 2008 | | | | | |
| A8, Allroad Quattro, S8 | Sensor | Includes Transmitter Only | 20079 | 35, 4 | Continental | Sensor | Includes Transmitter Only | 20078 | 35, 4 | |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | |
| 2014 | | | | | 2008 | | | | | |
| Bentley | Azure, Continental, Mulsanne | Sensor | Includes Transmitter Only | 20103 | 35, 4 | Azure | Service Pack | Does Not Include Valve | 20023 | 35, 4 |
| | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 |
| | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 |
| | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 |
| | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 |
| | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | | | | |

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|--|----------------------|---------------------------|---------|-------------------------------|--|----------------------|---------------------------|---------|-------------------------------|
| 2011 (cont.) | | | | | 2010 (Cont.) | | | | |
| Alpina B7 | Sensor | Includes Transmitter Only | 20080 | 31, 3.5 | M5, M6 | Sensor | Includes Transmitter Only | 20083 | 31, 3.5 |
| | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 |
| | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 |
| | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 |
| | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 |
| | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 |
| M3 | Sensor | Includes Transmitter Only | 28081 | 31, 3.5 | X3, X5, X6 | Sensor | Includes Transmitter Only | 20083 | 35, 4 |
| | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 |
| | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 |
| | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 |
| | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 |
| | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 |
| X3, X5, X6 | Sensor | Includes Transmitter Only | 20083 | 35, 4 | Z4 | Sensor | Includes Transmitter Only | 20083 | 31, 3.5 |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 |
| Z4 | Sensor | Includes Transmitter Only | 20083 | 31, 3.5 | 2009 | | | | |
| | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | 128I, 135I, 323I, 328I, 335D, 335I, 528I, 528XI, 535I, 550I, 650I, 750I, 750LI, M3, M5, M6 | Sensor | Includes Transmitter Only | 20083 | 31, 3.5 |
| | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 |
| | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 |
| | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 |
| | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 |
| Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | Service Pack | | W/51mm Orange Insert | 20040 | 31, 3.5 | |
| 2010 | | | | | X3, X5, X6 | Sensor | Includes Transmitter Only | 20083 | 35, 4 |
| 128I, 135I, 323I | Sensor | Includes Transmitter Only | 20083 | 31, 3.5 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 |
| | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 |
| | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 |
| | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 |
| | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 |
| | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | |
| 328I, 335D, 335I, 335XI | Sensor | Includes Transmitter Only | 28081 | 31, 3.5 | Z4 | Sensor | Includes Transmitter Only | 20083 | 31, 3.5 |
| | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 |
| | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 |
| | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 |
| | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 |
| | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 |
| 528I, 535I, 535XI, 550I, 650I, 750I, 750LI, 760LI | Sensor | Includes Transmitter Only | 20083 | 31, 3.5 | 2008 | | | | |
| | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | 128I, 135I, 323I, 328I, 328XI, 335I, 335XI, 528I, 528XI, 535I, 535XI, 550I, 650I, 750I, 750LI, 760LI, Alpina B7, M3, M5, M6 | Sensor | Includes Transmitter Only | 20083 | 31, 3.5 |
| | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 |
| | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 |
| | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 |
| | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 |
| Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | Service Pack | | W/51mm Orange Insert | 20040 | 31, 3.5 | |
| M3 | Sensor | Includes Transmitter Only | 28081 | 31, 3.5 | 2008 | | | | |
| | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | 128I, 135I, 323I, 328I, 328XI, 335I, 335XI, 528I, 528XI, 535I, 535XI, 550I, 650I, 750I, 750LI, 760LI, Alpina B7, M3, M5, M6 | Sensor | Includes Transmitter Only | 20083 | 31, 3.5 |
| | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 |
| | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 |
| | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 |
| | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 |
| Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | Service Pack | | W/51mm Orange Insert | 20040 | 31, 3.5 | |

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | | | | | |
|--|------------------------|---|---------------------------|-------------------------------|---|--|---------------------------|---------------------------|-------------------------------|---------|--------------|------------------------------------|---------------------|---------|---------|
| 2008 (cont.) | | | | | 2006 (cont.) | | | | | | | | | | |
| X3, X5, X6 | Sensor | Includes Transmitter Only | 20083 | 35, 4 | 325CI, 325I, 325XI, 330CI, 330I, 330XI (cont.) | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | | | | | | |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | | | | | | |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | | | | | | |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | 525I, 525XI, 530I, 530XI, 550I, 650I, 750I, 750LI, 760I, 760LI, M3, M5, M6 | Sensor | Includes Transmitter Only | 20083 | 31, 3.5 | | | | | |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | | | | | |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | | | | | |
| Z4 | Sensor | Includes Transmitter Only | 20083 | 31, 3.5 | Service Pack | | W/48mm Green Insert | 20038 | 31, 3.5 | | | | | | |
| | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | Service Pack | | W/49mm Black Insert | 20039 | 31, 3.5 | | | | | | |
| | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | Service Pack | | W/51mm Orange Insert | 20040 | 31, 3.5 | | | | | | |
| | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | X3, X5 | Sensor | Includes Transmitter Only | 20083 | 35, 4 | | | | | | |
| | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | | | | | |
| | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | | | | | |
| 2007 | | | | | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | | | | | |
| 323I, 328I, 328XI, 335I, 335XI, 525I, 525XI, 530I, 530XI, 550I, 650I, 750I, 750LI, 760LI, Alpina B7, M5, M6 | Sensor | Includes Transmitter Only | 20083 | 31, 3.5 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | | | | | |
| | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | | | | | |
| | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | Z4 | Sensor | Includes Transmitter Only | 20083 | 31, 3.5 | | | | | | |
| | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | | | | | | |
| | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | | | | | | |
| | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | | | | | | |
| X3, X5 | Sensor | Includes Transmitter Only | 20083 | 35, 4 | | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | | | | | | |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | | | | | | |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | 2005 | | | | | | | | | | |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | 320I, 325CI, 325I, 325XI, 330CI, 330I, 330XI, 525I, 530I, 545I, 645CI, 745I, 745LI, 760I | Sensor | Includes Transmitter Only | 20080 | 31, 3.5 | | | | | | |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | | | | | | |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | | | | | | |
| Z4 | Sensor | Includes Transmitter Only | 20083 | 31, 3.5 | | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | | | | | | |
| | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | | | | | | |
| | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | | | | | | |
| | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | 760LI, M3 | Sensor | Includes Transmitter Only | 20083 | 31, 3.5 | | | | | | |
| | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | | | | | | |
| | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | | | | | | |
| 2006 | | | | | | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | | | | | | |
| 323I | Sensor | Includes Transmitter Only; Jun. & Newer | 20083 | 31, 3.5 | | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | | | | | | |
| | Service Pack | Does Not Include Valve; Jun. & Newer | 20023 | 31, 3.5 | | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | | | | | | |
| | Service Pack | W/43mm Silver Insert; Jun. & Newer | 20037 | 31, 3.5 | X5 | Sensor | Includes Transmitter Only | 20083 | 35, 4 | | | | | | |
| | Service Pack | W/48mm Green Insert; Jun. & Newer | 20038 | 31, 3.5 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | | | | | |
| | Service Pack | W/49mm Black Insert; Jun. & Newer | 20039 | 31, 3.5 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | | | | | |
| | Service Pack | W/51mm Orange Insert; Jun. & Newer | 20040 | 31, 3.5 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | | | | | |
| 325CI, 325I, 325XI, 330CI, 330I, 330XI | Sensor | Includes Transmitter Only | 20080 | 31, 3.5 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | | | | | |
| | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | | | | | |
| | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | Z4 | Sensor | Includes Transmitter Only | 20083 | 31, 3.5 | | | | | | |
| 2006 (cont.) | | | | | | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | | | | | | |
| BMW (cont.) | X3, X5 | Sensor | Includes Transmitter Only | 20083 | | 35, 4 | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | | | | | |
| | | | | | | | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | | | | | |
| | | | | | | | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | | | | | |
| | | | | | | | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | | | | | |
| | | | | | BMW (cont.) | | Z4 | Sensor | Includes Transmitter Only | 20083 | 31, 3.5 | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 |
| | | | | | | | | | | | | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 |
| Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | | | | | | | | | | | | |
| Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | | | | | | | | | | | | |
| Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | | | | | | | | | | | | |
| Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | | | | | | | | | | | | |
| Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | | | | | | | | | | | | |
| Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | | | | | | | | | | | | |
| 2006 | | | | | BMW (cont.) | X5 | Sensor | Includes Transmitter Only | 20083 | 35, 4 | | | | | |
| 323I | Service Pack | Does Not Include Valve; Jun. & Newer | 20023 | 31, 3.5 | | | | | | | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | |
| | | | | | | | | | | | Service Pack | W/43mm Silver Insert; Jun. & Newer | 20037 | 31, 3.5 | |
| | | | | | | | | | | | Service Pack | W/48mm Green Insert; Jun. & Newer | 20038 | 31, 3.5 | |
| | | | | | | | | | | | Service Pack | W/49mm Black Insert; Jun. & Newer | 20039 | 31, 3.5 | |
| | | | | | | | | | | | Service Pack | W/51mm Orange Insert; Jun. & Newer | 20040 | 31, 3.5 | |
| | | | | | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | | | | | | | |
| 325CI, 325I, 325XI, 330CI, 330I, 330XI | Sensor | Includes Transmitter Only | 20080 | 31, 3.5 | 31, 3.5 | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | | | | | | |
| | | | | | | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | | | | | | |
| | | | | | | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | | | | | | |
| | | | | | | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | | | | | | |
| | | | | | | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | | | | | | |
| | | | | | | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | | | | | | |

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|---|----------------------|---|--------|-------------------------------|---|----------------------|---|------------------------|-------------------------------|
| 2004 | | | | | 2003 (cont.) | | | | |
| 320I, 325CI, 325I, 325XI, 330CI, 330I, 330XI, 525I, 530I, 545I, 645CI, 745I, 745LI, 760I | Sensor | Includes Transmitter Only | 20080 | 31, 3.5 | Z4 | Sensor | Includes Transmitter Only | 20083 | 31, 3.5 |
| | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 |
| | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 |
| | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 |
| | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 |
| | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 |
| 760LI, M3 | Sensor | Includes Transmitter Only | 20083 | 31, 3.5 | Z8 | Sensor | Includes Transmitter Only; W/433 MHz Sensor | 20080 | 31, 3.5 |
| | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 |
| | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 |
| | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 |
| | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 |
| | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 |
| X5 | Sensor | Includes Transmitter Only | 28082 | 35, 4 | 2002 | | | | |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | 320I, 325CI, 325I, 325XI, 330CI, 330I, 330XI, 525I, 530I, 540I, 745I, 745LI, M3, M5 | Sensor | Includes Transmitter Only; W/433 MHz Sensor | 20080 | 31, 3.5 |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 |
| Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | Service Pack | | W/51mm Orange Insert | 20040 | 31, 3.5 | |
| Z4 | Sensor | Includes Transmitter Only | 20083 | 31, 3.5 | X5 | Sensor | Includes Transmitter Only | 28082 | 35, 4 |
| | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 |
| | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 |
| | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 |
| | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 |
| | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 |
| 2003 | | | | | Z3 | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 |
| 320I, 325CI, 325I, 325XI, 330CI, 330I, 330XI, 525I, 530I, 540I, 745I, 745LI, 760LI, M3 | Sensor | Includes Transmitter Only | 20080 | 31, 3.5 | | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 |
| | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 |
| | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 |
| | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 |
| | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | | Z8 | Service Pack | Does Not Include Valve | 20023 |
| | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | Service Pack | | W/43mm Silver Insert | 20037 | 31, 3.5 |
| M5 | Sensor | Includes Transmitter Only; W/433 MHz Sensor | 20080 | 31, 3.5 | Service Pack | | W/48mm Green Insert | 20038 | 31, 3.5 |
| | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | Service Pack | | W/49mm Black Insert | 20039 | 31, 3.5 |
| | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | Service Pack | | W/51mm Orange Insert | 20040 | 31, 3.5 |
| | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | 2001 | | | | |
| | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | 320I, 325CI, 325I, 325XI, 330CI, 330I, 330XI, 525I, 530I, 540I, 740I, 740LI, 750LI, M3 | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 |
| | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 |
| X5 | Sensor | Includes Transmitter Only | 28082 | 35, 4 | | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | | | | |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | | | | |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | | | | |

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|---------------------|--|---|------------------------|-------------------------------|--|--|------------------------|------------------------|-------------------------------|-----------|
| 2001 (cont.) | | | | | 1999-1997 | | | | | |
| M5 | Sensor | Includes Transmitter Only; W/433 MHz Sensor | 20080 | 31, 3.5 | BMW (cont.) | 528i, 540i, 740i, 740iL, 750iL | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 |
| | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | |
| | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | |
| | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | 2006 | | | | | |
| X5 | Sensor | Includes Transmitter Only | 28082 | 35, 4 | Veyron | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | 2014 | | | | | |
| Z3 | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | Enclave | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | | Sensor | - | 20153 | 11.5, 1.3 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | | Service Pack | - | 20008 | 11.5, 1.3 | |
| | Z8 | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | Encore, LaCrosse, Regal, Verano | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| Service Pack | | W/43mm Silver Insert | 20037 | 31, 3.5 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | |
| Service Pack | | W/48mm Green Insert | 20038 | 31, 3.5 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| Service Pack | | W/49mm Black Insert | 20039 | 31, 3.5 | Sensor | | - | 28206 | 11.5, 1.3 | |
| Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | Service Pack | - | 20008 | 11.5, 1.3 | | | |
| 2000 | | | | | 2013 | | | | | |
| BMW (cont.) | 323Ci, 323i, 328Ci, 328i, 528i, 540i, 740i, 740iL, 750iL | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | Enclave | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | Sensor | | - | 20153 | 11.5, 1.3 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | Service Pack | | - | 20008 | 11.5, 1.3 | |
| M5 | Sensor | Includes Transmitter Only; W/433 MHz Sensor | 20080 | 31, 3.5 | Encore, LaCrosse, Regal, Verano | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | | Sensor | - | 28206 | 11.5, 1.3 | |
| | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | | Service Pack | - | 20008 | 11.5, 1.3 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | 2012 | | | | | |
| X5 | Sensor | Includes Transmitter Only | 28082 | 35, 4 | Enclave | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | Sensor | - | 20153 | 11.5, 1.3 | |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Service Pack | - | 20008 | 11.5, 1.3 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | LaCrosse, Regal, Verano | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| Z3, Z8 | Service Pack | Does Not Include Valve | 20023 | 31, 3.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 31, 3.5 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | W/48mm Green Insert | 20038 | 31, 3.5 | | Sensor | - | 28206 | 11.5, 1.3 | |
| | Service Pack | W/49mm Black Insert | 20039 | 31, 3.5 | Service Pack | - | 20008 | 11.5, 1.3 | | |
| | Service Pack | W/51mm Orange Insert | 20040 | 31, 3.5 | | | | | | |

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|-------------|------------------------|--------------|--------|-------------------------------|---|------------------------|------------------------|--------------------|-------------------------------|-----------|
| 2011 | | | | | 2009 | | | | | |
| Enclave | EZ-Sensor | - | 33000* | 11.5, 1.3 | Allure, Enclave, Lacrosse, Lucerne | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 20153 | 11.5, 1.3 | | Sensor | - | 20153 | 11.5, 1.3 | |
| | Service Pack | - | 20008 | 11.5, 1.3 | | Service Pack | - | 20008 | 11.5, 1.3 | |
| LaCrosse | EZ-Sensor | - | 33000* | 11.5, 1.3 | 2008 | | | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Allure, Enclave, Lacrosse | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Sensor | - | 28206 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | Service Pack | - | 20008 | 11.5, 1.3 | | Sensor | - | 20158 | 62, 7 | |
| | | | | Service Pack | | W/Schrader Sensor | 20004 | 62, 7 | | |
| Lucerne | EZ-Sensor | - | 33000* | 11.5, 1.3 | Service Pack | W/Siemens Sensor | 20030 | 80, 9 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Lucerne | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Sensor | - | 20153 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | Service Pack | - | 20008 | 11.5, 1.3 | | Sensor | - | 20153 | 11.5, 1.3 | |
| | | | | Service Pack | | - | 20008 | 11.5, 1.3 | | |
| Regal | EZ-Sensor | - | 33000* | 11.5, 1.3 | 2007 | | | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Allure, Lacrosse | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Sensor | - | 28206 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | Service Pack | - | 20008 | 11.5, 1.3 | | Sensor | - | 20158 | 62, 7 | |
| | | | | Service Pack | | W/Schrader Sensor | 20004 | 62, 7 | | |
| 2010 | | | | | Service Pack | W/Siemens Sensor | 20030 | 80, 9 | | |
| Allure | EZ-Sensor | - | 33000* | 11.5, 1.3 | LeSabre, Lucerne | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 28206 | 11.5, 1.3 | | Sensor | - | 20153 | 11.5, 1.3 | |
| | Service Pack | - | 20008 | 11.5, 1.3 | | Service Pack | - | 20008 | 11.5, 1.3 | |
| Enclave | EZ-Sensor | - | 33000* | 11.5, 1.3 | Raimier | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 20153 | 11.5, 1.3 | | Sensor | - | 20153 | 11.5, 1.3 | |
| | Service Pack | - | 20008 | 11.5, 1.3 | | Service Pack | - | 20008 | 11.5, 1.3 | |
| Lacrosse | EZ-Sensor | - | 33000* | 11.5, 1.3 | ATS | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 28206 | 11.5, 1.3 | | Sensor | - | 28206 ¹ | 11.5, 1.3 | |
| | Service Pack | - | 20008 | 11.5, 1.3 | | Service Pack | - | 20008 | 11.5, 1.3 | |
| Lucerne | EZ-Sensor | - | 33000* | 11.5, 1.3 | ATS-V | Sensor | - | 28423 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | - | 20004 | 62, 7 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | 2014 | | | | |
| | Sensor | - | 20153 | 11.5, 1.3 | | Cadillac | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Service Pack | - | 20008 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | | | EZ-Sensor Service Pack | Almm. Valve | | 34000 | 62, 7 | | |
| | | | | Sensor | - | | 28206 ¹ | 11.5, 1.3 | | |
| | | | | Service Pack | - | | 20008 | 11.5, 1.3 | | |

* Programming Tool Required ¹ Schrader OE Sensor

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|--------------------------------|------------------------|--|---------------------|-------------------------------|---------------------|--|--|--|-------------------------------|-----------|
| 2014 (cont.) | | | | | 2013 (cont.) | | | | | |
| CTS | EZ-Sensor | - | 33000* | 11.5, 1.3 | Escalade | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 28206 | 11.5, 1.3 | | Sensor | - | 20153 | 11.5, 1.3 | |
| | Service Pack | - | 20008 | 11.5, 1.3 | | Service Pack | - | 20008 | 11.5, 1.3 | |
| CTS - V | EZ-Sensor | When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000 | 33000* | 11.5, 1.3 | SRX, XTS | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 28423 [†] | 62, 7 | | Sensor | - | 28206 | 11.5, 1.3 | |
| | Service Pack | - | 20004 | 62, 7 | | Service Pack | - | 20008 | 11.5, 1.3 | |
| ELR, Escalade, SRX, XTS | EZ-Sensor | - | 33000* | 11.5, 1.3 | 2012 | | | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | CTS | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Sensor | - | 28206 [†] | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | - | 20008 | 11.5, 1.3 | | Sensor | OEM Part No. 25920615; Exc. CTS V | 20153 | 11.5, 1.3 | |
| | | | | Service Pack | | OEM Part No. 15268606; CTS V; W/315 MHz Sensor | 20004 | 62, 7 | | |
| 2013 | | | | | CTS | Service Pack | OEM Part No. 25920615; Exc. CTS V | 20008 | 11.5, 1.3 | |
| ATS | EZ-Sensor | - | 33000* | 11.5, 1.3 | | CTS - V | EZ-Sensor | When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000 | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 28206 ^{††} | 11.5, 1.3 | | | Sensor | OEM Part No. 15268606; CTS V; W/315 MHz Sensor | 20158 | 62, 7 |
| | Service Pack | - | 20008 | 11.5, 1.3 | Service Pack | | OEM Part No. 15268606; CTS V; W/315 MHz Sensor | 20004 | 62, 7 | |
| CTS | EZ-Sensor | - | 33000* | 11.5, 1.3 | Escalade | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | OEM Part No. 25920615; Exc. CTS V | 20153 | 11.5, 1.3 | | Sensor | - | 20153 | 11.5, 1.3 | |
| | Service Pack | OEM Part No. 15268606; CTS V; W/315 MHz Sensor | 20004 | 62, 7 | | Service Pack | - | 20008 | 11.5, 1.3 | |
| CTS - V | EZ-Sensor | When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000 | 33000* | 11.5, 1.3 | SRX | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | OEM Part No. 15268606; CTS V; W/315 MHz Sensor | 20158 | 62, 7 | | Sensor | - | 28206 | 11.5, 1.3 | |
| | Service Pack | OEM Part No. 15268606; CTS V; W/315 MHz Sensor | 20004 | 62, 7 | | Service Pack | - | 20008 | 11.5, 1.3 | |

* Programming Tool Required † Schrader OE Sensor (ELR only) †† Continental OE Sensor

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|------------------|---------------------------|--|-----------|-------------------------------|---------------------------|--------------------------------------|--|-----------|-------------------------------|
| 2011-2010 | | | | | 2009 (cont.) | | | | |
| CTS | EZ-Sensor | - | 33000* | 11.5, 1.3 | CTS - V | Sensor | OEM Part No. 15268606; CTS V; W/315 MHz Sensor | 20158 | 62, 7 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | OEM Part No. 15268606; CTS V; W/315 MHz Sensor | 20004 | 62, 7 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | DTS, Escalade, SRX | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Sensor | OEM Part No. 25920615; Exc. CTS V | 20153 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Service Pack | OEM Part No. 15268606; CTS V; W/315 MHz Sensor | 20004 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | Service Pack | OEM Part No. 25920615; Exc. CTS V | 20008 | 11.5, 1.3 | | Sensor | - | 20153 | 11.5, 1.3 |
| CTS - V | Sensor | OEM Part No. 15268606; CTS V; W/315 MHz Sensor | 20158 | 62, 7 | | Service Pack | - | 20008 | 11.5, 1.3 |
| | Service Pack | OEM Part No. 15268606; CTS V; W/315 MHz Sensor | 20004 | 62, 7 | STS | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| DTS | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | Sensor | OEM Part No. 25920615; Exc. STS V | 20153 | 11.5, 1.3 |
| | Sensor | - | 20153 | 11.5, 1.3 | Service Pack | OEM Part No. 25920615; Exc. STS V | 20008 | 11.5, 1.3 | |
| | Service Pack | - | 20008 | 11.5, 1.3 | STS - V | Sensor | OEM Part No. 25920615; Exc. STS V | 20158 | 11.5, 1.3 |
| Escalade | EZ-Sensor | - | 33000* | 11.5, 1.3 | | XLR | EZ-Sensor | - | 33000* |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 |
| | Sensor | - | 20153 | 11.5, 1.3 | Sensor | | OEM Part No. 25758220 | 20076 | 62, 7 |
| | Sensor | - | 33000* | 11.5, 1.3 | Service Pack | | - | 20004 | 62, 7 |
| Service Pack | - | 20008 | 11.5, 1.3 | 2008 | | | | | |
| SRX | EZ-Sensor | - | 33000* | 11.5, 1.3 | CTS | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | Sensor | - | 28206 | 11.5, 1.3 | | Sensor | - | 20153 | 11.5, 1.3 |
| | Service Pack | - | 20008 | 11.5, 1.3 | | Service Pack | - | 20008 | 11.5, 1.3 |
| STS | EZ-Sensor | - | 33000* | 11.5, 1.3 | | DTS | EZ-Sensor | - | 33000* |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 |
| | Sensor | - | 20153 | 11.5, 1.3 | Sensor | | - | 20153 | 11.5, 1.3 |
| | Service Pack | - | 20008 | 11.5, 1.3 | Sensor | | - | 20153 | 11.5, 1.3 |
| 2009 | EZ-Sensor | - | 33000* | 11.5, 1.3 | Service Pack | | - | 20008 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Escalade | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Sensor | OEM Part No. 25920615; Exc. CTS V | 20153 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | Service Pack | OEM Part No. 15268606; CTS V; W/315 MHz Sensor | 20004 | 62, 7 | | Sensor | Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem | 20153 | 11.5, 1.3 |
| | Service Pack | OEM Part No. 25920615; Exc. CTS V | 20008 | 11.5, 1.3 | | Sensor | - | 20153 | 11.5, 1.3 |
| | | | | | | Service Pack | - | 20008 | 11.5, 1.3 |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|---------------------|------------------------|---|-----------------------|-------------------------------|--------------|------------------------|------------------------|-----------------------|-------------------------------|-----------|
| 2008 (cont.) | | | | | 2006 | | | | | |
| SRX | EZ-Sensor | - | 33000* | 11.5, 1.3 | CTS | Sensor | OEM Part No. 25774006 | 20116 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | - | 20004 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | DTS | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Sensor | - | 20153 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | - | 20008 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 20153 | 11.5, 1.3 | | Sensor | - | 20158 | 62, 7 | |
| | STS, XLR | EZ-Sensor | - | 33000* | 11.5, 1.3 | Service Pack | - | 20004 | 62, 7 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Escalade | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | Sensor | OEM Part No. 25758220 | 20076 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| Service Pack | | - | 20004 | 62, 7 | Sensor | | - | 20107 | 62, 7 | |
| 2007 | | | | | Service Pack | | - | 20004 | 62, 7 | |
| CTS | Sensor | OEM Part No. 25774006 | 20116 | 62, 7 | SRX | | Sensor | OEM Part No. 25774006 | 20116 | 62, 7 |
| | Service Pack | - | 20004 | 62, 7 | | Service Pack | - | 20004 | 62, 7 | |
| DTS | EZ-Sensor | - | 33000* | 11.5, 1.3 | STS, XLR | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 20153 | 11.5, 1.3 | | Sensor | OEM Part No. 25758220 | 20076 | 62, 7 | |
| | Sensor | - | 20153 | 11.5, 1.3 | Service Pack | - | 20004 | 62, 7 | | |
| | Service Pack | - | 20008 | 11.5, 1.3 | 2005 | | | | | |
| Escalade | EZ-Sensor | - | 33000* | 11.5, 1.3 | CTS | Sensor | - | 20116 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | - | 20004 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Deville | Sensor | - | 20117** | 62, 7 | |
| | Sensor | Snap-In Style Only; Schrader Sensor; W/ Rubber Valve Stem | 20153 | 11.5, 1.3 | | Service Pack | - | 20003 | 62, 7 | |
| | Sensor | Clamp-In Style Only; TRW Sensor; W/Almnm. Valve Stem | 20158 | 62, 7 | Escalade | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Service Pack | Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem | 20008 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | Clamp-In Style Only; TRW Sensor; W/Almnm. Valve Stem | 20015 | 80, 9 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 20153 | 11.5, 1.3 | | Sensor | - | 20107 | 62, 7 | |
| SRX | EZ-Sensor | - | 33000* | 11.5, 1.3 | Service Pack | - | 20004 | 62, 7 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | SRX | Sensor | - | 20116 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20004 | 62, 7 | |
| | Sensor | - | 20153 | 11.5, 1.3 | STS, XLR | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Service Pack | - | 20008 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| Sensor | OEM Part No. 25758220 | 20076 | 62, 7 | Sensor | | OEM Part No. 25758220 | 20076 | 62, 7 | | |
| Service Pack | - | 20004 | 62, 7 | Service Pack | - | 20004 | 62, 7 | | | |
| STS, XLR | EZ-Sensor | - | 33000* | 11.5, 1.3 | 2004 | | | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | CTS | Sensor | - | 20116 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20004 | 62, 7 | |
| | Sensor | OEM Part No. 25758220 | 20076 | 62, 7 | Deville | Sensor | - | 20117** | 62, 7 | |
| | Service Pack | - | 20004 | 62, 7 | | Service Pack | - | 20003 | 62, 7 | |

* Programming Tool Required ** Magnet Required to Activate Sensor

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | |
|------------------------|--------------|------------------------|--------------|-------------------------------|----------------------------|-------------------------------|------------------------|------------------------|-------------------------------|-----------|-----------|
| 2004 (cont.) | | | | | 2014 (cont.) | | | | | | |
| Cadillac (cont.) | Escalade | EZ-Sensor | - | 33000* | 11.5, 1.3 | Impala, Malibu | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | | Sensor | - | 20115 | 62, 7 | | Sensor | - | 28206 | 11.5, 1.3 | |
| | | Service Pack | - | 20004 | 62, 7 | | Service Pack | - | 20008 | 11.5, 1.3 | |
| | | Service Pack | - | 20117** | 62, 7 | | Service Pack | - | 33000* | 11.5, 1.3 | |
| | Seville | Sensor | - | 20117** | 62, 7 | Silverado Series Pickup | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | | Service Pack | - | 20003 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | SRX | Sensor | - | 20116 | 62, 7 | | Sensor | W/Single Rear Wheels | 28206 | 11.5, 1.3 | |
| | | Service Pack | - | 20004 | 62, 7 | | Service Pack | W/Single Rear Wheels | 20008 | 11.5, 1.3 | |
| | XLR | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sonic, Spark | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | EZ-Sensor Service Pack | Almm. Valve | | 34000 | 62, 7 | | |
| Sensor | | OEM Part No. 25758220 | 20076 | 62, 7 | Sensor | - | | 28206 | 11.5, 1.3 | | |
| Service Pack | | - | 20004 | 62, 7 | Service Pack | - | | 20008 | 11.5, 1.3 | | |
| 2003-2001 | | | | | 2014 | | | | | | |
| Deville, Seville | Sensor | - | 20117** | 62, 7 | Camaro | EZ-Sensor | Exc. ZL1 | 33000* | 11.5, 1.3 | | |
| | Service Pack | - | 20003 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve; Exc. ZL1 | 20018 | 11.5, 1.3 | | |
| | | | | | | EZ-Sensor Service Pack | Almm. Valve; Exc. ZL1 | 34000 | 62, 7 | | |
| | | | | | | Sensor | Exc. ZL1 | 28206 | 11.5, 1.3 | | |
| | | | | | | Service Pack | Exc. ZL1 | 20008 | 11.5, 1.3 | | |
| | | | | | Camaro - ZL1 | Sensor | ZL1 | 28423 | 62, 7 | | |
| | | | | | | Service Pack | ZL1 | 20004 | 62, 7 | | |
| | | | | | Caprice | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | | | | | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | |
| | | | | | Caprice Police Sedan | Sensor | - | | | | |
| | | | | | | Service Pack | - | | | | |
| | | | | | Corvette | Sensor | 433 MHz WAL | 20223 | | | |
| | | | | | | Service Pack | - | | | | |
| | | | | | Cruze, Equinox | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | | | | | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | |
| | | | | | | Sensor | - | 28206 | 11.5, 1.3 | | |
| | | | | | | Service Pack | - | 20008 | 11.5, 1.3 | | |
| | | | | | | Express | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | | | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | | | | | EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | | |
| | | | | | Sensor | | - | 20153 | 11.5, 1.3 | | |
| | | | | | Service Pack | - | 20008 | 11.5, 1.3 | | | |
| | | | | | Chevrolet (cont.) | Suburban, Tahoe | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | | | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | | | | | | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | | | | | | | Sensor | - | 28206 | 11.5, 1.3 | |
| | | | | | | | Service Pack | - | 20008 | 11.5, 1.3 | |
| | | | | | | | Service Pack | - | 20008 | 11.5, 1.3 | |
| | | | | | | Traverse | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | | | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | | | | | | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | | | | | | | Sensor | - | 20153 | 11.5, 1.3 | |
| | | | | | | | Service Pack | - | 20008 | 11.5, 1.3 | |
| | | | | | Volt | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | | | | | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | |
| | | | | | | Sensor | - | 28206 | 11.5, 1.3 | | |
| | | | | | | Service Pack | - | 20008 | 11.5, 1.3 | | |
| | | | | | 2013 | | | | | | |
| | | | | | Avalanche | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | | | | | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | |
| | | | | | | Sensor | - | 20153 | 11.5, 1.3 | | |
| | | | | | | Service Pack | - | 20008 | 11.5, 1.3 | | |

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|--------------------------|------------------------|------------------------|--|-------------------------------|------------------------|----------------------------------|------------------------|----------------------|-------------------------------|-----------|
| 2013 (cont.) | | | | | 2013 (cont.) | | | | | |
| Chevrolet (cont.) | Camaro | EZ-Sensor | Exc. ZL1 | 33000* | 11.5, 1.3 | Silverado Series Pickup | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve; Exc. ZL1 | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve; Exc. ZL1 | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | Sensor | Exc. ZL1 | 28206 | 11.5, 1.3 | | Sensor | W/Single Rear Wheels | 20153 | 11.5, 1.3 |
| | | Service Pack | Exc. ZL1 | 20008 | 11.5, 1.3 | | Service Pack | W/Single Rear Wheels | 20008 | 11.5, 1.3 |
| | Camaro - ZL1 | Sensor | ZL1 | 28423 | 62, 7 | Sonic, Spark | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Service Pack | ZL1 | 20004 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Caprice | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 28206 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Service Pack | - | 20008 | 11.5, 1.3 | |
| | | Sensor | - | 20158 | 62, 7 | Suburban, Tahoe, Traverse | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Service Pack | - | 20004 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Captiva | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Sensor | - | 20153 | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Service Pack | - | 20008 | 11.5, 1.3 | |
| | | Sensor | - | 20153 | 11.5, 1.3 | Volt | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Service Pack | - | 20008 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Corvette | EZ-Sensor | When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000 | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Sensor | - | 28206 | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Service Pack | - | 20008 | 11.5, 1.3 | |
| | | Sensor | - | 20158 | 62, 7 | 2012 | | | | |
| | | Service Pack | - | 20004 | 62, 7 | Avalanche, Aveo | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Cruze, Equinox | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 20153 | 11.5, 1.3 |
| | | Sensor | - | 28206 | 11.5, 1.3 | | Service Pack | - | 20008 | 11.5, 1.3 |
| | | Service Pack | - | 20008 | 11.5, 1.3 | Camaro | EZ-Sensor | Exc. ZL1 | 33000* | 11.5, 1.3 |
| Express, Impala | EZ-Sensor | - | 33000* | 11.5, 1.3 | EZ-Sensor Service Pack | | Rubber Valve; Exc. ZL1 | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | Almnm. Valve; Exc. ZL1 | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sensor | | - | 28206 | 11.5, 1.3 | |
| | Sensor | - | 20153 | 11.5, 1.3 | Sensor | | Exc. ZL1 | 28206 | 11.5, 1.3 | |
| | Service Pack | - | 20008 | 11.5, 1.3 | Service Pack | Exc. ZL1 | 20008 | 11.5, 1.3 | | |
| Malibu | EZ-Sensor | - | 33000* | 11.5, 1.3 | Camaro - ZL1 | Sensor | ZL1 | 28423 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | ZL1 | 20004 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Caprice | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Sensor | - | 28206 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | - | 20008 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | | | | | Sensor | - | 20158 | 62, 7 | | |
| | | | | | Service Pack | - | 20004 | 62, 7 | | |

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | |
|-------------------------|------------------------|------------------------|--|-------------------------------|------------------------|------------------------|---------------------------|--|-------------------------------|-----------|-----------|
| 2012 (cont.) | | | | | 2012 (cont.) | | | | | | |
| Chevrolet (cont.) | Captiva | EZ-Sensor | - | 33000* | 11.5, 1.3 | Sonic (cont.) | Sensor | - | 28206 | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | - | 20008 | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Suburban, Tahoe, Traverse | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Sensor | - | 20153 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | Service Pack | - | 20008 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | EZ-Sensor | - | 33000* | 11.5, 1.3 | | | Sensor | - | 20153 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | - | | 20008 | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Volt | EZ-Sensor | | - | 33000* | 11.5, 1.3 | |
| | Sensor | - | 20131 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | Service Pack | - | 20006 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | |
| | Colorado | EZ-Sensor | - | 33000* | | 11.5, 1.3 | Sensor | - | 28206 | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | | 11.5, 1.3 | Service Pack | - | 20008 | 11.5, 1.3 | |
| EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | | 2011 | | | | | |
| Sensor | | - | 20158 | 62, 7 | Avalanche, Aveo | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| Service Pack | | - | 20004 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| Corvette, Corvette Z06 | | EZ-Sensor | When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000 | 33000* | | 11.5, 1.3 | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 20153 | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20008 | 11.5, 1.3 | | |
| | Sensor | - | 20158 | 62, 7 | | Camaro | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Service Pack | - | 20004 | 62, 7 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | Cruze, Equinox | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | Sensor | | - | 28206 | 11.5, 1.3 | | |
| EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | Service Pack | | - | 20008 | 11.5, 1.3 | | |
| Sensor | | - | 28206 | 11.5, 1.3 | Caprice | | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| Service Pack | | - | 20008 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| Express, Impala, Malibu | | EZ-Sensor | - | 33000* | | 11.5, 1.3 | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 20158 | 62, 7 | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20004 | 62, 7 | | |
| | Sensor | - | 20153 | 11.5, 1.3 | | Colorado | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Service Pack | - | 20008 | 11.5, 1.3 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | Orlando | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | Sensor | | - | 20131 | 62, 7 | | |
| EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | Service Pack | | - | 20006 | 62, 7 | | |
| Sensor | | - | 28206 | 11.5, 1.3 | Corvette, Corvette Z06 | | EZ-Sensor | When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000 | 33000* | 11.5, 1.3 | |
| Service Pack | | - | 20008 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| Silverado Series Pickup | | EZ-Sensor | - | 33000* | | 11.5, 1.3 | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 20158 | 62, 7 | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20004 | 62, 7 | | |
| | Sensor | W/Single Rear Wheels | 20153 | 11.5, 1.3 | | Sonic | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Service Pack | W/Single Rear Wheels | 20008 | 11.5, 1.3 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | Sonic | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | Sensor | | - | 20158 | 62, 7 | | |
| EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | Service Pack | | - | 20004 | 62, 7 | | |
| Sensor | | - | 20153 | 11.5, 1.3 | | | | | | | |
| Service Pack | | - | 20008 | 11.5, 1.3 | | | | | | | |
| Service Pack | | - | 20006 | 62, 7 | | | | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|--------------------------|-------------------------------------|------------------------|----------------------|-------------------------------|--------------------------|--------------------------------|------------------------|---|-------------------------------|-----------|
| 2011 (cont.) | | | | | 2010 (cont.) | | | | | |
| Chevrolet (cont.) | Cruze, Equinox | EZ-Sensor | | 33000* | 11.5, 1.3 | Corvette, Corvette Z06 | EZ-Sensor | When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000 | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | | Sensor | - | 28206 | 11.5, 1.3 | | Sensor | - | 20158 | 62, 7 |
| | | Service Pack | - | 20008 | 11.5, 1.3 | | Service Pack | - | 20004 | 62, 7 |
| | Express, HHR, Impala, Malibu | EZ-Sensor | - | 33000* | 11.5, 1.3 | Equinox | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | | Sensor | - | 20153 | 11.5, 1.3 | | Sensor | - | 28206 | 11.5, 1.3 |
| | | Service Pack | - | 20008 | 11.5, 1.3 | | Service Pack | - | 20008 | 11.5, 1.3 |
| | Silverado Series Pickup | EZ-Sensor | - | 33000* | 11.5, 1.3 | Express | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | | Sensor | W/Single Rear Wheels | 20153 | 11.5, 1.3 | | Sensor | - | 20153 | 11.5, 1.3 |
| | | Service Pack | W/Single Rear Wheels | 20008 | 11.5, 1.3 | | Service Pack | - | 20008 | 11.5, 1.3 |
| | Suburban, Tahoe, Traverse | EZ-Sensor | - | 33000* | 11.5, 1.3 | HHR | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | | Sensor | - | 20153 | 11.5, 1.3 | | Sensor | - | 28206 | 11.5, 1.3 |
| | | Service Pack | - | 20008 | 11.5, 1.3 | | Service Pack | - | 20008 | 11.5, 1.3 |
| | Volt | EZ-Sensor | - | 33000* | 11.5, 1.3 | Impala | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | | Sensor | - | 28206 | 11.5, 1.3 | | Sensor | - | 20153 | 11.5, 1.3 |
| Service Pack | | - | 20008 | 11.5, 1.3 | Service Pack | | - | 20008 | 11.5, 1.3 | |
| 2010 | | | | | Chevrolet (cont.) | Malibu | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| Avalanche, Aveo | EZ-Sensor | - | 33000* | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | | Sensor | - | 20153 | 11.5, 1.3 |
| | Sensor | - | 20153 | 11.5, 1.3 | | | Service Pack | - | 20008 | 11.5, 1.3 |
| | Service Pack | - | 20008 | 11.5, 1.3 | | Silverado Series Pickup | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| Camaro, Cobalt | EZ-Sensor | - | 33000* | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | | Sensor | - | 28206 | 11.5, 1.3 |
| | Sensor | - | 28206 | 11.5, 1.3 | | | Service Pack | - | 20008 | 11.5, 1.3 |
| | Service Pack | - | 20008 | 11.5, 1.3 | | Colorado | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| EZ-Sensor | - | 33000* | 11.5, 1.3 | EZ-Sensor Service Pack | | | Rubber Valve | 20018 | 11.5, 1.3 | |
| EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | | Almm. Valve | 34000 | 62, 7 | |
| EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Sensor | | | - | 20131 | 62, 7 | |
| Sensor | - | 20131 | 62, 7 | Service Pack | | | - | 20006 | 62, 7 | |
| Service Pack | - | 20006 | 62, 7 | | | | | | | |

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|---------------------------------|--|--|-----------|-------------------------------|--------------------------------|---|---|--------------|-------------------------------|-----------|
| 2010 (cont.) | | | | | 2009 (cont.) | | | | | |
| Suburban, Tahoe, Traverse | EZ-Sensor | - | 33000* | 11.5, 1.3 | Equinox, Express (cont.) | Sensor | - | 20158 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | W/Schrader Sensor | 20004 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | W/Siemens Sensor | 20030 | 80, 9 | |
| | Sensor | - | 20153 | 11.5, 1.3 | | HHR | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Service Pack | - | 20008 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| 2009 | | | | | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| Avalanche, Aveo | EZ-Sensor | - | 33000* | 11.5, 1.3 | Sensor | | Snap-In Style Only; W/Rubber Valve Stem | 20153 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Sensor | | Clamp-In Style Only; W/Almnm. Valve Stem | 20158 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Service Pack | Clamp-In Style Only; W/Almnm. Valve Stem | 20004 | 80, 9 | | |
| | Sensor | - | 20153 | 11.5, 1.3 | Service Pack | Snap-In Style Only; W/Rubber Valve Stem | 20008 | 11.5, 1.3 | | |
| | Service Pack | - | 20008 | 11.5, 1.3 | Impala, Malibu | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| Cobalt Cobalt | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 20153 | 11.5, 1.3 | |
| | Sensor | Snap-In Style Only; W/Rubber Valve Stem | 20153 | 11.5, 1.3 | | Service Pack | - | 20008 | 11.5, 1.3 | |
| | Service Pack | Clamp-In Style Only; W/Almnm. Valve Stem | 20004 | 80, 9 | Silverado Series Pickup | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| Service Pack | Snap-In Style Only; W/Rubber Valve Stem | 20008 | 11.5, 1.3 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | | |
| Colorado | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | W/Single Rear Wheels | 20153 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | W/Single Rear Wheels | 20008 | 11.5, 1.3 | |
| | Sensor | - | 20131 | 62, 7 | Suburban, Tahoe | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Service Pack | - | 20006 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| Corvette, Corvette C6 | EZ-Sensor | When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000 | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 20153 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20008 | 11.5, 1.3 | |
| | Sensor | - | 20076 | 62, 7 | Trail- blazer | Sensor | OEM Part No. 25774006 | 20116 | 62, 7 | |
| | Service Pack | - | 20004 | 62, 7 | | Service Pack | - | 20004 | 62, 7 | |
| Corvette Z06 | EZ-Sensor | When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000 | 33000* | 11.5, 1.3 | Traverse | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 20076 | 62, 7 | | Sensor | - | 20153 | 11.5, 1.3 | |
| | Service Pack | - | 20004 | 62, 7 | | Service Pack | - | 20008 | 11.5, 1.3 | |
| Equinox, Express | EZ-Sensor | - | 33000* | 11.5, 1.3 | Uplander | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | | | | | | Sensor | - | 20158 | 62, 7 | |
| | | | | | | Service Pack | - | 20004 | 62, 7 | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|-------------------------------------|---|--|---|-------------------------------|------------------------|-------------------------|---|--|-------------------------------|-----------|
| 2008 | | | | | 2008 (cont.) | | | | | |
| Chevrolet (cont.) | Avalanche, Aveo | EZ-Sensor | - | 33000* | 11.5, 1.3 | Impala (cont.) | Sensor | - | 20153 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | - | 20008 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Malibu | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Sensor | Snap-In Style Only; Schrader Sensor; W/ Rubber Valve Stem | 20153 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | Service Pack | - | 20008 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | Cobalt | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sensor | Snap-In Style Only; W/Rubber Valve Stem | 20153 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | Clamp-In Style Only; W/Almm. Valve Stem | 20158 | 62, 7 |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Service Pack | Clamp-In Style Only; W/Almm. Valve Stem | 20004 | 80, 9 | |
| | | Sensor | Snap-In Style Only; W/Rubber Valve Stem | 20153 | 11.5, 1.3 | Service Pack | Snap-In Style Only; W/Rubber Valve Stem | 20008 | 11.5, 1.3 | |
| | | Sensor | Clamp-In Style Only; W/Almm. Valve Stem | 20158 | 62, 7 | Silverado Series Pickup | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| Service Pack | Clamp-In Style Only; W/Almm. Valve Stem | 20004 | 80, 9 | EZ-Sensor Service Pack | Rubber Valve | | 20018 | 11.5, 1.3 | | |
| Service Pack | Snap-In Style Only; W/Rubber Valve Stem | 20008 | 11.5, 1.3 | EZ-Sensor Service Pack | Almm. Valve | | 34000 | 62, 7 | | |
| Colorado | EZ-Sensor | - | 33000* | 11.5, 1.3 | Sensor | | W/Single Rear Wheels | 20153 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | | W/Single Rear Wheels | 20008 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Suburban, Tahoe | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Sensor | - | 20131 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | - | 20006 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| Corvette, Corvette C6, Corvette Z06 | EZ-Sensor | When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000 | 33000* | 11.5, 1.3 | | Sensor | - | 20153 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | - | 33000* | 11.5, 1.3 | | Service Pack | - | 20008 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Trail-blazer | Sensor | OEM Part No. 25774006 | 20116 | 62, 7 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | Service Pack | - | 20004 | 62, 7 | |
| | Sensor | - | 20158 | 62, 7 | Uplander | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| Service Pack | W/Schrader Sensor | 20004 | 62, 7 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | | |
| Service Pack | W/Siemens Sensor | 20030 | 80, 9 | EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | | |
| Chevrolet (cont.) | Equinox, Express | EZ-Sensor | - | 33000* | 11.5, 1.3 | Sensor | - | 20158 | 62, 7 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | - | 20004 | 62, 7 | |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | 2007 | | | | |
| | | Sensor | - | 20158 | 62, 7 | Avalanche | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Service Pack | W/Schrader Sensor | 20004 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Service Pack | W/Siemens Sensor | 20030 | 80, 9 | EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | |
| | HHR | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sensor | Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem | 20153 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | Clamp-In Style Only; TRW Sensor; W/Almm. Valve Stem | 20158 | 62, 7 |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | Service Pack | Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem | 20008 | 11.5, 1.3 |
| | | Sensor | Snap-In Style Only; W/Rubber Valve Stem | 20153 | 11.5, 1.3 | | Service Pack | Clamp-In Style Only; TRW Sensor; W/Almm. Valve Stem | 20015 | 80, 9 |
| Sensor | | Clamp-In Style Only; W/Almm. Valve Stem | 20158 | 62, 7 | Impala | | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| Service Pack | Clamp-In Style Only; W/Almm. Valve Stem | 20004 | 80, 9 | EZ-Sensor Service Pack | | | Rubber Valve | 20018 | 11.5, 1.3 | |
| Service Pack | Snap-In Style Only; W/Rubber Valve Stem | 20008 | 11.5, 1.3 | EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | | |

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|-------------------------------------|------------------------|--|--------|-------------------------------|-------------------------------------|---|--|-----------|-------------------------------|--|
| 2007 (cont.) | | | | | 2007 (cont.) | | | | | |
| Aveo | EZ-Sensor | - | 33000* | 11.5, 1.3 | Silverado Series Pickup (cont.) | Service Pack | Snap-In Style Only; Schrader Sensor; W/ Rubber Valve Stem; Exc. Classic | 20008 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | Clamp-In Style Only; TRW Sensor; W/Almm. Valve Stem; Exc. Classic | 20015 | 80, 9 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Suburban, Tahoe | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Sensor | Hatchback | 20153 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | - | 20008 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| Colorado | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sensor | Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem | 20153 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | Clamp-In Style Only; TRW Sensor; W/Almm. Valve Stem | 20158 | 62, 7 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Service Pack | Snap-In Style Only; Schrader Sensor; W/ Rubber Valve Stem | 20008 | 11.5, 1.3 | | |
| | Sensor | - | 20131 | 62, 7 | Service Pack | Clamp-In Style Only; TRW Sensor; W/Almm. Valve Stem | 20015 | 80, 9 | | |
| | Service Pack | - | 20006 | 62, 7 | Trail-blazer | Sensor | OEM Part No. 25774006 | 20116 | 62, 7 | |
| Corvette, Corvette C6, Corvette Z06 | EZ-Sensor | When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000 | 33000* | 11.5, 1.3 | | Service Pack | - | 20004 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | 2006 | | | | | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Avalanche | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Sensor | - | 20076 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | - | 20004 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| Equinox | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sensor | - | 20107 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | - | 20004 | 62, 7 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Corvette, Corvette C6, Corvette Z06 | EZ-Sensor | When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000 | 33000* | 11.5, 1.3 | |
| | Sensor | - | 20158 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | W/Schrader Sensor | 20004 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| Service Pack | W/Siemens Sensor | 20030 | 80, 9 | Sensor | | - | 20076 | 62, 7 | | |
| Service Pack | - | 20004 | 62, 7 | Service Pack | | - | 20004 | 62, 7 | | |
| Impala, Monte Carlo | EZ-Sensor | - | 33000* | 11.5, 1.3 | Impala, Monte Carlo | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | Sensor | Snap-In Style Only; W/Rubber Valve Stem | 20153 | 11.5, 1.3 | | Sensor | W/Alloy Wheels | 20158 | 62, 7 | |
| | Sensor | Clamp-In Style Only; W/Almm. Valve Stem | 20158 | 62, 7 | | Service Pack | W/Alloy Wheels | 20004 | 62, 7 | |
| Silverado Series Pickup | Service Pack | Clamp-In Style Only; W/Almm. Valve Stem | 20004 | 62, 7 | Silverado Series Pickup | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Service Pack | Snap-In Style Only; W/Rubber Valve Stem | 20008 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 20107 | 62, 7 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | Service Pack | - | 20004 | 62, 7 | |
| | Sensor | Classic | 20107 | 62, 7 | SSR | Sensor | OEM Part No. 25774006 | 20116 | 62, 7 | |
| | Sensor | Snap-In Style Only; Schrader Sensor; W/ Rubber Valve Stem; Exc. Classic | 20153 | 11.5, 1.3 | | Service Pack | - | 20004 | 62, 7 | |
| | Sensor | Clamp-In Style Only; TRW Sensor; W/Almm. Valve Stem; Exc. Classic | 20158 | 62, 7 | | | | | | |
| | Service Pack | Classic | 20004 | 62, 7 | | | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|--|---------------------------|--|---------|-------------------------------|-------------------------------|---|---|--------------|-------------------------------|-----------|
| 2006 (cont.) | | | | | 2003-2001 | | | | | |
| Suburban, Tahoe | EZ-Sensor | - | 33000* | 11.5, 1.3 | Chevrolet (cont.) | Corvette, Corvette C5, Corvette Z06 | Sensor | - | 20117** | 62, 7 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | - | 20003 | 62, 7 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | 2000-1997 | | | | | |
| | Sensor | - | 20107 | 62, 7 | Corvette | Sensor | - | 28006** | 62, 7 | |
| | Service Pack | - | 20004 | 62, 7 | | Service Pack | - | 20012 | 62, 7 | |
| Trail- blazer | Sensor | OEM Part No. 25774006 | 20116 | 62, 7 | 2014-2013 | | | | | |
| | Service Pack | - | 20004 | 62, 7 | 200 | Sensor | - | 28308 | 11.5, 1.3 | |
| 2005 | | | | | | Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| Avalanche | EZ-Sensor | - | 33000* | 11.5, 1.3 | 300, Town & Country Van | EZ-Sensor | - | 33200 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 20107 | 62, 7 | | Sensor | - | 20398 | 11.5, 1.3 | |
| | Service Pack | - | 20004 | 62, 7 | | Service Pack | - | 20018 | 11.5, 1.3 | |
| Corvette, Corvette C6, Corvette Z06 | EZ-Sensor | When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000 | 33000* | 11.5, 1.3 | 2012 | | | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | 200 | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Sensor | - | 20076 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | Service Pack | - | 20004 | 62, 7 | | Sensor | Almm. Valve | 20066 | 58, 6.5 | |
| Silverado Series Pickup, Suburban, Tahoe | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sensor | Rubber Valve | 28308 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | Service Pack | Almm. Valve | 20018 | 11.5, 1.3 | |
| | Sensor | - | 20107 | 62, 7 | | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | |
| Service Pack | - | 20004 | 62, 7 | 300 | | EZ-Sensor | - | 33200 | 11.5, 1.3 | |
| | 2004 | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| Avalanche | EZ-Sensor | - | 33000* | | 11.5, 1.3 | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | | 11.5, 1.3 | Sensor | W/Rubber Stem Snap-in Sensor | 20398 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | | 62, 7 | Service Pack | W/Rubber Stem Snap-in Sensor | 20008 | 11.5, 1.3 | |
| | Sensor | - | 20115 | | 62, 7 | Service Pack | W/Metal Stem Clamp-in Sensor; Does Not Include Stem | 20016 | 58, 6.5 | |
| | Service Pack | - | 20004 | | 62, 7 | Service Pack | W/Metal Stem Clamp-in Sensor; Includes Stem Only | 20020 | 58, 6.5 | |
| Corvette, Corvette C5, Corvette Z06 | Sensor | - | 20117** | | 62, 7 | Town & Country Van | EZ-Sensor | - | 33200 | 11.5, 1.3 |
| | Service Pack | - | 20003 | | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| Silverado Series Pickup, Suburban, Tahoe | EZ-Sensor | - | 33000* | | 11.5, 1.3 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Sensor | | - | 20398 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Service Pack | | - | 20018 | 11.5, 1.3 | |
| | Sensor | - | 20115 | 62, 7 | | | | | | |
| | Service Pack | - | 20004 | 62, 7 | | | | | | |

* Programming Tool Required ** Magnet Required to Activate Sensor

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|-------------------------|------------------------|---|--------|-------------------------------|----------------------------|------------------------|---|--------|-------------------------------|
| 2011 | | | | | 2010 (cont.) | | | | |
| 200 | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | Town & Country Van | EZ-Sensor | W/433 MHz Sensor | 33100 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 20066 | 58, 6.5 | | Sensor | - | 28155 | 58, 6.5 |
| | Sensor | - | 28308 | 11.5, 1.3 | | Sensor | - | 28434 | 11.5, 1.3 |
| | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 |
| | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 |
| | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | | Service Pack | W/Siemens Sensor | 20030 | 71, 8 |
| 2010 | | | | | 2009 | | | | |
| 300, Town & Country Van | EZ-Sensor | | 33200 | 11.5, 1.3 | 300 | EZ-Sensor | | 33200 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 20398 | 11.5, 1.3 | | Sensor | - | 28291 | 58, 6.5 |
| | Sensor | - | 28291 | 58, 6.5 | | Service Pack | Does Not Include Stem | 20016 | 58, 6.5 |
| | Service Pack | Does Not Include Stem | 20016 | 58, 6.5 | | Service Pack | Includes Stem Only | 20020 | 58, 6.5 |
| | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | Service Pack | Includes Stem Only | 20020 | 58, 6.5 |
| | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | | Service Pack | W/Siemens Sensor | 20030 | 71, 8 |
| 2010 | | | | | 2008 | | | | |
| 300 | EZ-Sensor | | 33200 | 11.5, 1.3 | Aspen, PT Cruiser, Sebring | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 20398 | 11.5, 1.3 | | Sensor | - | 20066 | 58, 6.5 |
| | Sensor | - | 28291 | 58, 6.5 | | Sensor | - | 28308 | 11.5, 1.3 |
| | Service Pack | Does Not Include Stem | 20016 | 58, 6.5 | | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 |
| | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 |
| | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | | Service Pack | W/Siemens Sensor | 20030 | 71, 8 |
| PT Cruiser | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | Town & Country Van | EZ-Sensor | W/433 MHz Sensor | 33100 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 20066 | 58, 6.5 | | Sensor | - | 28155 | 58, 6.5 |
| | Sensor | - | 28308 | 11.5, 1.3 | | Sensor | - | 28434 | 11.5, 1.3 |
| | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 |
| | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 |
| | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | | Service Pack | W/Siemens Sensor | 20030 | 71, 8 |
| Sebring | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | 300 | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | W/Steel Wheels | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 20066 | 58, 6.5 | | Sensor | - | 28155 | 58, 6.5 |
| | Sensor | - | 28308 | 11.5, 1.3 | | Sensor | - | 28434 | 11.5, 1.3 |
| | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 |
| | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 |
| | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | | Service Pack | W/Siemens Sensor | 20030 | 71, 8 |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | |
|-------------------------|-------------------------------|--|---|---|--------------|--|-------------------------|---|---|---|-----------|
| 2008 (cont.) | | | | | 2007 | | | | | | |
| Chrysler (cont.) | Aspen | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | 300 | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | | Sensor | - | 20066 | 58, 6.5 | | Sensor | - | 20066 | 58, 6.5 | |
| | | Sensor | - | 28308 | 11.5, 1.3 | | Sensor | - | 28155 | 58, 6.5 | |
| | | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | | Sensor | - | 28308 | 11.5, 1.3 | |
| | | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | | Sensor | - | 28434 | 11.5, 1.3 | |
| | | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | |
| | Crossfire | EZ-Sensor | W/315 MHz Sensor. Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | |
| | | EZ-Sensor | W/433 MHz Sensor | 33100 | 11.5, 1.3 | | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Aspen | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | Sensor | - | 20028** | 35, 4 | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | Service Pack | W/Schrader Sensor | 20003 | 35, 4 | | | Sensor | - | 20066 | 58, 6.5 |
| | | Service Pack | W/Siemens Sensor | 20030 | 35, 4 | | | Sensor | - | 28308 | 11.5, 1.3 |
| | | Pacifica, PT Cruiser, Sebring | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | | | 11.5, 1.3 | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 |
| | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | |
| | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | Service Pack | | W/Siemens Sensor | 20030 | 71, 8 | |
| | Sensor | | - | 20066 | 58, 6.5 | Crossfire | EZ-Sensor | W/315 MHz Sensor. Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | |
| | Sensor | | - | 28308 | 11.5, 1.3 | | EZ-Sensor | W/433 MHz Sensor | 33100 | 11.5, 1.3 | |
| | Service Pack | | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | | W/Siemens Sensor | 20030 | 71, 8 | | Sensor | - | 20028** | 35, 4 | |
| | Town & Country Van | EZ-Sensor | W/315 MHz Sensor. Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | | Service Pack | W/Schrader Sensor | 20003 | 35, 4 | |
| | | EZ-Sensor | W/433 MHz Sensor | 33100 | 11.5, 1.3 | | Service Pack | W/Siemens Sensor | 20030 | 35, 4 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Chrysler (cont.) | Pacifica, Sebring, Town & Country Van | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | EZ-Sensor Service Pack | | | Rubber Valve | 20018 | 11.5, 1.3 |
| | | Sensor | - | 20066 | 58, 6.5 | EZ-Sensor Service Pack | | | Almnm. Valve | 34000 | 62, 7 |
| Sensor | | - | 28155 | 58, 6.5 | Sensor | - | | | 20066 | 58, 6.5 | |
| Sensor | | - | 28308 | 11.5, 1.3 | Sensor | - | | | 28308 | 11.5, 1.3 | |
| Sensor | | - | 28434 | 11.5, 1.3 | Service Pack | W/Schrader Sensor; Does Not Include Stem | | | 20013 | 58, 6.5 | |
| Service Pack | | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | Service Pack | W/Schrader Sensor; Includes Stem Only | | | 20020 | 58, 6.5 | |
| Service Pack | | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | Service Pack | W/Siemens Sensor | | | 20030 | 71, 8 | |
| Service Pack | | W/Siemens Sensor | 20030 | 71, 8 | | | | | | | |

* Programming Tool Required ** Magnet Required to Activate Sensor

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|------------------------------|------------------------|---|---|-------------------------------|------------------------|-------------------------------|---|--|-------------------------------|-----------|
| 2006 | | | | | 2005 (cont.) | | | | | |
| 300 | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | Crossfire (cont.) | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | | 20028** | 35, 4 | |
| | Sensor | - | 20066 | 58, 6.5 | | Sensor | | 20066 | 58, 6.5 | |
| | Sensor | - | 28308 | 11.5, 1.3 | | Service Pack | | 28308 | 11.5, 1.3 | |
| | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | | Service Pack | | 20003 | 35, 4 | |
| | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | | Service Pack | | 20013 | 58, 6.5 | |
| | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | | Service Pack | | 20020 | 58, 6.5 | |
| | Crossfire | EZ-Sensor | W/315 MHz Sensor. Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | Pacifica, Town & Country Van | Sensor | - | 20335 | 71, 8 |
| | | EZ-Sensor | W/433 MHz Sensor | 33100 | 11.5, 1.3 | | Service Pack | - | 20030 | 71, 8 |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | 2004 | | | | | |
| EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | 300M | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | 11.5, 1.3 | |
| Sensor | | - | 20028** | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| Service Pack | | W/Schrader Sensor | 20003 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| Service Pack | | W/Siemens Sensor | 20030 | 35, 4 | | Sensor | - | 20028** | 35, 4 | |
| Pacifica, Town & Country Van | | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | | 11.5, 1.3 | Service Pack | W/Schrader Sensor | 20003 | 35, 4 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | W/Siemens Sensor | 20030 | 35, 4 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Concorde, Crossfire, Intrepid | EZ-Sensor | | 33100 | 11.5, 1.3 |
| | Sensor | - | 20066 | 58, 6.5 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Sensor | - | 28308 | 11.5, 1.3 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | Sensor | | - | 20028** | 35, 4 | |
| | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | Service Pack | | W/Schrader Sensor | 20003 | 35, 4 | |
| | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | Service Pack | | W/Siemens Sensor | 20030 | 35, 4 | |
| 300 | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | Pacifica | | EZ-Sensor | W/ 433 MHz sensor. Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 20066 | 58, 6.5 | | Sensor | OEM Part No. 52088990AC | 20028** | 35, 4 | |
| | Sensor | - | 28308 | 11.5, 1.3 | | Sensor | OEM Part No. 04727392AD | 20335 | 71, 8 | |
| | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | | Service Pack | W/Schrader Sensor | 20003 | 35, 4 | |
| | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | |
| | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | | Town & Country Van | Sensor | - | 20335 | 71, 8 |
| | Crossfire | EZ-Sensor | W/315 MHz Sensor. Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | | Service Pack | - | 20030 | 71, 8 |
| | | EZ-Sensor | W/433 MHz Sensor | 33100 | 11.5, 1.3 | 2003 | | | | |
| 300M | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | 11.5, 1.3 | 300M | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 20028** | 35, 4 | | Sensor | - | 20028** | 35, 4 | |
| | Service Pack | W/Schrader Sensor | 20003 | 35, 4 | | Service Pack | W/Schrader Sensor | 20003 | 35, 4 | |
| | Service Pack | W/Siemens Sensor | 20030 | 35, 4 | | Service Pack | W/Siemens Sensor | 20030 | 35, 4 | |

* Programming Tool Required ** Magnet Required to Activate Sensor

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|--------------------------------------|--------------------------------------|---|---------|-------------------------------|---|---------------------------------|---|--------------|-------------------------------|-----------|
| 2003 (cont.) | | | | | 2002 (cont.) | | | | | |
| Concorde, Intrepid | EZ-Sensor | | 33100 | 11.5, 1.3 | Town & Country Van, Voyager (cont.) | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 20028** | 35, 4 | |
| | Sensor | - | 20028** | 35, 4 | | Service Pack | - | 20003 | 35, 4 | |
| | Service Pack | W/Schrader Sensor | 20003 | 35, 4 | 2001 | | | | | |
| | Service Pack | W/Siemens Sensor | 20030 | 35, 4 | Prowler | Sensor | - | 28004 | 35, 4 | |
| Pacifica | EZ-Sensor | W/ 433 MHz sensor. Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | 11.5, 1.3 | | Service Pack | W/Red Sensor Body | 20003 | 35, 4 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | W/Black Sensor Body | 20012 | 35, 4 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | 2014 | | | | | |
| | Sensor | OEM Part No. 52088990AC | 20028** | 35, 4 | Avenger | Sensor | - | 28308 | 11.5, 1.3 | |
| | Service Pack | W/Schrader Sensor | 20003 | 35, 4 | | Service Pack | | 20018 | 11.5, 1.3 | |
| | Town & Country Van, Voyager | EZ-Sensor | | 33100 | 11.5, 1.3 | Challenger | EZ-Sensor | | 33200 | 11.5, 1.3 |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | |
| EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| Sensor | | - | 20028** | 35, 4 | Sensor | W/Rubber Stem Snap-in Sensor | 20398 | 11.5, 1.3 | | |
| Service Pack | - | 20003 | 35, 4 | Service Pack | W/Rubber Stem Snap-in Sensor | 20018 | 11.5, 1.3 | | | |
| 2002 | | | | | Charger | EZ-Sensor | | 33200 | 11.5, 1.3 | |
| 300M | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 20398 | 11.5, 1.3 | |
| | Sensor | - | 20028** | 35, 4 | | Service Pack | - | 20018 | 11.5, 1.3 | |
| | Service Pack | W/Schrader Sensor | 20003 | 35, 4 | | Dart | Sensor | - | 28586 ^{††} | |
| | Service Pack | W/Siemens Sensor | 20030 | 35, 4 | | | Service Pack | - | 20043 [†] | |
| Concorde, Intrepid | EZ-Sensor | | 33100 | 11.5, 1.3 | | Durango, Grand Caravan | EZ-Sensor | | 33200 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 20028** | 35, 4 | Sensor | | - | 20398 | 11.5, 1.3 | |
| | Service Pack | W/Schrader Sensor | 20003 | 35, 4 | Service Pack | - | 20018 | 11.5, 1.3 | | |
| | Service Pack | W/Siemens Sensor | 20030 | 35, 4 | Journey | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33200 | 11.5, 1.3 | |
| Prowler | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 20398 | 11.5, 1.3 | |
| | Sensor | - | 20028** | 35, 4 | Service Pack | - | 20018 | 11.5, 1.3 | | |
| | Service Pack | W/Schrader Sensor | 20003 | 35, 4 | Ram Pro- master | Sensor | - | | | |
| | Service Pack | W/Siemens Sensor | 20030 | 35, 4 | | Service Pack | - | | | |
| Town & Country Van, Voyager | EZ-Sensor | | 33100 | 11.5, 1.3 | Ram Series Pickup | Sensor | - | 28984 | N/A | |
| | | | | | | Service Pack | - | | | |
| 2013 | | | | | Avenger | Sensor | - | 28308 | 11.5, 1.3 | |
| | | | | | | Service Pack | | 20018 | 11.5, 1.3 | |

** Magnet Required to Activate Sensor † Continental Rubber Clip-in Valve †† Continental Rubber Valve Sensor

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | | |
|---------------------|------------------------|---|------------------------------|-------------------------------|-------------------------------|------------------------|---|---|---|---------------------|-----------|-----------|
| 2013 (cont.) | | | | | 2012 (cont.) | | | | | | | |
| Dodge (cont.) | Challenger | EZ-Sensor | | 33200 | 11.5, 1.3 | Dodge (cont.) | Challenger | EZ-Sensor | | 33200 | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | | Sensor | W/Rubber Stem Snap-in Sensor | 20398 | 11.5, 1.3 | | | Sensor | W/Rubber Stem Snap-in Sensor | 20398 | 11.5, 1.3 | |
| | | Service Pack | W/Rubber Stem Snap-in Sensor | 20018 | 11.5, 1.3 | | | Sensor | W/Metal Stem Clamp-in Sensor | 28291 | 58, 6.5 | |
| | Charger | EZ-Sensor | | 33200 | 11.5, 1.3 | | Charger | Service Pack | W/Rubber Stem Snap-in Sensor | 20008 | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | Service Pack | W/Metal Stem Clamp-in Sensor; Does Not Include Stem | 20016 | 58, 6.5 | |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | | Service Pack | W/Metal Stem Clamp-in Sensor; Includes Stem Only | 20020 | 58, 6.5 | |
| | | Sensor | - | 20398 | 11.5, 1.3 | | | Charger | EZ-Sensor | | 33200 | 11.5, 1.3 |
| | | Service Pack | - | 20018 | 11.5, 1.3 | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| Dart | Sensor | - | 28586 ^{††} | | Dart | EZ-Sensor Service Pack | Almm. Valve | | 34000 | 62, 7 | | |
| | Service Pack | - | 20043 | | | Sensor | - | | 20398 | 11.5, 1.3 | | |
| | Durango, Grand Caravan | EZ-Sensor | | 33200 | | 11.5, 1.3 | Durango, Grand Caravan | | Service Pack | - | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | | 11.5, 1.3 | | Sensor | - | 28586 ^{††} | | |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | | 62, 7 | | Service Pack | - | 20043 | | |
| Sensor | | - | 20398 | 11.5, 1.3 | Journey | EZ-Sensor | | | 33200 | 11.5, 1.3 | | |
| Service Pack | | - | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | | |
| Journey | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33200 | 11.5, 1.3 | | Journey | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | Sensor | - | 20398 | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | | Service Pack | - | 20018 | 11.5, 1.3 | | |
| | Sensor | - | 20398 | 11.5, 1.3 | EZ-Sensor | | Caution: Pressure by location vehicles not supported by EZ-sensor | 33200 | 11.5, 1.3 | | | |
| | Service Pack | - | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | | | |
| Ram Series Pickup | EZ-Sensor | | 33200 | 11.5, 1.3 | Ram Series Pickup | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 20398 | 11.5, 1.3 | | | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | Service Pack | - | 20018 | 11.5, 1.3 | | | |
| | Sensor | - | 20398 | 11.5, 1.3 | | Nitro | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | | |
| | Service Pack | - | 20018 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| 2012 | | | | | EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | | | |
| Avenger, Caliber | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | Sensor | | - | 20066 | 58, 6.5 | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Sensor | | - | 28308 | 11.5, 1.3 | | | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Service Pack | Does Not Include Stem | 20013 | 58, 6.5 | | | | |
| | Sensor | - | 20066 | 58, 6.5 | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | | | |
| | Sensor | - | 28308 | 11.5, 1.3 | Ram 4500HD, Ram Series Pickup | EZ-Sensor | | 33200 | 11.5, 1.3 | | | |
| | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | |
| | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | | |
| | | | | Sensor | | - | 20398 | 11.5, 1.3 | | | | |
| | | | | Service Pack | | - | 20018 | 11.5, 1.3 | | | | |

* Programming Tool Required †† Continental Rubber Valve Sensor

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | |
|----------------------|-------------------------------|---|---|---|------------------------|---------------------------------------|--|---|--|-----------|-----------|
| 2011 | | | | | 2011 (cont.) | | | | | | |
| Dodge (cont.) | Avenger, Caliber | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | Journey (cont.) | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 20398 | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20008 | 11.5, 1.3 | |
| | | Sensor | - | 20066 | 58, 6.5 | Magnum | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | 11.5, 1.3 | |
| | | Sensor | - | 28308 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | | Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 20398 | 58, 6.5 | |
| | Challenger | EZ-Sensor | | 33200 | 11.5, 1.3 | | Service Pack | | 20018 | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Nitro | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | Sensor | W/Rubber Stem Snap-in Sensor | 20398 | 11.5, 1.3 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| | | Sensor | W/Metal Stem Clamp-in Sensor | 28291 | 58, 6.5 | Sensor | | - | 20066 | 58, 6.5 | |
| | | Service Pack | W/Rubber Stem Snap-in Sensor | 20008 | 11.5, 1.3 | Sensor | | - | 28308 | 11.5, 1.3 | |
| | | Service Pack | W/Metal Stem Clamp-in Sensor; Does Not Include Stem | 20016 | 58, 6.5 | Service Pack | | Does Not Include Stem | 20013 | 58, 6.5 | |
| | Service Pack | W/Metal Stem Clamp-in Sensor; Includes Stem Only | 20020 | 58, 6.5 | Service Pack | Includes Stem Only | | 20020 | 58, 6.5 | | |
| | Charger | EZ-Sensor | | 33200 | 11.5, 1.3 | Ram Series Pickup | EZ-Sensor | | 33200 | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | | Sensor | W/Rubber Stem Snap-in Sensor | 20398 | 11.5, 1.3 | | Sensor | W/Rubber Stem Snap-in Sensor | 20398 | 11.5, 1.3 | |
| | | Service Pack | W/Rubber Stem Snap-in Sensor | 20008 | 11.5, 1.3 | Service Pack | W/Rubber Stem Snap-in Sensor | 20008 | 11.5, 1.3 | | |
| | | Dakota | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | Viper | EZ-Sensor | When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000 | 33100 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | | - | 28308 | 58, 6.5 | Sensor | | - | 20028** | 35, 4 | |
| | Service Pack | | Includes Stem Only | 20008 | 11.5, 1.3 | Service Pack | | - | 20003 | 35, 4 | |
| | Durango, Grand Caravan | | EZ-Sensor | | 33200 | 11.5, 1.3 | | 2010 | | | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Avenger | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| Sensor | | - | 20398 | 11.5, 1.3 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | | |
| Service Pack | | - | 20008 | 11.5, 1.3 | Sensor | | - | 20066 | 58, 6.5 | | |
| Journey | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33200 | 11.5, 1.3 | Sensor | | - | 28308 | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | | |
| | | | | | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | | | |

* Programming Tool Required ** Magnet Required to Activate Sensor

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|------------------------|------------------------|---|---|-------------------------------|---------------------|--|---|---|-------------------------------|-----------|
| 2010 (cont.) | | | | | 2010 (cont.) | | | | | |
| Dodge (cont.) | Caliber | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | Grand Caravan (cont.) | Sensor | - | 28155 | 58, 6.5 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 28434 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Alnm. Valve | 34000 | 62, 7 | | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 |
| | | Sensor | - | 20066 | 58, 6.5 | | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 |
| | | Sensor | - | 28308 | 11.5, 1.3 | | Service Pack | W/Siemens Sensor | 20030 | 71, 8 |
| | | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | Journey | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | 11.5, 1.3 |
| | | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | | EZ-Sensor Service Pack | Alnm. Valve | 34000 | 62, 7 |
| | Challenger, Charger | EZ-Sensor | | 33200 | 11.5, 1.3 | | Sensor | - | 20398 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 28155 | 58, 6.5 |
| | | EZ-Sensor Service Pack | Alnm. Valve | 34000 | 62, 7 | | Sensor | - | 28434 | 11.5, 1.3 |
| | | Sensor | W/Rubber Stem Snap-in Sensor | 20398 | 11.5, 1.3 | | Service Pack | - | 20008 | 11.5, 1.3 |
| Sensor | | W/Metal Stem Clamp-in Sensor | 28291 | 58, 6.5 | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | | |
| Service Pack | | W/Rubber Stem Snap-in Sensor | 20008 | 11.5, 1.3 | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | | |
| Service Pack | | W/Metal Stem Clamp-in Sensor; Does Not Include Stem | 20016 | 58, 6.5 | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | | |
| Service Pack | | W/Metal Stem Clamp-in Sensor; Includes Stem Only | 20020 | 58, 6.5 | Magnum | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | 11.5, 1.3 | |
| Dakota | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Alnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Alnm. Valve | 34000 | 62, 7 | | Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 20398 | 58, 6.5 | |
| | Sensor | - | 28154 | 58, 6.5 | Service Pack | | 20018 | 11.5, 1.3 | | |
| | Sensor | - | 28461 | 11.5, 1.3 | Nitro | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | |
| | Service Pack | Does Not Include Stem | 20013 | 58, 6.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | EZ-Sensor Service Pack | Alnm. Valve | 34000 | 62, 7 | |
| | Durango | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | | 11.5, 1.3 | Sensor | - | 20066 | 58, 6.5 |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 28308 | 11.5, 1.3 | |
| EZ-Sensor Service Pack | | Alnm. Valve | 34000 | 62, 7 | | Service Pack | Does Not Include Stem | 20013 | 58, 6.5 | |
| Sensor | | - | 20066 | 58, 6.5 | | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | |
| Sensor | | - | 28308 | 11.5, 1.3 | Ram Series Pickup | EZ-Sensor | | 33200 | 11.5, 1.3 | |
| Service Pack | | Does Not Include Stem | 20013 | 58, 6.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| Service Pack | | Includes Stem Only | 20020 | 58, 6.5 | | EZ-Sensor Service Pack | Alnm. Valve | 34000 | 62, 7 | |
| Grand Caravan | | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | | 11.5, 1.3 | Sensor | W/Rubber Stem Snap-in Sensor | 20398 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | 1500, 2500; W/Metal Stem Clamp-in Sensor | 28155 | 58, 6.5 | |
| | EZ-Sensor Service Pack | Alnm. Valve | 34000 | 62, 7 | | Sensor | W/Rubber Stem Snap-in Sensor | 28434 | 11.5, 1.3 | |
| | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | Service Pack | W/Rubber Stem Snap-in Sensor | 20008 | 11.5, 1.3 | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | |
|---------------------------|------------------------|--|---|-------------------------------|------------------------|------------------------|---|---|---|-----------|-----------|
| 2010 (cont.) | | | | | 2009 (cont.) | | | | | | |
| Ram Series Pickup (cont.) | Service Pack | 1500, 2500; W/Metal Stem Clamp-in Sensor; Does Not Include Stem | 20013 | 58, 6.5 | Durango | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | | |
| | Service Pack | 1500, 2500; W/Metal Stem Clamp-in Sensor; Includes Stem Only | 20020 | 58, 6.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| Sprinter | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 20066 | 58, 6.5 | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 28308 | 11.5, 1.3 | | |
| | Sensor | - | 20089 | 53, 6 | | Service Pack | Does Not Include Stem | 20013 | 58, 6.5 | | |
| | Service Pack | Includes Valve | 20036 | 53, 6 | | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | |
| | EZ-Sensor | When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000 | 33100 | 11.5, 1.3 | | Grand Caravan, Journey | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | 11.5, 1.3 | |
| EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | | Rubber Valve | 20018 | 11.5, 1.3 | | |
| EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | EZ-Sensor Service Pack | | | Almnm. Valve | 34000 | 62, 7 | | |
| Sensor | - | 20028** | 35, 4 | Sensor | - | | 28155 | 58, 6.5 | | | |
| Service Pack | - | 20003 | 35, 4 | Sensor | - | | 28434 | 11.5, 1.3 | | | |
| 2009 | | | | | Service Pack | | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | | |
| Dodge (cont.) | Avenger, Caliber | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Magnum | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | 11.5, 1.3 |
| | | Sensor | - | 20066 | 58, 6.5 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | Sensor | - | 28308 | 11.5, 1.3 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| | | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | Sensor | | Caution: Pressure by location vehicles not supported by EZ-sensor | 28291 | 58, 6.5 | |
| | | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | Service Pack | | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | |
| | | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | Service Pack | | Does Not Include Stem | 20016 | 58, 6.5 | |
| | Challenger, Charger | EZ-Sensor | | 33200 | 11.5, 1.3 | Service Pack | | W/Siemens Sensor | 20030 | 71, 8 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Nitro | | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 |
| EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | EZ-Sensor Service Pack | | | Rubber Valve | 20018 | 11.5, 1.3 | |
| Sensor | | - | 28291 | 58, 6.5 | EZ-Sensor Service Pack | | | Almnm. Valve | 34000 | 62, 7 | |
| Service Pack | | Does Not Include Stem | 20016 | 58, 6.5 | Sensor | | - | 20066 | 58, 6.5 | | |
| Service Pack | | Includes Stem Only | 20020 | 58, 6.5 | Sensor | | - | 28308 | 11.5, 1.3 | | |
| Dakota | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | Service Pack | | Does Not Include Stem | 20013 | 58, 6.5 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | | Includes Stem Only | 20020 | 58, 6.5 | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Ram Series Pickup | | EZ-Sensor | 1500, 2500. Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | |
| | Sensor | - | 28154 | 58, 6.5 | | | EZ-Sensor Service Pack | 1500, 2500; Rubber Valve | 20018 | 11.5, 1.3 | |
| | Sensor | - | 28461 | 11.5, 1.3 | | | EZ-Sensor Service Pack | 1500, 2500; Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | Does Not Include Stem | 20013 | 58, 6.5 | | Sensor | 1500, 2500 | 28155 | 58, 6.5 | | |
| | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | | | | | | |

* Programming Tool Required ** Magnet Required to Activate Sensor

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | | |
|------------------------------------|---------------------------|--|---|-------------------------------|---------------------------|---|---|---|---|---|-----------|-----------|
| 2009 (cont.) | | | | | 2008 (cont.) | | | | | | | |
| Ram Series Pickup (cont.) | Sensor | 1500, 2500 | 28434 | 11.5, 1.3 | Charger (cont.) | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | | | |
| | Service Pack | 1500, 2500; Does Not Include Stem | 20013 | 58, 6.5 | | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | | | |
| | Service Pack | 1500, 2500; Includes Stem Only | 20020 | 58, 6.5 | | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | | | |
| Sprinter | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | Dakota | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | | |
| | Sensor | - | 20089 | 53, 6 | | Sensor | - | 28154 | 58, 6.5 | | | |
| | Service Pack | Includes Valve | 20036 | 53, 6 | | Sensor | - | 28461 | 11.5, 1.3 | | | |
| Viper | EZ-Sensor | When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000 | 33100 | 11.5, 1.3 | Service Pack | Does Not Include Stem | 20013 | 58, 6.5 | | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | | | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Durango | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | | | |
| | Sensor | - | 20028** | 35, 4 | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | | |
| | Service Pack | - | 20003 | 35, 4 | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | | | |
| 2008 | | | | | 2008 | | | | | | | |
| Dodge (cont.) | Avenger, Caliber | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | Dodge (cont.) | Grand Caravan, Magnum | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | EZ-Sensor Service Pack | | | Almm. Valve | 34000 | 62, 7 | | |
| | Sensor | - | 20066 | 58, 6.5 | Sensor | | | - | 28155 | 58, 6.5 | | |
| | Sensor | - | 28308 | 11.5, 1.3 | Sensor | | | - | 28434 | 11.5, 1.3 | | |
| | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | Service Pack | | | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | | |
| | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | Service Pack | | | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | | |
| | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | Service Pack | | | W/Siemens Sensor | 20030 | 71, 8 | | |
| | Chal- lenger | EZ-Sensor | | 33200 | 11.5, 1.3 | | | Nitro | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | EZ-Sensor Service Pack | Almm. Valve | 34000 | | 62, 7 | | | |
| Sensor | | W/433 MHz sensor. | 28155 | 58, 6.5 | Sensor | - | 20066 | | 58, 6.5 | | | |
| Sensor | | W/433 MHz sensor. | 28434 | 11.5, 1.3 | Sensor | - | 28308 | | 11.5, 1.3 | | | |
| Sensor | | - | 28291 | 58, 6.5 | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | | 58, 6.5 | | | |
| Service Pack | | Does Not Include Stem | 20016 | 58, 6.5 | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | | 58, 6.5 | | | |
| Service Pack | | Includes Stem Only | 20020 | 58, 6.5 | Service Pack | W/Siemens Sensor | 20030 | | 71, 8 | | | |
| Charger | | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | 11.5, 1.3 | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | | 33000* | 11.5, 1.3 | | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | Rubber Valve | | 20018 | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | | | |
| | Sensor | - | 28155 | 58, 6.5 | Sensor | - | 20066 | 58, 6.5 | | | | |
| | Sensor | - | 28434 | 11.5, 1.3 | Sensor | - | 28308 | 11.5, 1.3 | | | | |

* Programming Tool Required ** Magnet Required to Activate Sensor

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|--|------------------------|--|---|-------------------------------|---------------------|---|---|--|-------------------------------|-----------|
| 2008 (cont.) | | | | | 2007 (cont.) | | | | | |
| Dodge (cont.) | Ram Series Pickup | EZ-Sensor | 1500, 2500. Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | Stratus | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | 1500, 2500; Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | 1500, 2500; Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | | Sensor | 1500, 2500 | 28154 | 58, 6.5 | | Sensor | - | 20066 | 58, 6.5 |
| | | Sensor | 1500, 2500 | 28461 | 11.5, 1.3 | | Service Pack | Does Not Include Stem | 20013 | 58, 6.5 |
| | | Service Pack | 1500, 2500; Does Not Include Stem | 20013 | 58, 6.5 | | Service Pack | Includes Stem Only | 20020 | 58, 6.5 |
| | | Service Pack | 1500, 2500; Includes Stem Only | 20020 | 58, 6.5 | 2006 | | | | |
| | Sprinter | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | Caravan, Charger, Grand Caravan, Magnum | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| Sensor | | - | 20089 | 53, 6 | Sensor | | - | 20066 | 58, 6.5 | |
| Sensor | | - | 20028** | 35, 4 | Sensor | | - | 28308 | 11.5, 1.3 | |
| Service Pack | | Includes Valve | 20036 | 53, 6 | Service Pack | | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | |
| Viper | EZ-Sensor | When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000 | 33100 | 11.5, 1.3 | Service Pack | | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Service Pack | | W/Siemens Sensor | 20030 | 71, 8 | |
| | Sensor | - | 20028** | 35, 4 | Viper | | EZ-Sensor | When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000 | 33100 | 11.5, 1.3 |
| | Service Pack | - | 20003 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | 2007 | | | | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| Caliber, Caravan, Charger, Durango, Grand Caravan, Magnum, Nitro | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | | Sensor | - | 20028** | 35, 4 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | - | 20003 | 35, 4 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | 2005 | | | | |
| | Sensor | - | 20066 | 58, 6.5 | Caravan | Sensor | - | 20335 | 71, 8 | |
| | Sensor | - | 28308 | 11.5, 1.3 | | Service Pack | - | 20030 | 71, 8 | |
| | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | Charger | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | |
| | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | Sprinter | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | | 11.5, 1.3 | Sensor | - | 20066 | 58, 6.5 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | | 11.5, 1.3 | Sensor | - | 28308 | 11.5, 1.3 |
| EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | |
| Sensor | | - | 20089 | 53, 6 | | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | |
| Service Pack | | Includes Valve | 20036 | 53, 6 | | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | |
| Service Pack | | Includes Valve | 20036 | 53, 6 | Grand Caravan | Sensor | - | 20335 | 71, 8 | |
| | | | | | | Service Pack | - | 20030 | 71, 8 | |
| | | | | | Magnum | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | |
| | | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |

* Programming Tool Required ** Magnet Required to Activate Sensor

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|---|---|---|--|-------------------------------|--|----------------------|---------------------------|---------------------------|-------------------------------|-------|
| 2005 (cont.) | | | | | 2009-2006 | | | | | |
| Magnum (cont.) | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | 612 Scaglietti, F430 | Sensor | Includes Transmitter Only | 20077 | 35, 4 | |
| | Sensor | - | 20066 | 58, 6.5 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| | Sensor | - | 28308 | 11.5, 1.3 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | |
| | Viper | EZ-Sensor | When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000 | 33100 | 11.5, 1.3 | 2005 | | | | |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | 575M Maranello, 612 Scaglietti, F430 | Sensor | Includes Transmitter Only | 20077 | 35, 4 | |
| EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| Sensor | | - | 20028** | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| Service Pack | | - | 20003 | 35, 4 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| 2004 | | | | | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| Caravan, Grand Caravan | | Sensor | - | 20335 | 71, 8 | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | |
| | Service Pack | - | 20030 | 71, 8 | 2004 | | | | | |
| Intrepid | EZ-Sensor | | 33100 | 11.5, 1.3 | 575M Maranello, 612 Scaglietti | Sensor | Includes Transmitter Only | 20077 | 35, 4 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| | Sensor | - | 20028** | 35, 4 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| | Service Pack | - | 20003 | 35, 4 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| | Viper | EZ-Sensor | When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000 | 33100 | 11.5, 1.3 | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | 2004 | | | | | |
| EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | Enzo | Sensor | Includes Transmitter Only | 20084 | 35, 4 | |
| Sensor | | - | 20028** | 35, 4 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| Service Pack | | - | 20003 | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| 2003 | | | | | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| Caravan, Grand Caravan, Intrepid, Viper | EZ-Sensor | | 33100 | 11.5, 1.3 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | 2003 | | | | | |
| | Sensor | - | 20028** | 35, 4 | 575M Maranello | Sensor | Includes Transmitter Only | 20077 | 35, 4 | |
| | Service Pack | - | 20003 | 35, 4 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| 2002 | | | | | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| Caravan, Grand Caravan, Intrepid | EZ-Sensor | | 33100 | 11.5, 1.3 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | |
| | Sensor | - | 20028** | 35, 4 | 2002 | | | | | |
| | Service Pack | - | 20003 | 35, 4 | 550 Maranello, 575 Maranello | Sensor | Includes Transmitter Only | 20077 | 35, 4 | |
| 2003 | | | | | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| Caravan, Grand Caravan, Intrepid | EZ-Sensor | | 33100 | 11.5, 1.3 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| Viper | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| | Sensor | - | 20028** | 35, 4 | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | |
| | Service Pack | - | 20003 | 35, 4 | 2002 | | | | | |
| | 2002 | | | | | 550 Maranello | Sensor | Includes Transmitter Only | 20077 | 35, 4 |
| | Caravan, Grand Caravan, Intrepid | EZ-Sensor | | 33100 | 11.5, 1.3 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | | W/43mm Silver Insert | 20037 | 35, 4 | |
| Viper | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Service Pack | | W/48mm Green Insert | 20038 | 35, 4 | |
| | Sensor | - | 20028** | 35, 4 | Service Pack | | W/49mm Black Insert | 20039 | 35, 4 | |
| | Service Pack | - | 20003 | 35, 4 | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | |

** Magnet Required to Activate Sensor

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | |
|---|------------------------------------|------------------------|---|-------------------------------|------------------------|---|--------------------------|---|---|-----------|-----------|
| 2014-2013 | | | | | 2013 | | | | | | |
| Fiat | 500, 500 Arbarth, 500c, 500e, 500L | EZ-Sensor | | 33200 | 11.5, 1.3 | C-MAX, E Series Van, E350 Super Duty, Edge, Escape, Expedition, Explorer, F Series Pickup, Fiesta, Flex, Focus, Fusion, Mustang | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | | Sensor | - | 20398 | 11.5, 1.3 | | Sensor | - | 20315 | 11.5, 1.3 | |
| | | Service Pack | - | 20018 | 11.5, 1.3 | | Service Pack | - | 20018 | 11.5, 1.3 | |
| | 2012-2011 | | | | | | | | | | |
| | 500, 500L | EZ-Sensor | | 33200 | 11.5, 1.3 | | Police Interceptor Sedan | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | Sensor | - | 20398 | 11.5, 1.3 | | | EZ-Sensor | MUST use Aluminum stem kit 34000 before sensor installation | 33000* | 11.5, 1.3 |
| Service Pack | | - | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | Rubber Valve | | 20018 | 11.5, 1.3 | | |
| 2014 | | | | | | | | | | | |
| C-MAX, E Series Van | Sensor | - | 20315 | 11.5, 1.3 | Shelby GT500 | EZ-Sensor | | MUST use Aluminum stem kit 34000 before sensor installation | 33000* | 11.5, 1.3 | |
| | Service Pack | - | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| Edge, Escape, Expedition, Explorer, F Series Pickup, Fiesta, Flex | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | | - | | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | | | | |
| | Sensor | - | 20315 | 11.5, 1.3 | | Super Duty Pickup | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Service Pack | - | 20018 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Focus | Sensor | - | 20315 | | | 13, 1.5 | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| Service Pack | | - | 20018 | 11.5, 1.3 | | | Sensor | - | 20315 | 11.5, 1.3 | |
| Fusion, Mustang | EZ-Sensor | - | 33000* | 11.5, 1.3 | | | Service Pack | - | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Super Duty Van | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | |
| | Sensor | - | 20315 | 11.5, 1.3 | Taurus | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | Service Pack | - | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | Shelby GT500 | EZ-Sensor | MUST use Aluminum stem kit 34000 before sensor installation | 33000* | | 11.5, 1.3 | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 20315 | 11.5, 1.3 | | |
| EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20018 | 11.5, 1.3 | | |
| Sensor | | - | | | Transit Connect | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| Service Pack | | - | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| Super Duty Pickup | Sensor | - | 20315 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | |
| | Service Pack | - | 20018 | 11.5, 1.3 | | Sensor | - | 20315 | 11.5, 1.3 | | |
| Taurus | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Service Pack | - | 20018 | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Transit | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | Sensor | - | 20315 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | |
| | Service Pack | - | 20018 | 11.5, 1.3 | | Sensor | - | 20315 | 11.5, 1.3 | | |
| Service Pack | - | 20018 | 11.5, 1.3 | Service Pack | | - | 20018 | 11.5, 1.3 | | | |
| Transit Connect | Sensor | - | 20315 | 11.5, 1.3 | Transit | Sensor | - | 20315 | 11.5, 1.3 | | |
| | Service Pack | - | 20018 | 11.5, 1.3 | | Service Pack | - | 20018 | 11.5, 1.3 | | |
| | Service Pack | - | 20018 | 11.5, 1.3 | | Service Pack | - | 20018 | 11.5, 1.3 | | |

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|--|-----------------------------|---------------------------|---|-------------------------------|--|-------------------------------|---------------------------|--------------|-------------------------------|-----------|
| 2012 | | | | | 2011 (cont.) | | | | | |
| C-MAX, E Series Van, E350 Super Duty, Edge, Escape, Expedition, Explorer, F Series Pickup, Fiesta, Flex, Focus, Fusion, Mustang | EZ-Sensor | - | 33000* | 11.5, 1.3 | Fiesta, Flex, Focus, Fusion | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 20315 | 11.5, 1.3 | | Sensor | - | 20315 | 11.5, 1.3 | |
| | Service Pack | - | 20018 | 11.5, 1.3 | | Service Pack | - | 20018 | 11.5, 1.3 | |
| | Shelby GT500 | EZ-Sensor | MUST use Aluminum stem kit 34000 before sensor installation | 33000* | 11.5, 1.3 | Grand Marquis | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | Sensor | - | | | | Sensor | - | 28385 | 27, 3 |
| | | Service Pack | - | | | | Sensor Clip | - | 22100 | - |
| Super Duty Pickup, Taurus, Transit Connect | EZ-Sensor | - | 33000* | 11.5, 1.3 | Mustang | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 20315 | 11.5, 1.3 | | Sensor | - | 20315 | 11.5, 1.3 | |
| | Service Pack | - | 20018 | 11.5, 1.3 | | Service Pack | - | 20018 | 11.5, 1.3 | |
| 2011 | | | | | Ranger | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| Crown Victoria | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 28385 | 27, 3 | |
| | Sensor | - | 28385 | 27, 3 | | Sensor Clip | - | 22100 | - | |
| | Sensor Clip | - | 22100 | - | Sensor Cradle | - | 22101 | - | | |
| | Sensor Cradle | - | 22101 | - | Sensor Universal Band | - | 22102 | - | | |
| | Sensor Universal Band | - | 22102 | - | Super Duty Pickup, Super Duty Van | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| E Series Van, E350 Super Duty, Edge | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 20315 | 11.5, 1.3 | |
| | Sensor | - | 20315 | 11.5, 1.3 | | Taurus, Transit Connect | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Service Pack | - | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | |
| Escape, Expedition, Explorer, F Series Pickup | EZ-Sensor | - | 33000* | 11.5, 1.3 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Sensor | | - | 20315 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Service Pack | - | 20018 | 11.5, 1.3 | | |
| | Sensor | - | 20315 | 11.5, 1.3 | 2010 | | | | | |
| | Service Pack | - | 20018 | 11.5, 1.3 | Crown Victoria | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| Crown Victoria | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 28385 | 27, 3 | |
| | Sensor | - | 28385 | 27, 3 | | Sensor Clip | - | 22100 | - | |
| | Sensor Clip | - | 22100 | - | | | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|------------------------|-------------------------------|------------------------|------------------------------|-------------------------------|---------------------------------------|------------------------|------------------------|--------------|-------------------------------|-----------|
| 2010 (cont.) | | | | | 2010 (cont.) | | | | | |
| Crown Victoria (cont.) | Sensor Cradle | - | 22101 | - | Explorer, Explorer Sport Trac (cont.) | Sensor | - | 28385 | 27, 3 | |
| | Sensor Universal Band | - | 22102 | - | | Sensor Clip | - | 22100 | - | |
| | E Series Van | EZ-Sensor | W/Alloy Wheels | 33000* | | 11.5, 1.3 | Sensor Cradle | - | 22101 | - |
| | | EZ-Sensor Service Pack | W/Alloy Wheels; Rubber Valve | 20018 | | 11.5, 1.3 | Sensor Universal Band | - | 22102 | - |
| | | EZ-Sensor Service Pack | W/Alloy Wheels; Almm. Valve | 34000 | 62, 7 | F Series Pickup | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Sensor | W/Steel Wheels | 20315 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | Sensor | W/Alloy Wheels | 28395 | 27, 3 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | | Sensor Clip | W/Alloy Wheels | 22100 | - | | Sensor | - | 20315 | 11.5, 1.3 |
| | Sensor Cradle | W/Alloy Wheels | 22101 | - | Service Pack | - | 20018 | 11.5, 1.3 | | |
| | Sensor Universal Band | W/Alloy Wheels | 22102 | - | F450 Super Duty, F550 Super Duty | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| Service Pack | W/Steel Wheels | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | | |
| E350 Super Duty | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 28395 | 27, 3 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Sensor Clip | - | 22100 | - | | |
| Sensor | - | 20315 | 11.5, 1.3 | Sensor Cradle | - | 22101 | - | | | |
| Service Pack | - | 20018 | 11.5, 1.3 | Sensor Universal Band | - | 22102 | - | | | |
| Edge | EZ-Sensor | - | 33000* | 11.5, 1.3 | Flex | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 28390 | 27, 3 | | Sensor | - | 28390 | 27, 3 | |
| | Sensor Clip | - | 22100 | - | | Sensor Clip | - | 22100 | - | |
| | Sensor Cradle | - | 22101 | - | | Sensor Cradle | - | 22101 | - | |
| | Sensor Universal Band | - | 22102 | - | | Sensor Universal Band | - | 22102 | - | |
| | Escape | EZ-Sensor | - | 33000* | | 11.5, 1.3 | Focus, Fusion | EZ-Sensor | - | 33000* |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 |
| Sensor | | - | 20315 | 11.5, 1.3 | Sensor | - | | 20315 | 13, 1.5 | |
| Service Pack | | - | 20018 | 11.5, 1.3 | Service Pack | - | 20018 | 11.5, 1.3 | | |
| Expedition | EZ-Sensor | - | 33000* | 11.5, 1.3 | Grand Marquis | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 28390 | 27, 3 | | Sensor | - | 28385 | 27, 3 | |
| | Sensor Clip | - | 22100 | - | Sensor Clip | - | 22100 | - | | |
| | Sensor Cradle | - | 22101 | - | Sensor Cradle | - | 22101 | - | | |
| | Sensor Universal Band | - | 22102 | - | Sensor Universal Band | - | 22102 | - | | |
| | Explorer, Explorer Sport Trac | EZ-Sensor | - | 33000* | 11.5, 1.3 | | | | | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | | | |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | | | | |

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|--------------------------|------------------------|------------------------------|--------|-------------------------------|--------------------------------------|------------------------|--------------|-----------|-------------------------------|
| 2010 (cont.) | | | | | 2010 (cont.) | | | | |
| Mustang | EZ-Sensor | - | 33000* | 11.5, 1.3 | Transit Connect | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 20315 | 11.5, 1.3 | | Sensor | - | 20315 | 11.5, 1.3 |
| | Service Pack | - | 20018 | 11.5, 1.3 | | Service Pack | - | 20018 | 11.5, 1.3 |
| Ranger | EZ-Sensor | - | 33000* | 11.5, 1.3 | 2009 | | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Crown Victoria | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Sensor | - | 28385 | 27, 3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor Clip | - | 22100 | - | | Sensor | - | 28385 | 27, 3 |
| | Sensor Cradle | - | 22101 | - | | Sensor Clip | - | 22100 | - |
| | Sensor Universal Band | - | 22102 | - | | Sensor Cradle | - | 22101 | - |
| | | | | Sensor Universal Band | | - | 22102 | - | |
| | | | | | | | | | |
| Super Duty Pickup | EZ-Sensor | - | 33000* | 11.5, 1.3 | E Series Van, E350 Super Duty | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 28395 | 27, 3 | | Sensor | - | 28395 | 27, 3 |
| | Sensor Clip | - | 22100 | - | | Sensor Clip | - | 22100 | - |
| | Sensor Cradle | - | 22101 | - | | Sensor Cradle | - | 22101 | - |
| | Sensor Universal Band | - | 22102 | - | | Sensor Universal Band | - | 22102 | - |
| | | | | | | | | | |
| Super Duty Van | EZ-Sensor | W/Alloy Wheels | 33000* | 11.5, 1.3 | Edge | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | W/Alloy Wheels; Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | W/Alloy Wheels; Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | W/Steel Wheels | 20315 | 11.5, 1.3 | | Sensor | - | 28390 | 27, 3 |
| | Sensor | W/Alloy Wheels | 28395 | 27, 3 | | Sensor Clip | - | 22100 | - |
| | Sensor Clip | W/Alloy Wheels | 22100 | - | | Sensor Cradle | - | 22101 | - |
| | Sensor Cradle | W/Alloy Wheels | 22101 | - | | Sensor Universal Band | - | 22102 | - |
| | Sensor Universal Band | W/Alloy Wheels | 22102 | - | | | | | |
| | Service Pack | W/Steel Wheels | 20018 | 11.5, 1.3 | Escape | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | | | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| | | | | Sensor | | - | 20315 | 11.5, 1.3 | |
| Taurus | EZ-Sensor | Apr. & Older | 33000* | 11.5, 1.3 | Service Pack | - | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Apr. & Older; Rubber Valve | 20018 | 11.5, 1.3 | Expedition | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Apr. & Older; Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Sensor | May & Newer | 20315 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | Apr. & Older | 28390 | 27, 3 | | Sensor | - | 28390 | 27, 3 |
| | Sensor Clip | Apr. & Older | 22100 | - | | Sensor Clip | - | 22100 | - |
| | Sensor Cradle | Apr. & Older | 22101 | - | | Sensor Cradle | - | 22101 | - |
| | Sensor Universal Band | Apr. & Older | 22102 | - | | Sensor Universal Band | - | 22102 | - |
| | Service Pack | May & Newer | 20018 | 11.5, 1.3 | | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | |
|---|--------------------------------------|------------------------|--------------|-------------------------------|--|--|---------------------------------|------------------------|-------------------------------|-----------|-----------|
| 2009 (cont.) | | | | | 2009 (cont.) | | | | | | |
| Ford (cont.) | Explorer, Explorer Sport Trac | EZ-Sensor | - | 33000* | 11.5, 1.3 | Super Duty Pickup, Super Duty Van (cont.) | Sensor Cradle | - | 22101 | - | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor Universal Band | - | 22102 | - | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Taurus, Taurus X | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Sensor | - | 28385 | 27, 3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | Sensor Clip | - | 22100 | - | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | Sensor Cradle | - | 22101 | - | | | Sensor | - | 28390 | 27, 3 |
| | | Sensor Universal Band | - | 22102 | - | | | Sensor Clip | - | 22100 | - |
| | Sensor | - | 20315 | 11.5, 1.3 | Sensor Cradle | - | | 22101 | - | | |
| | Sensor Universal Band | - | 20018 | 11.5, 1.3 | Sensor Universal Band | - | 22102 | - | | | |
| | F Series Pickup | EZ-Sensor | - | 33000* | 11.5, 1.3 | 2008 | | | | | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Crown Victoria | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | | Sensor | - | 20315 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | | Service Pack | - | 20018 | 11.5, 1.3 | | Sensor | - | 28385 | 27, 3 | |
| | | F450 Super Duty | EZ-Sensor | - | 33000* | | 11.5, 1.3 | Sensor Clip | - | 22100 | - |
| | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor Cradle | - | 22101 | - | |
| | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | | Sensor Universal Band | - | 22102 | - | |
| | Sensor | | - | 28395 | 27, 3 | E Series Van, E350 Super Duty | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Sensor Clip | | - | 22100 | - | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Sensor Cradle | | - | 22101 | - | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor Universal Band | - | 22102 | - | Sensor | | - | 28395 | 27, 3 | | |
| | Flex, Focus | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sensor Clip | - | 22100 | - | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor Cradle | - | 22101 | - | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor Universal Band | - | 22102 | - | |
| | | Sensor | - | 28390 | 27, 3 | Edge | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | | Sensor Clip | - | 22100 | - | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | | Sensor Cradle | - | 22101 | - | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor Universal Band | - | 22102 | - | Sensor | | W/Chrome Plated Almnm. Wheels | 28385 | 27, 3 | | |
| Fusion, Grand Marquis, Mustang, Ranger | EZ-Sensor | - | 33000* | 11.5, 1.3 | Sensor | | W/O Chrome Plated Almnm. Wheels | 28390 | 27, 3 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Sensor Clip | | - | 22100 | - | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sensor Cradle | | - | 22101 | - | | |
| | Sensor | - | 28385 | 27, 3 | Sensor Universal Band | - | 22102 | - | | | |
| | Sensor Clip | - | 22100 | - | Super Duty Pickup, Super Duty Van | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | Sensor Cradle | - | 22101 | - | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| Sensor Universal Band | - | 22102 | - | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | | | |
| Sensor | - | 28395 | 27, 3 | Sensor | | - | 28395 | 27, 3 | | | |
| Sensor Clip | - | 22100 | - | Sensor Clip | | - | 22100 | - | | | |

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|---------------------|-------------------------------|------------------------|-----------------------|-------------------------------|---------------------|--|------------------------|--------------|-------------------------------|-----------|
| 2008 (cont.) | | | | | 2008 (cont.) | | | | | |
| Ford (cont.) | Escape | EZ-Sensor | - | 33000* | 11.5, 1.3 | Focus | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | Sensor | - | 28385 | 27, 3 | | Sensor | - | 28390 | 27, 3 |
| | | Sensor Clip | - | 22100 | - | | Sensor Clip | - | 22100 | - |
| | | Sensor Cradle | - | 22101 | - | | Sensor Cradle | - | 22101 | - |
| | | Sensor Universal Band | - | 22102 | - | | Sensor Universal Band | - | 22102 | - |
| | Expedition | EZ-Sensor | - | 33000* | 11.5, 1.3 | Fusion, Grand Marquis, Mustang, Ranger | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | Sensor | - | 28390 | 27, 3 | | Sensor | - | 28385 | 27, 3 |
| | | Sensor Clip | - | 22100 | - | | Sensor Clip | - | 22100 | - |
| | | Sensor Cradle | - | 22101 | - | | Sensor Cradle | - | 22101 | - |
| | | Sensor Universal Band | - | 22102 | - | | Sensor Universal Band | - | 22102 | - |
| | Explorer, Explorer Sport Trac | EZ-Sensor | - | 33000* | 11.5, 1.3 | Super Duty Pickup, Super Duty Van | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | Sensor | - | 28385 | 27, 3 | | Sensor | - | 28395 | 27, 3 |
| | | Sensor Clip | - | 22100 | - | | Sensor Clip | - | 22100 | - |
| | | Sensor Cradle | - | 22101 | - | | Sensor Cradle | - | 22101 | - |
| | | Sensor Universal Band | - | 22102 | - | | Sensor Universal Band | - | 22102 | - |
| | F Series Pickup | EZ-Sensor | - | 33000* | 11.5, 1.3 | Taurus | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | Sensor | W/O H.D. Payload Pkg. | 28385 | 27, 3 | | Sensor | - | 28390 | 27, 3 |
| | | Sensor | W/H.D. Payload Pkg. | 28395 | 27, 3 | | Sensor Clip | - | 22100 | - |
| | | Sensor Clip | - | 22100 | - | | Sensor Cradle | - | 22101 | - |
| | | Sensor Cradle | - | 22101 | - | | Sensor Universal Band | - | 22102 | - |
| F450 Super Duty | EZ-Sensor | - | 33000* | 11.5, 1.3 | Taurus X | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 28395 | 27, 3 | | Sensor | - | 28390 | 27, 3 | |
| | Sensor Clip | - | 22100 | - | | Sensor Clip | - | 22100 | - | |
| | Sensor Cradle | - | 22101 | - | | Sensor Cradle | - | 22101 | - | |
| | Sensor Universal Band | - | 22102 | - | | Sensor Universal Band | - | 22102 | - | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|---------------------------------------|-----------------------------|-----------------------------------|--------|-------------------------------|---|-----------------------------|--------------|--------|-------------------------------|
| 2007 | | | | | 2007 (cont.) | | | | |
| Crown Victoria, E Series Van | EZ-Sensor | - | 33000* | 11.5, 1.3 | Explorer, Explorer Sport Trac, F Series Pickup | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | Sensor | - | 28385 | 27, 3 | | Sensor | - | 28385 | 27, 3 |
| | Sensor Clip | - | 22100 | - | | Sensor Clip | - | 22100 | - |
| | Sensor Cradle | - | 22101 | - | | Sensor Cradle | - | 22101 | - |
| | Sensor Universal Band | - | 22102 | - | | Sensor Universal Band | - | 22102 | - |
| E350 Super Duty | EZ-Sensor | - | 33000* | 11.5, 1.3 | Five Hundred | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | Sensor | - | 28395 | 27, 3 | | Sensor | - | 28390 | 27, 3 |
| | Sensor Clip | - | 22100 | - | | Sensor Clip | - | 22100 | - |
| | Sensor Cradle | - | 22101 | - | | Sensor Cradle | - | 22101 | - |
| | Sensor Universal Band | - | 22102 | - | | Sensor Universal Band | - | 22102 | - |
| Edge | EZ-Sensor | - | 33000* | 11.5, 1.3 | Focus, Freestar, Fusion, Grand Marquis, Mustang, Ranger | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | Sensor | W/Chrome Plated Almm. Wheels | 28385 | 27, 3 | | Sensor | - | 28385 | 27, 3 |
| | Sensor | W/O Chrome Plated Almm. Wheels | 28390 | 27, 3 | | Sensor Clip | - | 22100 | - |
| | Sensor Clip | - | 22100 | - | | Sensor Cradle | - | 22101 | - |
| | Sensor Cradle | - | 22101 | - | | Sensor Universal Band | - | 22102 | - |
| | Sensor Universal Band | - | 22102 | - | | 2006 | | | |
| Escape | EZ-Sensor | - | 33000* | 11.5, 1.3 | Crown Victoria, Escape | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | Sensor | - | 28385 | 27, 3 | | Sensor | - | 28385 | 27, 3 |
| | Sensor Clip | - | 22100 | - | | Sensor Clip | - | 22100 | - |
| | Sensor Cradle | - | 22101 | - | | Sensor Cradle | - | 22101 | - |
| | Sensor Universal Band | - | 22102 | - | | Sensor Universal Band | - | 22102 | - |
| | Expedition | EZ-Sensor | - | 33000* | 11.5, 1.3 | Expedition | Sensor | - | 20135** |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | | - | 20002 | 44, 5 |
| EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | Explorer, Explorer Sport Trac | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| Sensor | | - | 28390 | 27, 3 | | Sensor | - | 28385 | 27, 3 |
| Sensor Clip | | - | 22100 | - | | Sensor Clip | - | 22100 | - |
| Sensor Cradle | | - | 22101 | - | | Sensor Cradle | - | 22101 | - |
| Sensor Universal Band | - | 22102 | - | Sensor Universal Band | - | 22102 | - | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|-------------------------|------------------------|----------------------|---------|----------------------------|------------------------|------------------------|----------------------|-----------|----------------------------|
| 2006 (cont.) | | | | | 2003 | | | | |
| Five Hundred | EZ-Sensor | - | 33000* | 11.5, 1.3 | Expedition | EZ-Sensor | - | 33100 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 28390 | 27, 3 | | Sensor | - | 20096** | 44, 5 |
| | Sensor Clip | - | 22100 | - | | Service Pack | - | 20002 | 44, 5 |
| | Sensor Cradle | - | 22101 | - | | Explorer | EZ-Sensor | - | 33100 |
| | Sensor Universal Band | - | 22102 | - | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 |
| Freestar, Grand Marquis | EZ-Sensor | - | 33000* | 11.5, 1.3 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Sensor | Exc. Sport | 20096** | 44, 5 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Service Pack | Exc. Sport | 20002 | 44, 5 | |
| | Sensor | - | 28385 | 27, 3 | 2002 | | | | |
| | Sensor Clip | - | 22100 | - | Explorer | EZ-Sensor | - | 33100 | 11.5, 1.3 |
| | Sensor Cradle | - | 22101 | - | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Sensor Universal Band | - | 22102 | - | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| 2005 | | | | | | Sensor | Exc. Sport | 20096** | 44, 5 |
| Escape | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Service Pack | Exc. Sport | 20002 | 44, 5 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | 2008-2007 | | | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sprinter | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Sensor | Oct. 3, 2005 & Newer | 28385 | 27, 3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Sensor Clip | - | 22100 | - | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor Cradle | - | 22101 | - | | Sensor | - | 20089 | 53, 6 |
| | Sensor Universal Band | - | 22102 | - | | Service Pack | Includes Valve | 20036 | 53, 6 |
| Expedition | Sensor | - | 20135** | 44, 5 | 2014 | | | | |
| | Service Pack | - | 20002 | 44, 5 | Acadia | Sensor | - | 20153 | 11.5, 1.3 |
| Explorer | EZ-Sensor | - | 33100 | 11.5, 1.3 | | Service Pack | - | 20008 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Savana | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | |
| Sensor | - | 20096** | 44, 5 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| Service Pack | - | 20002 | 44, 5 | Sensor | | - | 20153 | 11.5, 1.3 | |
| Freestar | Sensor | W/Almnm. Valve Stem | 20135** | 44, 5 | | Service Pack | - | 20008 | 11.5, 1.3 |
| | Service Pack | W/Almnm. Valve Stem | 20002 | 44, 5 | Sierra Series Pickup | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| 2004 | | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| Expedition, Explorer | EZ-Sensor | - | 33100 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | W/Single Rear Wheels | 20153 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | W/Single Rear Wheels | 20008 | 11.5, 1.3 |
| | Sensor | - | 20096** | 44, 5 | Terrain, Yukon | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Service Pack | - | 20002 | 44, 5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| Freestar | Sensor | W/Almnm. Valve Stem | 20135** | 44, 5 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Service Pack | W/Almnm. Valve Stem | 20002 | 44, 5 | Sensor | - | 28206 | 11.5, 1.3 | |
| | | | | | Service Pack | | | | |

* Programming Tool Required ** Magnet Required to Activate Sensor

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|----------------------|------------------------|----------------------|-----------|-------------------------------|----------------------|------------------------|----------------------|-----------|-------------------------------|
| 2013 | | | | | 2012 (cont.) | | | | |
| Acadia, Savana | EZ-Sensor | - | 33000* | 11.5, 1.3 | Terrain | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 20153 | 11.5, 1.3 | | Sensor | - | 28206 | 11.5, 1.3 |
| | Service Pack | - | 20008 | 11.5, 1.3 | | Service Pack | - | 20008 | 11.5, 1.3 |
| Sierra Series Pickup | EZ-Sensor | - | 33000* | 11.5, 1.3 | Yukon | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | W/Single Rear Wheels | 20153 | 11.5, 1.3 | | Sensor | - | 20153 | 11.5, 1.3 |
| | Service Pack | W/Single Rear Wheels | 20008 | 11.5, 1.3 | | Service Pack | - | 20008 | 11.5, 1.3 |
| Terrain | EZ-Sensor | - | 33000* | 11.5, 1.3 | 2011-2010 | | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Acadia | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Sensor | - | 28206 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Service Pack | - | 20008 | 11.5, 1.3 | | Sensor | - | 20153 | 11.5, 1.3 |
| Service Pack | - | 20008 | 11.5, 1.3 | Service Pack | | - | 20008 | 11.5, 1.3 | |
| Yukon | EZ-Sensor | - | 33000* | 11.5, 1.3 | Canyon | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 20153 | 11.5, 1.3 | | Sensor | - | 20131 | 62, 7 |
| | Service Pack | - | 20008 | 11.5, 1.3 | | Service Pack | - | 20006 | 62, 7 |
| 2012 | | | | | Savana | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| Acadia | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 20153 | 11.5, 1.3 |
| | Sensor | - | 20153 | 11.5, 1.3 | | Service Pack | - | 20008 | 11.5, 1.3 |
| | Service Pack | - | 20008 | 11.5, 1.3 | Sierra Series Pickup | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| Canyon | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | W/Single Rear Wheels | 20153 | 11.5, 1.3 |
| | Sensor | - | 20131 | 62, 7 | | Service Pack | W/Single Rear Wheels | 20008 | 11.5, 1.3 |
| | Service Pack | - | 20006 | 62, 7 | Terrain | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| Savana | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 28206 | 11.5, 1.3 |
| | Sensor | - | 20153 | 11.5, 1.3 | | Service Pack | - | 20008 | 11.5, 1.3 |
| | Service Pack | - | 20008 | 11.5, 1.3 | Yukon | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| Sierra Series Pickup | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 20153 | 11.5, 1.3 |
| | Sensor | W/Single Rear Wheels | 20153 | 11.5, 1.3 | | Service Pack | - | 20008 | 11.5, 1.3 |
| | Service Pack | W/Single Rear Wheels | 20008 | 11.5, 1.3 | | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|------------------------|------------------------|------------------------|----------------------|----------------------------|----------------------|------------------------|------------------------|--------------|----------------------------|-----------|
| 2009 | | | | | 2008 (cont.) | | | | | |
| Acadia | EZ-Sensor | - | 33000* | 11.5, 1.3 | Canyon (cont.) | Sensor | - | 20131 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | - | 20006 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Envoy | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Sensor | - | 20153 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | - | 20008 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sensor | - | 20116 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | - | 20004 | 62, 7 | |
| | Canyon | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Savana | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Sensor | - | 20131 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | Service Pack | - | 20006 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| EZ-Sensor | | - | 33000* | 11.5, 1.3 | Sensor | | - | 20158 | 62, 7 | |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | | W/Schrader Sensor | 20004 | 62, 7 | |
| Envoy | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Service Pack | W/Siemens Sensor | 20030 | 80, 9 | | |
| | Sensor | - | 20116 | 62, 7 | Sierra Series Pickup | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Service Pack | - | 20004 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | W/Single Rear Wheels | 20153 | 11.5, 1.3 | |
| EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Service Pack | | W/Single Rear Wheels | 20008 | 11.5, 1.3 | | |
| Savana | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Yukon | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Sensor | - | 20158 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | W/Schrader Sensor | 20004 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | W/Siemens Sensor | 20030 | 80, 9 | | Sensor | - | 20153 | 11.5, 1.3 | |
| | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Service Pack | - | 20008 | 11.5, 1.3 | |
| | Sierra Series Pickup | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | 2007 | | | | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Acadia | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Sensor | W/Single Rear Wheels | 20153 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | Service Pack | W/Single Rear Wheels | 20008 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sensor | - | 20158 | 62, 7 |
| EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | W/Schrader Sensor | | 20004 | 62, 7 | | |
| Yukon | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Service Pack | W/Siemens Sensor | 20030 | 80, 9 | | |
| | Sensor | - | 20153 | 11.5, 1.3 | Canyon | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Service Pack | - | 20008 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 20131 | 62, 7 | |
| EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Service Pack | | - | 20006 | 62, 7 | | |
| 2008 | | | | | Envoy | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| Acadia | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 20116 | 62, 7 | |
| | Sensor | - | 20158 | 62, 7 | | Service Pack | - | 20004 | 62, 7 | |
| | Service Pack | W/Schrader Sensor | 20004 | 62, 7 | Canyon | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Service Pack | W/Siemens Sensor | 20030 | 80, 9 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| EZ-Sensor | - | 33000* | 11.5, 1.3 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | | |
| EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Sensor | | - | 20116 | 62, 7 | | |
| EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Service Pack | | - | 20004 | 62, 7 | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | |
|-----------------------------|-----------------------------|--|--------------|-------------------------------|-----------------------------|------------------------|--------------|--------------------|-------------------------------|-----------|-------|
| 2007 (cont.) | | | | | 2004 | | | | | | |
| Sierra Series Pickup | EZ-Sensor | - | 33000* | 11.5, 1.3 | Sierra Series Pickup, Yukon | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | |
| | Sensor | Classic | 20107 | 62, 7 | | Sensor | - | 20115 | 62, 7 | | |
| | Sensor | Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem; Exc. Classic | 20153 | 11.5, 1.3 | | Service Pack | - | 20004 | 62, 7 | | |
| | Sensor | Clamp-In Style Only; TRW Sensor; W/Almm. Valve Stem; Exc. Classic | 20158 | 62, 7 | 2014 | | | | | | |
| | Service Pack | Classic | 20004 | 62, 7 | Civic, CR-Z | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | Service Pack | Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem; Exc. Classic | 20008 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | Service Pack | Clamp-In Style Only; TRW Sensor; W/Almm. Valve Stem; Exc. Classic | 20015 | 80, 9 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | |
| | Yukon | EZ-Sensor | - | 33000* | | 11.5, 1.3 | Sensor | - | 28720 | 35, 4 | |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | - | 20019 | 35, 4 | | |
| EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | Crosstour | Sensor | - | 20100 | 71, 8 | | |
| Sensor | | Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem | 20153 | 11.5, 1.3 | | Service Pack | - | 20032 | 35, 4 | | |
| Sensor | | Clamp-In Style Only; TRW Sensor; W/Almm. Valve Stem | 20158 | 62, 7 | Insight | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| Service Pack | | Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem | 20008 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| Service Pack | | Clamp-In Style Only; TRW Sensor; W/Almm. Valve Stem | 20015 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | |
| GMC (cont.) | Envoy | 2006 | | | Honda | Odyssey | Sensor | - | 28720 | 35, 4 | |
| | | EZ-Sensor | - | 33000* | | | 11.5, 1.3 | Service Pack | - | 20019 | 35, 4 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | | | 11.5, 1.3 | Sensor | - | 28720 | 35, 4 |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | | | 62, 7 | Service Pack | - | 20019 | 35, 4 |
| | | Sensor | - | 20116 | | 62, 7 | Pilot | Sensor | W/Alloy Wheels | 20098 | 35, 4 |
| | | Service Pack | - | 20004 | | 62, 7 | | Service Pack | W/Alloy Wheels | 20032 | 35, 4 |
| | Sierra Series Pickup, Yukon | EZ-Sensor | - | 33000* | 11.5, 1.3 | Ridgeline | Sensor | - | 28981 | 35, 4 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | RT; Includes Valve | 20036 | 35, 4 | |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | 2013 | | | | | |
| | | Sensor | - | 20107 | 62, 7 | Civic | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| Service Pack | - | 20004 | 62, 7 | EZ-Sensor Service Pack | Rubber Valve | | 20018 | 11.5, 1.3 | | | |
| Sierra Series Pickup, Yukon | 2005 | | | CR-V | EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | | |
| | EZ-Sensor | - | 33000* | | 11.5, 1.3 | | Sensor | - | 28720 | 35, 4 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | | 11.5, 1.3 | Service Pack | - | 20019 | 35, 4 | | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | | 62, 7 | CR-Z | Sensor | - | 20100 | 35, 4 | |
| | Sensor | - | 20107 | | 62, 7 | | Service Pack | - | 20032 | 35, 4 | |
| Service Pack | - | 20004 | 62, 7 | CR-Z | EZ-Sensor | - | 33000* | 11.5, 1.3 | | | |
| Sierra Series Pickup, Yukon | EZ-Sensor | - | 33000* | | 11.5, 1.3 | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | | 11.5, 1.3 | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Sensor | - | 28720 | 35, 4 | | | |
| | Sensor | - | 20107 | 62, 7 | Service Pack | - | 20019 | 35, 4 | | | |
| | Service Pack | - | 20004 | 62, 7 | Crosstour | Sensor | - | 20100 | 71, 8 | | |
| Sierra Series Pickup, Yukon | 2005 | | | Fit, Insight, Odyssey | | Service Pack | - | 20032 | 35, 4 | | |
| | EZ-Sensor | - | 33000* | | 11.5, 1.3 | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | | 11.5, 1.3 | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | | 62, 7 | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | |
| | Sensor | - | 20107 | | 62, 7 | Sensor | - | 28720 | 35, 4 | | |
| Service Pack | - | 20004 | 62, 7 | Service Pack | - | 20019 | 35, 4 | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|------------------------------|------------------------|--------------------|--------|-------------------------------|---------------------|-------------------------------|----------------|---------------|-------------------------------|-------|
| 2010 (cont.) | | | | | 2009 (cont.) | | | | | |
| Element, Fit, Insight | EZ-Sensor | - | 33000* | 11.5, 1.3 | S2000 | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 28720 | 35, 4 | | Service Pack | - | 20032 | 35, 4 | |
| | Service Pack | - | 20019 | 35, 4 | 2008 | | | | | |
| Odyssey | Sensor | - | 28983 | 31-40, 3.5-4.5 | Accord | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| Pilot | Sensor | Exc. LX | 20098 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | Exc. LX | 20032 | 35, 4 | | Sensor | - | 20099 | 35, 4 | |
| Ridgeline | Sensor | RT | 28981 | 35, 4 | Service Pack | - | 20032 | 35, 4 | | |
| | Sensor | Exc. RT | 28981 | 35, 4 | Civic | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Service Pack | RT; Includes Valve | 20036 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| 2009 | | | | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| Accord | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sensor | - | 28720 | 35, 4 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | - | 20019 | 35, 4 | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | CR-V | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Sensor | - | 20099 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | - | 20032 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| Service Pack | - | 20032 | 35, 4 | Sensor | | - | 20099 | 35, 4 | | |
| Civic | EZ-Sensor | - | 33000* | 11.5, 1.3 | Service Pack | - | 20032 | 35, 4 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | Includes Valve | 20036 | 35, 4 | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Element Fit | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Sensor | - | 28720 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | - | 20019 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| Service Pack | - | 20019 | 35, 4 | Sensor | | - | 20099 | 35, 4 | | |
| CR-V | EZ-Sensor | - | 33000* | 11.5, 1.3 | Service Pack | - | 20032 | 35, 4 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Pilot | Sensor | - | 28981 | 35, 4 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | Includes Valve | 20036 | 35, 4 | |
| | Sensor | - | 20099 | 35, 4 | | Ridgeline | Sensor | RTL, RTS, RTX | 28981 | 35, 4 |
| | Service Pack | - | 20032 | 35, 4 | | | Sensor | RT | 28982 | 35, 4 |
| Service Pack | - | 20032 | 35, 4 | Service Pack | RT; Includes Valve | | 20035 | 35, 4 | | |
| Element, Fit | EZ-Sensor | - | 33000* | 11.5, 1.3 | Service Pack | RTL, RTS, RTX; Includes Valve | 20036 | 35, 4 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | S2000 | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Sensor | - | 28720 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | - | 20019 | 35, 4 | | Service Pack | - | 20032 | 35, 4 | |
| Odyssey | Sensor | - | 28983 | 31-40, 3.5-4.5 | 2007 | | | | | |
| | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | CR-V | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| Pilot | Sensor | W/Alloy Wheels | 20098 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | W/Alloy Wheels | 20032 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| Ridgeline | Sensor | - | 28981 | 35, 4 | | Sensor | - | 20099 | 35, 4 | |
| | Service Pack | Includes Valve | 20036 | 35, 4 | Service Pack | - | 20032 | 35, 4 | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | |
|---------------------|------------------------|--|-------------------------|----------------------------|------------------------|---------------------------|------------------------|----------------|----------------------------|-----------|-----------|
| 2007 (cont.) | | | | | 2008 (cont.) | | | | | | |
| Honda (cont.) | Element | Service Pack | Includes Valve | 20036 | 35, 4 | Hummer (cont.) | H3, H3T | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Odyssey | Sensor | Touring | 28981 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | | Service Pack | Touring; Includes Valve | 20036 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Pilot | Sensor | - | 28981 | 35, 4 | | Sensor | - | 20131 | 62, 7 | |
| | | Service Pack | Includes Valve | 20036 | 35, 4 | | Service Pack | - | 20006 | 62, 7 | |
| | Ridgeline | Sensor | RTL, RTS, RTX | 28981 | 35, 4 | 2007-2006 | | | | | |
| | | Sensor | RT | 28982 | 35, 4 | H3, H3T | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | | Service Pack | RT; Includes Valve | 20035 | 35, 4 | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | 2006 | | | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Hummer | |
| | Odyssey | Sensor | Touring | 28981 | 35, 4 | Sensor | - | 20131 | 62, 7 | | |
| | | Service Pack | Touring; Includes Valve | 20036 | 35, 4 | Service Pack | - | 20006 | 62, 7 | | |
| | Pilot | Sensor | - | 28981 | 35, 4 | 2014 | | | | | |
| Service Pack | | Includes Valve | 20036 | 35, 4 | Accent | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| Ridgeline | Sensor | RTL, RTS | 28981 | 35, 4 | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Equus | | |
| | Sensor | RT | 28982 | 35, 4 | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | |
| | Service Pack | RT; Includes Valve | 20035 | 35, 4 | Sensor | - | 20092 | 31-40, 3.5-4.5 | | | |
| | Service Pack | RTL, RTS; Includes Valve | 20036 | 35, 4 | Service Pack | - | 20022 | 31-40, 3.5-4.5 | | | |
| 2005 | | | | | Santa Fe | Sensor | - | 28849 | 31-40, 3.5-4.5 | | |
| Odyssey | Sensor | Touring | 28981 | 35, 4 | Sensor | - | | | Hyundai | | |
| | Service Pack | Touring; Includes Valve | 20036 | 35, 4 | Service Pack | - | 20022 | 31-40, 3.5-4.5 | | | |
| Pilot | Sensor | EX | 28981 | 35, 4 | Service Pack | - | | | | | |
| | Sensor | LX; W/Short Stem Valve | 28981 | 35, 4 | Sonata | Sensor | - | 20092 | 31-40, 3.5-4.5 | | |
| | Sensor | LX; W/Long Stem Valve | 28982 | 35, 4 | Tucson | Sensor | - | | | | |
| | Service Pack | LX; W/Long Stem Valve; Includes Valve | 20035 | 35, 4 | | Service Pack | - | | | | |
| | Service Pack | EX; Includes Valve | 20036 | 35, 4 | 2013 | | | | | | |
| | Service Pack | LX; W/Short Stem Valve; Includes Valve | 20036 | 35, 4 | Accent | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| 2010-2009 | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Hummer | | |
| H2 | EZ-Sensor | - | 33000* | 11.5, 1.3 | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Sensor | - | 20131 | 62, 7 | | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Service Pack | - | 20006 | 62, 7 | | | |
| | Sensor | - | 20153 | 11.5, 1.3 | 2008 | | | | | | |
| | Service Pack | - | 20018 | 11.5, 1.3 | H2 | EZ-Sensor | - | 33000* | | 11.5, 1.3 | |
| H3, H3T | EZ-Sensor | - | 33000* | 11.5, 1.3 | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sensor | - | 20153 | 11.5, 1.3 | | | |
| | Sensor | - | 20131 | 62, 7 | Service Pack | - | 20018 | 11.5, 1.3 | | | |
| | Service Pack | - | 20006 | 62, 7 | 2008 | | | | | | |
| 2008 | | | | | Azera | EZ-Sensor | - | 33000* | | 11.5, 1.3 | |
| H2 | EZ-Sensor | - | 33000* | 11.5, 1.3 | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 | | | |
| | Sensor | - | 20153 | 11.5, 1.3 | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | | | |
| | Service Pack | - | 20018 | 11.5, 1.3 | | | | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|------------------------|------------------------|---------------------------|--------------------|-------------------------------|------------------------|------------------------|---------------------------|-------------------|-------------------------------|-------------------|
| 2013 (cont.) | | | | | 2012 (cont.) | | | | | |
| Hyundai (cont.) | Elantra | Sensor | W/Transmitter Only | 20086 | 31-40, 3.5-4.5 | Equus | Sensor | - | 28849 | 31-40, 3.5-4.5 |
| | | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | | Service Pack | - | 20022 | 31-40, 3.5-4.5 |
| | Equus | Sensor | - | 28849 | 31-40, 3.5-4.5 | Genesis | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Service Pack | - | 20022 | 31-40, 3.5-4.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Santa Fe | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | Coupe | 20092 | 31-40, 3.5-4.5 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sensor | Sedan | 28849 | 31-40, 3.5-4.5 | |
| | | Sensor | - | 28849 | 31-40, 3.5-4.5 | Service Pack | Sedan | 20022 | 31-40, 3.5-4.5 | |
| | Sonata | Service Pack | - | 20022 | 31-40, 3.5-4.5 | Santa Fe | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sonata | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Sensor | - | 20092 | 31-40, 3.5-4.5 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Tucson | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 20092 | 31-40, 3.5-4.5 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Tucson | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Sensor | - | 28849 | 31-40, 3.5-4.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Service Pack | - | 20022 | 31-40, 3.5-4.5 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 28849 | 31-40, 3.5-4.5 | Sensor | | - | 28849 | 31-40, 3.5-4.5 | |
| | Veloster | Sensor | - | 28505 | 11.5, 1.3 | Service Pack | - | 20022 | 31-40, 3.5-4.5 | |
| Service Pack | | - | 20018 | 11.5, 1.3 | Veloster | Sensor | - | 28505 | 11.5, 1.3 | |
| 2012 | | | | | | Service Pack | - | 20018 | 11.5, 1.3 | |
| Accent | EZ-Sensor | - | 33000* | 11.5, 1.3 | Veracruz | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 20092 | 31-40, 3.5-4.5 | | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 | |
| Azera, Elantra | EZ-Sensor | - | 33000* | 11.5, 1.3 | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | 2011 | | | | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Accent | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sensor | | - | 28849 | 31-40, 3.5-4.5 | | |
| Elantra Touring | EZ-Sensor | - | 33000* | 11.5, 1.3 | Service Pack | - | 20022 | 31-40, 3.5-4.5 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | | | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | | | | |
| | Sensor | W/Transmitter Only | 20092 | 31-40, 3.5-4.5 | | | | | | |

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|------------------------|------------------------|---------------------------|-------------------|-------------------------------|--------------------------------|------------------------|---------------------------|-------------------|-------------------------------|
| 2011 (cont.) | | | | | 2010 | | | | |
| Azera, Elantra | EZ-Sensor | - | 33000* | 11.5, 1.3 | Accent | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 | | Sensor | - | 28849 | 31-40, 3.5-4.5 |
| | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | | Service Pack | - | 20022 | 31-40, 3.5-4.5 |
| Elantra Touring | EZ-Sensor | - | 33000* | 11.5, 1.3 | Azera, Elantra | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | Sensor | Includes Transmitter Only | 20092 | 31-40, 3.5-4.5 | | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 |
| Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | Service Pack | | Includes Valve | 20036 | 31-40, 3.5-4.5 | |
| Equus | Sensor | - | 28849 | 31-40, 3.5-4.5 | Elantra Touring, Genesis | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Service Pack | - | 20022 | 31-40, 3.5-4.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| Genesis | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | Includes Transmitter Only | 20092 | 31-40, 3.5-4.5 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 |
| | Sensor | Coupe | 20092 | 31-40, 3.5-4.5 | Santa Fe | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Sensor | Sedan | 28849 | 31-40, 3.5-4.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| Service Pack | Sedan | 20022 | 31-40, 3.5-4.5 | EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | |
| Santa Fe | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Sonata, Tucson | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Sonata | EZ-Sensor | - | 33000* | | 11.5, 1.3 | EZ-Sensor Service Pack | Rubber Valve | 20018 |
| EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | |
| EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Sensor | | - | 28849 | 31-40, 3.5-4.5 | |
| Sensor | - | 20092 | 31-40, 3.5-4.5 | Service Pack | | - | 20022 | 31-40, 3.5-4.5 | |
| Tucson | EZ-Sensor | - | 33000* | 11.5, 1.3 | Veracruz | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | Sensor | - | 28849 | 31-40, 3.5-4.5 | | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 |
| | Service Pack | - | 20022 | 31-40, 3.5-4.5 | | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 |
| Veracruz | EZ-Sensor | - | 33000* | 11.5, 1.3 | 2009 | | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Accent | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | | Sensor | - | 28849 | 31-40, 3.5-4.5 |
| | | | | Service Pack | | - | 20022 | 31-40, 3.5-4.5 | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|------------------------|------------------------|---------------------------|---------------------------|-------------------------------|----------------------------|------------------------|---------------------------|---------------------------|-------------------------------|----------------|
| 2009 (cont.) | | | | | 2008 (cont.) | | | | | |
| Hyundai (cont.) | Azera, Elantra | EZ-Sensor | - | 33000* | 11.5, 1.3 | Azera, Elantra | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 | | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 |
| | | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 |
| | Entourage | Sensor | Includes Transmitter Only | 20085 | 31-40, 3.5-4.5 | Entourage | Sensor | Includes Transmitter Only | 20085 | 31-40, 3.5-4.5 |
| | | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 |
| | Genesis | Service Pack | - | 20022 | 31-40, 3.5-4.5 | Santa Fe | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Santa Fe | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | Includes Transmitter Only | 20085 | 31-40, 3.5-4.5 |
| | | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 | | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 |
| | | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | Sonata | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Sonata | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 28983 | 31-40, 3.5-4.5 |
| | | Sensor | - | 28849 | 31-40, 3.5-4.5 | | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 |
| | | Service Pack | - | 20022 | 31-40, 3.5-4.5 | Tiburon, Tucson | Sensor | - | 28983 | 31-40, 3.5-4.5 |
| | Tucson | Sensor | - | 28983 | 31-40, 3.5-4.5 | | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 |
| | | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | Veracruz | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| Veracruz | EZ-Sensor | | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sensor | | Includes Transmitter Only | 20085 | 31-40, 3.5-4.5 | |
| | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 | Service Pack | | Includes Valve | 20036 | 31-40, 3.5-4.5 | |
| | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | 2007 | | | | | |
| 2008 | | | | | Azera, Elantra | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| Accent | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 | |
| | Sensor | - | 28849 | 31-40, 3.5-4.5 | | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | |
| | Service Pack | - | 20022 | 31-40, 3.5-4.5 | Entourage, Santa Fe | Sensor | Includes Transmitter Only | 20085 | 31-40, 3.5-4.5 | |
| | | | | Service Pack | | Includes Valve | 20036 | 31-40, 3.5-4.5 | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | |
|----------------------------------|-------------------------|------------------------|---------------------------|-------------------------------|------------------------|----------------------------|----------------------------|------------------------|-------------------------------|-----------|-----------|
| 2007 (cont.) | | | | | 2012 | | | | | | |
| Hyundai (cont.) | Sonata, Tiburon, Tucson | Sensor | - | 28983 | 31-40, 3.5-4.5 | EX35, FX35, FX50, G25, G37 | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Veracruz | Sensor | Includes Transmitter Only | 20085 | 31-40, 3.5-4.5 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | | Sensor | - | | 66, 7.5 . | |
| 2006 | | | | | 2011 | | | | | | |
| Hyundai (cont.) | Azera | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 | M35, M35H, M37, M56 | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Tucson | Sensor | - | 28983 | 31-40, 3.5-4.5 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | | Sensor | - | 28204 | 66, 7.5 . | |
| 2014 | | | | | 2010 | | | | | | |
| Q50, Q60, QX50, QX60, QX70, QX80 | Sensor | - | | | EX35, FX35, FX37 | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | Service Pack | - | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| 2013 | | | | | | 2010 | | | | | |
| Infiniti | EX35, FX35, FX37 | EZ-Sensor | - | 33000* | | 11.5, 1.3 | EX35, FX35, FX50, G25, G37 | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| | | Sensor | - | | 66, 7.5 . | Sensor | | - | | 66, 7.5 . | |
| | | Service Pack | - | | 66, 7.5 . | Service Pack | | - | | 66, 7.5 . | |
| | FX50 | Sensor | - | | 66, 7.5 . | M35, M37, M56 | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | | Service Pack | - | | 66, 7.5 . | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | G37 | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 28204 | 66, 7.5 . | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20014 | 66, 7.5 . | |
| | | Sensor | - | | 66, 7.5 . | QX56 | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | | Service Pack | - | | 66, 7.5 . | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| Q50, Q60 | Sensor | - | | | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | | |
| | Service Pack | - | | | Sensor | | - | | 66, 7.5 . | | |
| QX50 | Sensor | - | | | Service Pack | | - | | 66, 7.5 . | | |
| | Service Pack | - | | | 2010 | | | | | | |
| QX56 | EZ-Sensor | - | 33000* | 11.5, 1.3 | EX35, FX35, FX50, G37 | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | |
| | Sensor | - | | | | Sensor | - | 28210 | 66, 7.5 . | | |
| | Service Pack | - | | | | Service Pack | - | 20014 | 66, 7.5 . | | |
| QX60, QX70, QX80 | Sensor | - | | | M35, M45, QX56 | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | Service Pack | - | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|--------------------------------|------------------------|------------------------|--------------|-------------------------------|---------------|------------------------|------------------------|--------------|-------------------------------|-------------------|
| 2010 (cont.) | | | | | 2007 | | | | | |
| M35, M45, QX56 | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | FX35, FX45 | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Sensor | - | 28204 | 66, 7.5 . | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | - | 20014 | 66, 7.5 . | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| 2009 | | | | | | Sensor | Jun. & Older | 20064 | 66, 7.5 . | |
| EX35, FX35, FX50, G37 | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sensor | Jul. & Newer | 28204 | 66, 7.5 . | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | Jun. & Older | 20007 | 66, 7.5 . | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | Jul. & Newer | 20014 | 66, 7.5 . | |
| | Sensor | - | 28210 | 66, 7.5 . | | G35 | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Service Pack | - | 20014 | 66, 7.5 . | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| M35, M45, QX56 | EZ-Sensor | - | 33000* | 11.5, 1.3 | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Sensor | | Coupe | 28204 | 66, 7.5 . | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sensor | | Sedan | 28210 | 66, 7.5 . | |
| | Sensor | - | 28204 | 66, 7.5 . | Service Pack | - | 20014 | 66, 7.5 . | | |
| | Service Pack | - | 20014 | 66, 7.5 . | M35, M45 | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| 2008 | | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| EX35 | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 20064 | 66, 7.5 . | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20007 | 66, 7.5 . | |
| | Sensor | - | 28210 | 66, 7.5 . | QX56 | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Service Pack | - | 20014 | 66, 7.5 . | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| FX35, FX45 | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | Mar. & Older | 20161 | 49, 5.5 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | Apr. 1 & Newer | 28204 | 49, 5.5 | |
| | Sensor | - | 28204 | 66, 7.5 . | Service Pack | Mar. & Older | 20007 | 49, 5.5 | | |
| | Service Pack | - | 20014 | 66, 7.5 . | Service Pack | Apr. 1 & Newer | 20014 | 49, 5.5 | | |
| G35, G37 | EZ-Sensor | - | 33000* | 11.5, 1.3 | 2006 | | | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | FX35, FX45 | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Sensor | - | 28210 | 66, 7.5 . | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | - | 20014 | 66, 7.5 . | | Sensor | - | 20064 | 66, 7.5 . | |
| | Service Pack | - | 20007 | 66, 7.5 . | | Service Pack | - | 20007 | 66, 7.5 . | |
| | M35, M45 | EZ-Sensor | - | 33000* | 11.5, 1.3 | G35 | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | Sensor | - | 28204 | 66, 7.5 . | | Sensor | - | 20064 | 61-72, 6.8-8.2 |
| Service Pack | | - | 20014 | 66, 7.5 . | Service Pack | | - | 20007 | 61-72, 6.8-8.2 | |
| QX56 | EZ-Sensor | - | 33000* | 11.5, 1.3 | M35, M45 | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 28204 | 49, 5.5 | | Sensor | - | 20064 | 66, 7.5 . | |
| | Service Pack | - | 20014 | 49, 5.5 | | Service Pack | - | 20007 | 66, 7.5 . | |

* Programming Tool Required



On the winding road of TPMS

Bartec is always **AHEAD** of the curve!



**First
Wireless
TPMS
Service
Tool**



**First
OBDII
TPMS
Service
Tool**



**First
Wireless
Front
Counter
Tool**



**First
"At-the-car"
Sensor
Programming**



**First TPMS Tool
to feature Inductive
Charging**



**First OBDII Relearn
Solution for Mitsubishi
Vehicles**

IT'S SO EZ.



EZ-sensor[®]

- Fully programmable TPMS sensor • Produced to OE standards • Snap-in & clamp-in service packs
- New WAL sensor technology • Programs wirelessly • 2 part numbers cover 90% of the market

 **SCHRADER[®]**

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|---------------------|------------------------|----------------|---------|-------------------------------|--------------------------|------------------------|--------------|-------------------|-------------------------------|
| 2006 (cont.) | | | | | 2004 (cont.) | | | | |
| Q45 | EZ-Sensor | - | 33000* | 11.5, 1.3 | FX35, FX45 (cont.) | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 20064 | 66, 7.5 . |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20007 | 66, 7.5 . |
| | Sensor | Jul. & Older | 20064 | 66, 7.5 . | G35 | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Sensor | Aug. & Newer | 28204 | 66, 7.5 . | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Service Pack | Jul. & Older | 20007 | 66, 7.5 . | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Service Pack | Aug. & Newer | 20014 | 66, 7.5 . | | Sensor | - | 20064 | 61-72, 6.8-8.2 |
| QX56 | EZ-Sensor | - | 33000* | 11.5, 1.3 | Service Pack | - | 20007 | 61-72, 6.8-8.2 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | M45, Q45 | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Sensor | W/Steel Wheels | 20069 | 49, 5.5 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | W/Alloy Wheels | 20161 | 49, 5.5 | | Sensor | - | 20064 | 66, 7.5 . |
| | Service Pack | W/Steel Wheels | 20005 | 49, 5.5 | Service Pack | - | 20007 | 66, 7.5 . | |
| | Service Pack | W/Alloy Wheels | 20007 | 49, 5.5 | QX56 | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| 2005 | | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| FX35, FX45 | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 20069 | 49, 5.5 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20005 | 49, 5.5 |
| | Sensor | - | 20064 | 66, 7.5 . | 2003 | | | | |
| | Service Pack | - | 20007 | 66, 7.5 . | FX35, FX45 | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| G35 | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 20064 | 66, 7.5 . |
| | Sensor | - | 20064 | 61-72, 6.8-8.2 | | Service Pack | - | 20007 | 66, 7.5 . |
| | Service Pack | - | 20007 | 61-72, 6.8-8.2 | G35 | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| Q45 | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | Jun. & Newer | 20064 | 61-72, 6.8-8.2 |
| | Sensor | - | 20064 | 66, 7.5 . | | Service Pack | Jun. & Newer | 20007 | 61-72, 6.8-8.2 |
| | Service Pack | - | 20007 | 66, 7.5 . | M45, Q45, QX4 | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| QX56 | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 20064 | 66, 7.5 . |
| | Sensor | W/Steel Wheels | 20069 | 49, 5.5 | | Service Pack | - | 20007 | 66, 7.5 . |
| | Sensor | W/Alloy Wheels | 20161 | 49, 5.5 | 2009 | | | | |
| Service Pack | W/Steel Wheels | 20005 | 49, 5.5 | I-290, I-370 | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| Service Pack | W/Alloy Wheels | 20007 | 49, 5.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| 2004 | | | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| FX35, FX45 | EZ-Sensor | - | 33000* | | 11.5, 1.3 | Sensor | - | 20131 | 62, 7 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | | 11.5, 1.3 | Service Pack | - | 20006 | 62, 7 |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|---|--|------------------|------------------|-------------------------------|--|---------------------------|---|--------------|-------------------------------|-----------|
| 2008-2007 | | | | | 2007 | | | | | |
| Ascender | Sensor | - | 20116 | 62, 7 | Super V8, Vanden Plas, XJ8, XJR, XK, XKR | Sensor | W/315 MHz Sensor | 20090 | 71, 8 | |
| | Service Pack | - | 20004 | 62, 7 | | Sensor | W/433 MHz Sensor | 20091 | 71, 8 | |
| I-290, I-370 | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Service Pack | - | 20030 | 71, 8 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | 2006-2005 | | | | | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Super V8, Vanden Plas, XJ8, XJR | Sensor | W/315 MHz Sensor | 20090 | 71, 8 | |
| | Sensor | - | 20131 | 62, 7 | | Sensor | W/433 MHz Sensor | 20091 | 71, 8 | |
| | Service Pack | - | 20006 | 62, 7 | | Service Pack | - | 20030 | 71, 8 | |
| | 2006 | | | | | 2004 | | | | |
| Ascender | Sensor | - | 20116 | 62, 7 | Vanden Plas, XJ8, XJR | Sensor | W/315 MHz Sensor | 20090 | 71, 8 | |
| | Service Pack | - | 20004 | 62, 7 | | Sensor | W/433 MHz Sensor | 20091 | 71, 8 | |
| Rodeo | 2004 | | | | | Service Pack | - | 20030 | 71, 8 | |
| | EZ-Sensor | - | 33100 | 11.5, 1.3 | 2014 | | | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Cherokee | Sensor | - | 28984 | N/A | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | Service Pack | - | | | |
| | Sensor | - | 20028** | 62, 7 | Compass | Sensor | - | 28308 | 11.5, 1.3 | |
| | Service Pack | - | 20003 | 62, 7 | | Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| 2014 | | | | | Grand Cherokee | EZ-Sensor | | 33200 | 11.5, 1.3 | |
| XJ | Sensor | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | - | | | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| 2013 | | | | | | Sensor | - | 20398 | 11.5, 1.3 | |
| XF, XJ, XK | Sensor | | | | | Service Pack | - | 20018 | 11.5, 1.3 | |
| | Service Pack | - | | | | Patriot | Sensor | W/315 MHz | 28308 | 11.5, 1.3 |
| 2012 | | | | | Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | |
| XF, XJ, XK | Sensor | W/315 MHz Sensor | 20090 | 71, 8 | Wrangler | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33200 | 11.5, 1.3 | |
| | Sensor | W/433 MHz Sensor | 20091 | 71, 8 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | - | 20030 | 71, 8 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| 2011 | | | | | | Sensor | - | 20398 | 11.5, 1.3 | |
| XF, XFR, XJ, XK, XKR | Sensor | W/315 MHz Sensor | 20090 | 71, 8 | | Service Pack | - | 20018 | 11.5, 1.3 | |
| | Sensor | W/433 MHz Sensor | 20091 | 71, 8 | | 2013 | | | | |
| | Service Pack | - | 20030 | 71, 8 | Compass | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | |
| 2010 | | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| XF, XFR, XJ, XK, XKR | Sensor | W/315 MHz Sensor | 20090 | 71, 8 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | Sensor | W/433 MHz Sensor | 20091 | 71, 8 | | Sensor | - | 28308 | 11.5, 1.3 | |
| | Service Pack | - | 20030 | 71, 8 | | Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| XKR | 2009 | | | | | Grand Cherokee | EZ-Sensor | | 33200 | 11.5, 1.3 |
| | Super V8, Vanden Plas, XF, XJ8, XJR, XK, XKR | Sensor | W/315 MHz Sensor | 20090 | 71, 8 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Sensor | W/433 MHz Sensor | 20091 | 71, 8 | EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | |
| Service Pack | - | 20030 | 71, 8 | Sensor | - | | 20398 | 11.5, 1.3 | | |
| 2008 | | | | | Service Pack | | - | 20018 | 11.5, 1.3 | |
| S-Type, Super V-8, Vanden Plas, X-Type, XJ8, XJR, XK, XKR | Sensor | W/315 MHz Sensor | 20090 | 71, 8 | Patriot | | Sensor | W/315 MHz | 28308 | 11.5, 1.3 |
| | Sensor | W/433 MHz Sensor | 20091 | 71, 8 | | Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | - | 20030 | 71, 8 | | 2013 | | | | |

* Programming Tool Required ** Magnet Required to Activate Sensor

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | |
|------------------------|------------------------|---|---|-------------------------------|---------------------------------------|--|---|---|---|-----------|-----------|
| 2013 (cont.) | | | | | 2011 | | | | | | |
| Wrangler | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33200 | 11.5, 1.3 | Com-mander | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | |
| | Sensor | - | 20398 | 11.5, 1.3 | | Sensor | - | 28155 | 58, 6.5 | | |
| | Service Pack | - | 20018 | 11.5, 1.3 | | Sensor | - | 28434 | 11.5, 1.3 | | |
| 2012 | | | | | | Service Pack | Does Not Include Stem | 20013 | 58, 6.5 | | |
| Compass | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | | Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | Compass | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | |
| | Sensor | - | 28308 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | | |
| Grand Cherokee | EZ-Sensor | | 33200 | 11.5, 1.3 | Sensor | | - | 20066 | 58, 6.5 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Sensor | | - | 28308 | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Service Pack | | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | | |
| | Sensor | - | 20398 | 11.5, 1.3 | Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | Service Pack | - | 20018 | 11.5, 1.3 | Service Pack | | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | | |
| Liberty | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | Grand Cherokee | | EZ-Sensor | | 33200 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | |
| | Sensor | - | 20066 | 58, 6.5 | | Sensor | - | 20398 | 11.5, 1.3 | | |
| | Sensor | - | 28308 | 11.5, 1.3 | | Service Pack | - | 20018 | 11.5, 1.3 | | |
| | Service Pack | Does Not Include Stem | 20013 | 58, 6.5 | | Liberty | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | |
| | Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | Patriot | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | | | 11.5, 1.3 | Sensor | - | 20066 | 58, 6.5 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | | | 11.5, 1.3 | Sensor | - | 28308 | 11.5, 1.3 |
| EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | Service Pack | | Does Not Include Stem | 20013 | 58, 6.5 | | |
| Sensor | | - | 20066 | 58, 6.5 | Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | | |
| Service Pack | | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | Service Pack | | Includes Stem Only | 20020 | 58, 6.5 | | |
| Wrangler (cont.) | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | Patriot, Wrangler | | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | |
| | Sensor | - | 20066 | 58, 6.5 | | Sensor | - | 20066 | 58, 6.5 | | |
| | Sensor | - | 28308 | 11.5, 1.3 | | Sensor | - | 28308 | 11.5, 1.3 | | |
| | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | | Service Pack | Does Not Include Stem | 20013 | 58, 6.5 | | |
| | Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | |
| | Wrangler (cont.) | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | | 11.5, 1.3 | Patriot, Wrangler | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | EZ-Sensor Service Pack | Almm. Valve | | 34000 | 62, 7 | | |
| Sensor | | - | 20066 | 58, 6.5 | Sensor | - | | 20066 | 58, 6.5 | | |
| Service Pack | | - | 20018 | 11.5, 1.3 | Service Pack | W/Schrader Sensor; Does Not Include Stem | | 20013 | 58, 6.5 | | |
| Service Pack | - | 20018 | 11.5, 1.3 | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|-------------------|------------------------|---|--------|-------------------------------|---------------------|------------------------|---|-----------|-------------------------------|
| 2010 | | | | | 2010 (cont.) | | | | |
| Com- mander | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | 11.5, 1.3 | Patriot (cont.) | Sensor | - | 28308 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 |
| | Sensor | - | 28155 | 58, 6.5 | | Service Pack | W/Siemens Sensor | 20030 | 71, 8 |
| | Sensor | - | 28434 | 11.5, 1.3 | Wrangler | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | 11.5, 1.3 |
| | Service Pack | Does Not Include Stem | 20013 | 58, 6.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | Sensor | - | 28155 | 58, 6.5 |
| Compass | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | | Sensor | - | 28434 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | Does Not Include Stem | 20013 | 58, 6.5 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | Service Pack | Includes Stem Only | 20020 | 58, 6.5 |
| | Sensor | - | 20066 | 58, 6.5 | | 2009 | | | |
| | Sensor | - | 28308 | 11.5, 1.3 | Com- mander | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | 11.5, 1.3 |
| | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | | Sensor | - | 28155 | 58, 6.5 |
| Service Pack | W/Siemens Sensor | 20030 | 71, 8 | Sensor | | - | 28434 | 11.5, 1.3 | |
| Grand Cherokee | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | 11.5, 1.3 | | Service Pack | Does Not Include Stem | 20013 | 58, 6.5 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | Service Pack | Includes Stem Only | 20020 | 58, 6.5 |
| | Sensor | - | 28155 | 58, 6.5 | Compass | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 |
| | Sensor | - | 28434 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Service Pack | Does Not Include Stem | 20013 | 58, 6.5 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 20066 | 58, 6.5 |
| | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | Sensor | - | 28308 | 11.5, 1.3 |
| Liberty | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 |
| | Sensor | - | 20066 | 58, 6.5 | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | |
| | Sensor | - | 28308 | 11.5, 1.3 | Grand Cherokee | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | 11.5, 1.3 |
| | Service Pack | Does Not Include Stem | 20013 | 58, 6.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | Sensor | - | 28155 | 58, 6.5 |
| Patriot | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | | Sensor | - | 28434 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | Does Not Include Stem | 20013 | 58, 6.5 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Sensor | - | 20066 | 58, 6.5 | | Service Pack | Includes Stem Only | 20020 | 58, 6.5 |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | |
|------------------------|------------------------|---|---|----------------------------|----------------------------|--|---|---|---|-----------|-----------|
| 2009 (cont.) | | | | | 2008 (cont.) | | | | | | |
| Liberty | EZ-Sensor | W/315 MHz Sensor. Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | Compass | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | | |
| | EZ-Sensor | W/433 MHz Sensor. Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | Sensor | - | 20066 | 58, 6.5 | | |
| | Sensor | W/315 MHz Sensor | 20066 | 58, 6.5 | | Sensor | - | 28308 | 11.5, 1.3 | | |
| | Sensor | W/315 MHz Sensor | 28155 | 58, 6.5 | | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | | |
| | Sensor | W/315 MHz Sensor | 28308 | 11.5, 1.3 | | Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | Sensor | W/315 MHz Sensor | 28434 | 11.5, 1.3 | | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | | |
| | Service Pack | Does Not Include Stem | 20013 | 58, 6.5 | | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | | |
| | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | Grand Cherokee | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | 11.5, 1.3 | |
| Patriot | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Sensor | | - | 28155 | 58, 6.5 | | |
| | Sensor | - | 20066 | 58, 6.5 | Sensor | | - | 28434 | 11.5, 1.3 | | |
| | Sensor | - | 28308 | 11.5, 1.3 | Service Pack | | Does Not Include Stem | 20013 | 58, 6.5 | | |
| | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | Service Pack | | Includes Stem Only | 20020 | 58, 6.5 | | |
| | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | Liberty, Patriot, Wrangler | | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | |
| | Wrangler | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | | | 11.5, 1.3 | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | | 11.5, 1.3 | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | | Sensor | - | 20066 | 58, 6.5 | | |
| Sensor | | - | 28155 | 58, 6.5 | | Sensor | - | 28308 | 11.5, 1.3 | | |
| Sensor | | - | 28434 | 11.5, 1.3 | | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | | |
| Service Pack | | Does Not Include Stem | 20013 | 58, 6.5 | | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | | |
| Service Pack | | Includes Stem Only | 20020 | 58, 6.5 | | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | | |
| 2008 | | | | | | 2007 | | | | | |
| Com- mander | | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | | 11.5, 1.3 | Com- mander, Compass, Grand Cherokee, Liberty, Patriot, Wrangler | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | EZ-Sensor Service Pack | Almm. Valve | | 34000 | 62, 7 | | |
| | Sensor | - | 28155 | 58, 6.5 | Sensor | - | | 20066 | 58, 6.5 | | |
| | Sensor | - | 28434 | 11.5, 1.3 | Sensor | - | | 28308 | 11.5, 1.3 | | |
| | Service Pack | Does Not Include Stem | 20013 | 58, 6.5 | Service Pack | W/Schrader Sensor; Does Not Include Stem | | 20013 | 58, 6.5 | | |
| | Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | Rubber Valve | | 20018 | 11.5, 1.3 | | |
| | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | Service Pack | W/Schrader Sensor; Includes Stem Only | | 20020 | 58, 6.5 | | |
| | | | | | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|-------------------------|-------------------------------------|---|---|-------------------------------|------------------------|------------------------|------------------------|---------------------------|-------------------------------|----------------|
| 2006 | | | | | 2014 (cont.) | | | | | |
| Jeep (cont.) | Com-mander, Grand Cherokee, Liberty | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | Sedona | Sensor | Includes Transmitter Only | | |
| | | Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | Includes Valve | | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Sorento | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | Sensor | - | 20066 | 58, 6.5 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | Sensor | - | 28308 | 11.5, 1.3 | | Sensor | - | | |
| | | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | 2013 | | | | |
| | | Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Forte, Optima | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| Service Pack | W/Siemens Sensor | 20030 | 71, 8 | EZ-Sensor Service Pack | Almnm. Valve | | 34000 | 62, 7 | | |
| | | | | Sensor | - | | 20092 | 31-40, 3.5-4.5 | | |
| 2005 | | | | | Kia (cont.) | Rio | Sensor | - | 20086 | 31-40, 3.5-4.5 |
| Grand Cherokee, Liberty | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | | | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sedona | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Sensor | - | 20066 | 58, 6.5 | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 28308 | 11.5, 1.3 | | | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 |
| | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | |
| | Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sorento | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| 2004 | | | | | Soul | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| Grand Cherokee, Liberty | EZ-Sensor | | 33100 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 20092 | 31-40, 3.5-4.5 | |
| | Sensor | - | 20028** | 64, 7 | | Sportage | Sensor | - | 28849 | 31-40, 3.5-4.5 |
| | Service Pack | - | 20003 | 64, 7 | Service Pack | | - | 20022 | 31-40, 3.5-4.5 | |
| 2003-2002 | | | | | 2012 | | | | | |
| Grand Cherokee, Liberty | EZ-Sensor | | 33100 | 11.5, 1.3 | Forte, Optima | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 20028** | 64, 7 | | Sensor | - | 20092 | 31-40, 3.5-4.5 | |
| | Service Pack | - | 20003 | 64, 7 | Rio | Sensor | - | 20086 | 31-40, 3.5-4.5 | |
| 2014 | | | | | | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | |
| Kia | Cadenza | EZ-Sensor | - | 33000* | 11.5, 1.3 | | | | | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | | | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | | | |
| | | Sensor | - | 20092 | 31-40, 3.5-4.5 | | | | | |
| | | Service Pack | - | | | | | | | |
| | Forte | Sensor | - | | | | | | | |
| | Service Pack | - | | | | | | | | |

* Programming Tool Required ** Magnet Required to Activate Sensor

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|---------------------|------------------------|---------------------------|--------|-------------------------------|------------------------|------------------------|---------------------------|---------------------------|-------------------------------|
| 2012 (cont.) | | | | | 2011 (cont.) | | | | |
| Sedona | EZ-Sensor | - | 33000* | 11.5, 1.3 | Sorento, Soul | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 | | Sensor | - | 20092 | 31-40, 3.5-4.5 |
| | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | | Sportage | EZ-Sensor | - | 33000* |
| Sorento, Soul | EZ-Sensor | - | 33000* | 11.5, 1.3 | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sensor | - | 28849 | 31-40, 3.5-4.5 | |
| | Sensor | - | 20092 | 31-40, 3.5-4.5 | Service Pack | - | 20022 | 31-40, 3.5-4.5 | |
| Sportage | EZ-Sensor | - | 33000* | 11.5, 1.3 | 2010 | | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Borrego | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Sensor | - | 28849 | 31-40, 3.5-4.5 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Service Pack | - | 20022 | 31-40, 3.5-4.5 | | Sensor | - | 28849 | 31-40, 3.5-4.5 |
| | | | | Service Pack | | - | 20022 | 31-40, 3.5-4.5 | |
| 2011 | | | | | Forte | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| Borrego | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 20092 | 31-40, 3.5-4.5 |
| | Sensor | - | 28849 | 35-35.7, 3.5-4.5 | | Magentis | Sensor | Includes Transmitter Only | 20086 |
| | Service Pack | - | 20022 | 35-35.7, 3.5-4.5 | Service Pack | | Includes Valve | 20036 | 31-40, 3.5-4.5 |
| Forte, Optima | EZ-Sensor | - | 33000* | 11.5, 1.3 | Optima | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 20092 | 31-40, 3.5-4.5 | | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 |
| Rio | EZ-Sensor | - | 33000* | 11.5, 1.3 | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Rio | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Sensor | - | 28849 | 35-35.7, 3.5-4.5 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Service Pack | - | 20022 | 35-35.7, 3.5-4.5 | | Sensor | - | 28849 | 35-35.7, 3.5-4.5 |
| | | | | Service Pack | | - | 20022 | 35-35.7, 3.5-4.5 | |
| Rondo, Sedona | EZ-Sensor | - | 33000* | 11.5, 1.3 | Rondo, Sedona | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 | | | | | |
| | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|-----------------------|------------------------|---------------------------|----------------|-------------------------------|------------------------|---------------------------|---------------------------|------------------|-------------------------------|
| 2010 (cont.) | | | | | 2009 (cont.) | | | | |
| Rondo, Sedona (cont.) | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 | Rondo, Sedona (cont.) | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 |
| Soul | EZ-Sensor | - | 33000* | 11.5, 1.3 | Soul | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sorento | Sensor | - | 28983 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Service Pack | | Includes Valve | 20036 | 35-35.7, 3.5-4.5 |
| | Sensor | - | 20092 | 31-40, 3.5-4.5 | Spectra | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| Sportage | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 28849 | 35-35.7, 3.5-4.5 |
| | Sensor | - | 28849 | 31-40, 3.5-4.5 | Service Pack | - | 20022 | 35-35.7, 3.5-4.5 | |
| Sportage | Service Pack | - | 20022 | 31-40, 3.5-4.5 | Sportage | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| 2009 | | | | | 2008 | | | | |
| Amanti | Sensor | - | 28983 | 35-35.7, 3.5-4.5 | Amanti | Sensor | - | 28983 | 35-35.7, 3.5-4.5 |
| | Service Pack | Includes Valve | 20036 | 35-35.7, 3.5-4.5 | | Service Pack | Includes Valve | 20036 | 35-35.7, 3.5-4.5 |
| Borrego | EZ-Sensor | - | 33000* | 11.5, 1.3 | Magentis | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Optima | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Sensor | - | 28849 | 31-40, 3.5-4.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| Service Pack | - | 20022 | 31-40, 3.5-4.5 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| | | | | Sensor | | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 | |
| Magentis | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 | Rio | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 |
| | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| Optima | EZ-Sensor | - | 33000* | 11.5, 1.3 | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 | |
| | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | |
| | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | Rondo | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| Rio | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | | | |
| | Sensor | - | 28849 | 35-35.7, 3.5-4.5 | | | | | |
| | Service Pack | - | 20022 | 35-35.7, 3.5-4.5 | | | | | |
| Rondo, Sedona | EZ-Sensor | - | 33000* | 11.5, 1.3 | | | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | | | |

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|---------------------|------------------------|---------------------------|---------------------|-------------------------------|-------------------------------|---------------------------|--|---------------------|-------------------------------|
| 2008 (cont.) | | | | | 2007 (cont.) | | | | |
| Rondo (cont.) | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 | Sorento | Sensor | - | 28983 | 35-35.7, 3.5-4.5 |
| | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | | Service Pack | Includes Valve | 20036 | 35-35.7, 3.5-4.5 |
| Sedona | Sensor | Includes Transmitter Only | 20085 | 31-40, 3.5-4.5 | Spectra | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| Sorento | Sensor | - | 28983 | 35-35.7, 3.5-4.5 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Service Pack | Includes Valve | 20036 | 35-35.7, 3.5-4.5 | | Sensor | - | 28849 | 35-35.7, 3.5-4.5 |
| Spectra | EZ-Sensor | - | 33000* | 11.5, 1.3 | Service Pack | - | 20022 | 35-35.7, 3.5-4.5 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Sportage | Sensor | - | 28983 | 31-40, 3.5-4.5 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 |
| | Sensor | - | 28849 | 35-35.7, 3.5-4.5 | 2006 | | | | |
| Service Pack | - | 20022 | 35-35.7, 3.5-4.5 | Optima, Rondo | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| Sportage | Sensor | - | 28983 | | 31-40, 3.5-4.5 | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Service Pack | Includes Valve | 20036 | | 31-40, 3.5-4.5 | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| 2007 | | | | | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 | |
| Amanti | Sensor | - | 28983 | 35-35.7, 3.5-4.5 | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | |
| | Service Pack | Includes Valve | 20036 | 35-35.7, 3.5-4.5 | Sedona | Sensor | Includes Transmitter Only | 20085 | 31-40, 3.5-4.5 |
| Optima | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Spectra | Sensor | - | 28849 | 35-35.7, 3.5-4.5 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20022 | 35-35.7, 3.5-4.5 |
| | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 | Sportage | Sensor | - | 28983 | 31-40, 3.5-4.5 |
| Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | Service Pack | | Includes Valve | 20036 | 31-40, 3.5-4.5 | |
| Rio | EZ-Sensor | - | 33000* | 11.5, 1.3 | 2005 | | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Sportage | Sensor | Jun. 15, 2005 & Newer | 28983 | 31-40, 3.5-4.5 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | Jun. 15, 2005 & Newer; Includes Valve | 20036 | 31-40, 3.5-4.5 |
| | Sensor | - | 28849 | 35-35.7, 3.5-4.5 | 2013-2012 | | | | |
| | Service Pack | - | 20022 | 35-35.7, 3.5-4.5 | Evoque, LR2, LR4, Range Rover | Sensor | - | 20090 | 71, 8 |
| Rondo | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Service Pack | - | 20030 | 71, 8 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | 2011-2010 | | | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | LR2 | Sensor | - | 20090 | 71, 8 |
| | Sensor | Includes Transmitter Only | 20086 | 31-40, 3.5-4.5 | | Service Pack | - | 20030 | 71, 8 |
| | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | LR4, Range Rover | Sensor | W/315 MHz Sensor | 20090 | 71, 8 |
| Sedona | Sensor | Includes Transmitter Only | 20085 | 31-40, 3.5-4.5 | | Sensor | W/433 MHz Sensor | 20091 | 71, 8 |
| | Service Pack | Includes Valve | 20036 | 31-40, 3.5-4.5 | | Service Pack | - | 20030 | 71, 8 |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|-------------------------------------|------------------------|---------------------------|------------------|-------------------------------|---|------------------------|--------------|--------|-------------------------------|-----------|
| 2009 | | | | | 2013 (cont.) | | | | | |
| LR2 | Sensor | - | 20090 | 71, 8 | GS350 (cont.) | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | - | 20030 | 71, 8 | | Sensor | - | | | |
| LR3, Range Rover | Sensor | W/315 MHz Sensor | 20090 | 71, 8 | | Service Pack | - | | | |
| | Sensor | W/433 MHz Sensor | 20091 | 71, 8 | GS450H, GX460, IS F, IS250, IS300H, IS350, LFA, LS460, LS600H, LX570, RX350, RX450H | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | - | 20030 | 71, 8 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| 2008 | LR2 | Sensor | - | 20090 | | 71, 8 | Sensor | - | 28370 | 35, 4 |
| | | Service Pack | - | 20030 | | 71, 8 | Service Pack | - | 20032 | 35, 4 |
| | LR3, Range Rover | Sensor | W/315 MHz Sensor | 20090 | | 71, 8 | RXF Sport | Sensor | Vehicle Made for Canada | 28370 |
| Sensor | | W/433 MHz Sensor | 20091 | 71, 8 | Service Pack | - | | 20032 | 35, 4 | |
| Service Pack | | - | 20030 | 71, 8 | 2012 | | | | | |
| 2007-2006 | | | | | CT200H, ES350, GX460 | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| LR3, Range Rover | Sensor | W/315 MHz Sensor | 20090 | 71, 8 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Sensor | W/433 MHz Sensor | 20091 | 71, 8 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | - | 20030 | 71, 8 | | Sensor | - | 28370 | 35, 4 | |
| 2005 | | | | | | Service Pack | - | 20032 | 35, 4 | |
| LR3, Range Rover | Sensor | Includes Transmitter Only | 28082 | 58, 6.5 | | HS250H | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Service Pack | Does Not Include Valve | 20023 | 58, 6.5 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 58, 6.5 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | W/48mm Green Insert | 20038 | 58, 6.5 | Sensor | | - | 28345 | 35, 4 | |
| | Service Pack | W/49mm Black Insert | 20039 | 58, 6.5 | Service Pack | | - | 20032 | 35, 4 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 58, 6.5 | IS C, IS F, IS250, IS300H, IS350, LFA, LS460, LS600H, RX350 | | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| 2004-2002 | | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| Range Rover | Sensor | Includes Transmitter Only | 28082 | 58, 6.5 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | Does Not Include Valve | 20023 | 58, 6.5 | | Sensor | - | 28370 | 35, 4 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 58, 6.5 | | Service Pack | - | 20032 | 35, 4 | |
| | Service Pack | W/48mm Green Insert | 20038 | 58, 6.5 | RX400H | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Service Pack | W/49mm Black Insert | 20039 | 58, 6.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 58, 6.5 | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | |
| 2014 | | | | | Sensor | - | 28370 | 35, 4 | | |
| ES300H, ES350, IS350, LX570, RX450H | Sensor | - | 28370 | 35, 4 | Service Pack | - | 20032 | 35, 4 | | |
| | Service Pack | - | 20032 | 35, 4 | RX450H | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| 2013 | | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| CT200H | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 28370 | 35, 4 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20032 | 35, 4 | |
| | Sensor | - | 28370 | 35, 4 | ES300H | Sensor | - | 28370 | 35, 4 | |
| | Service Pack | - | 20032 | 35, 4 | | Service Pack | - | 20032 | 35, 4 | |
| ES300H | Sensor | - | 28370 | 35, 4 | ES350 | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Service Pack | - | 20032 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| ES350 | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 28370 | 35, 4 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20032 | 35, 4 | |
| | Sensor | - | 28370 | 35, 4 | GS350 | EZ-Sensor | - | 33200 | 11.5, 1.3 | |
| | Service Pack | - | 20032 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Service Pack | | - | 20032 | 35, 4 | | |

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|--|------------------------|------------------------|--------------|-------------------------------|---|------------------------|------------------------|----------------------|-------------------------------|-----------|
| 2011 | | | | | 2010 (cont.) | | | | | |
| CT200H, ES350, GS350, GS450H, GS460, GX460 | EZ-Sensor | - | 33000* | 11.5, 1.3 | RX350 | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 28370 | 35, 4 | | Sensor | Models Made in Japan | 28370 | 35, 4 | |
| | Service Pack | - | 20032 | 35, 4 | | Service Pack | - | 20032 | 35, 4 | |
| | Service Pack | - | 20032 | 35, 4 | | Service Pack | - | 20032 | 35, 4 | |
| | HS250H | EZ-Sensor | - | 33000* | 11.5, 1.3 | RX400H | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | Models Made in Japan | 28370 | 35, 4 |
| | | Sensor | - | 28345 | 35, 4 | | Service Pack | - | 20032 | 35, 4 |
| Service Pack | | - | 20032 | 35, 4 | Service Pack | - | 20032 | 35, 4 | | |
| Service Pack | | - | 20032 | 35, 4 | Service Pack | - | 20032 | 35, 4 | | |
| IS C, IS F, IS250, IS300H, IS350, LFA, LS460, LS600H, LX570, RX350 | EZ-Sensor | - | 33000* | 11.5, 1.3 | RX450H | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 28370 | 35, 4 | | Sensor | - | 28370 | 35, 4 | |
| | Service Pack | - | 20032 | 35, 4 | Service Pack | - | 20032 | 35, 4 | | |
| | Service Pack | - | 20032 | 35, 4 | Service Pack | - | 20032 | 35, 4 | | |
| RX400H | EZ-Sensor | - | 33000* | 11.5, 1.3 | SC430 | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | Models Made in Japan | 28370 | 35, 4 | | Sensor | - | 28370 | 27, 3 | |
| | Service Pack | - | 20032 | 35, 4 | Service Pack | - | 20032 | 27, 3 | | |
| | Service Pack | - | 20032 | 35, 4 | Service Pack | - | 20032 | 27, 3 | | |
| RX450H | EZ-Sensor | - | 33000* | 11.5, 1.3 | 2009-2008 | | | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | ES350, GS350, GS450H, GS460, GX470, IS C, IS F, IS250, IS300H, IS350, LS460, LS600H, LX570 | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Sensor | - | 28370 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | - | 20032 | 35, 4 | | Sensor | - | 28370 | 35, 4 | |
| | Service Pack | - | 20032 | 35, 4 | | Service Pack | - | 20032 | 35, 4 | |
| 2010 | | | | | RX350 | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| ES350, GS350, GS450H, GS460, GX460 | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 28370 | 35, 4 | | Sensor | Models Made in Japan | 28370 | 35, 4 | |
| | Service Pack | - | 20032 | 35, 4 | | Service Pack | - | 20032 | 35, 4 | |
| Service Pack | - | 20032 | 35, 4 | Service Pack | - | 20032 | 35, 4 | | | |
| HS250H | EZ-Sensor | - | 33000* | 11.5, 1.3 | RX400H | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 28345 | 35, 4 | | Sensor | Models Made in Japan | 28370 | 35, 4 | |
| | Service Pack | - | 20032 | 35, 4 | | Service Pack | - | 20032 | 35, 4 | |
| | Service Pack | - | 20032 | 35, 4 | | Service Pack | - | 20032 | 35, 4 | |
| IS C, IS F, IS250, IS300H, IS350, LS460, LS600H, LX570 | EZ-Sensor | - | 33000* | 11.5, 1.3 | SC430 | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 28370 | 35, 4 | | Sensor | - | 28370 | 27, 3 | |
| | Service Pack | - | 20032 | 35, 4 | | Service Pack | - | 20032 | 27, 3 | |
| | Service Pack | - | 20032 | 35, 4 | | Service Pack | - | 20032 | 27, 3 | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | |
|--|------------------------|------------------------|--------------------------------|-------------------------------|---------------------------------------|------------------------|------------------------|------------------------|-------------------------------|-----------|-----------|
| 2007 | | | | | 2006 (cont.) | | | | | | |
| ES350, GS350, GS430, GS450H, GX470, IS C, IS F, IS250, IS300H, IS350, LS460, LX470 | EZ-Sensor | - | 33000* | 11.5, 1.3 | IS C, IS F | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | |
| | Sensor | - | 28370 | 35, 4 | | Sensor | - | 28370 | 35, 4 | | |
| | Service Pack | - | 20032 | 35, 4 | | Service Pack | - | 20032 | 35, 4 | | |
| | | | | | | | | | | | |
| RX350, RX400H | EZ-Sensor | - | 33000* | 11.5, 1.3 | IS250 | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | |
| | Sensor | Models Made in Japan | 28370 | 35, 4 | | Sensor | Mar. & Older | 28335 | 35, 4 | | |
| | Service Pack | - | 20032 | 35, 4 | | Sensor | Apr. 1 & Newer | 28370 | 35, 4 | | |
| | | | | | | Service Pack | Mar. & Older | 20031 | 35, 4 | | |
| SC430 | EZ-Sensor | - | 33000* | 11.5, 1.3 | IS300H | Service Pack | Apr. 1 & Newer | 20032 | 35, 4 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | Sensor | - | 28370 | 27, 3 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | |
| | Service Pack | - | 20032 | 27, 3 | | Sensor | - | 28370 | 35, 4 | | |
| | | | | | | Service Pack | - | 20032 | 35, 4 | | |
| 2006 | | | | | IS350 | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| Lexus (cont.) | GS300 | EZ-Sensor | - | 33000* | | 11.5, 1.3 | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | | 11.5, 1.3 | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | | 62, 7 | Sensor | Mar. & Older | 28335 | 35, 4 | |
| | | Sensor | - | 28335 | | 35, 4 | Sensor | Apr. 1 & Newer | 28370 | 35, 4 | |
| | | Service Pack | - | 20031 | | 35, 4 | Service Pack | Mar. & Older | 20031 | 35, 4 | |
| | | | | | | Service Pack | Apr. 1 & Newer | 20032 | 35, 4 | | |
| Lexus (cont.) | GS430 | EZ-Sensor | - | 33000* | 11.5, 1.3 | LX470 | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | | Sensor | Jun. & Older | 28335 | 35, 4 | | Sensor | Jul. & Older | 28365 | 35, 4 | |
| | | Sensor | Jul. & Newer | 28370 | 35, 4 | | Sensor | Aug. & Newer | 28370 | 35, 4 | |
| | | Service Pack | Jun. & Older | 20031 | 35, 4 | | Service Pack | Jul. & Older | 20031 | 35, 4 | |
| | | Service Pack | Jul. & Newer | 20032 | 35, 4 | | Service Pack | Aug. & Newer | 20032 | 35, 4 | |
| | | | | | | | RX330 | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | | | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | | | | | | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | | | | Sensor | Models Made in Japan; Feb. & Newer | 28370 | | 35, 4 | | | |
| | | | | Service Pack | Jan. 31 & Older | 20031 | | 35, 4 | | | |
| | | | | Service Pack | Feb. & Newer | 20032 | | 35, 4 | | | |
| Lexus (cont.) | GX470 | EZ-Sensor | - | 33000* | 11.5, 1.3 | RX400H | Sensor | Models Made in Japan | 28370 | 35, 4 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | - | 20032 | 35, 4 | |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | | | | | |
| | | Sensor | Feb. & Newer; W/O Valve Cap | 28335 | 35, 4 | | | | | | |
| | | Sensor | Jan. 31 & Older | 28345 | 35, 4 | | | | | | |
| | | Service Pack | Jan. 31 & Older | 20031 | 35, 4 | | | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | |
|---------------------|-------------|------------------------|---------------------------------|----------------------------|---|-------------------------------|------------------------|--------------|----------------------------|-----------|-------|
| 2006 (cont.) | | | | | 2003-2002 | | | | | | |
| Lexus (cont.) | SC430 | EZ-Sensor | - | 33000* | 11.5, 1.3 | Lexus (cont.) | SC430 | Sensor | W/White I.D. Mark | 28310 | 27, 3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | Sensor | W/Blue I.D. Mark | 28315 | 27, 3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | Sensor | W/Red I.D. Mark | 28320 | 27, 3 |
| | | Sensor | W/White I.D. Mark; Jul. & Older | 28310 | 27, 3 | | | Sensor | W/Gold I.D. Mark | 28325 | 27, 3 |
| | | Sensor | W/Blue I.D. Mark; Jul. & Older | 28315 | 27, 3 | 2014 | | | | | |
| | | Sensor | W/Red I.D. Mark; Jul. & Older | 28320 | 27, 3 | MKS, MKT, MKX, MKZ, Navigator | Sensor | - | 20315 | 11.5, 1.3 | |
| | | Sensor | W/Gold I.D. Mark; Jul. & Older | 28325 | 27, 3 | | Service Pack | - | 20018 | 11.5, 1.3 | |
| | | Sensor | Aug. & Newer | 28370 | 27, 3 | 2013-2012 | | | | | |
| | | Service Pack | Aug. & Newer | 20032 | 27, 3 | MKS, MKT, MKX, MKZ, Navigator | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| 2005 | | | | | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | | |
| GS430 | EZ-Sensor | - | 33000* | 11.5, 1.3 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | | |
| | | Rubber Valve | 20018 | 11.5, 1.3 | Sensor | | - | 20315 | 11.5, 1.3 | | |
| | | Almnm. Valve | 34000 | 62, 7 | Service Pack | | - | 20018 | 11.5, 1.3 | | |
| | | - | 28335 | 35, 4 | 2011 | | | | | | |
| | | - | 20031 | 35, 4 | MKS, MKT, MKX, MKZ, Navigator, Town Car | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| GX470 | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | |
| | | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 20315 | 11.5, 1.3 | | |
| | | - | 28345 | 35, 4 | | Service Pack | - | 20018 | 11.5, 1.3 | | |
| | | - | 20031 | 35, 4 | 2010 | | | | | | |
| LX470 | EZ-Sensor | - | 33000* | 11.5, 1.3 | MKS, MKT, MKX | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | |
| | | - | 28365 | 35, 4 | | Sensor | - | 28390 | 27, 3 | | |
| | | - | 20031 | 35, 4 | | Sensor Clip | - | 22100 | - | | |
| SC430 | Sensor | W/White I.D. Mark | 28310 | 27, 3 | | Sensor Cradle | - | 22101 | - | | |
| | | W/Blue I.D. Mark | 28315 | 27, 3 | | Sensor Universal Band | - | 22102 | - | | |
| | | W/Red I.D. Mark | 28320 | 27, 3 | 2010 | | | | | | |
| | | W/Gold I.D. Mark | 28325 | 27, 3 | MKZ | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | | 2004 | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| GX470 | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | |
| | | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 20315 | 11.5, 1.3 | | |
| | | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20018 | 11.5, 1.3 | | |
| | | - | 28345 | 35, 4 | Navigator | | | | | | |
| | | - | 20031 | 35, 4 | EZ-Sensor | - | 33000* | 11.5, 1.3 | | | |
| SC430 | Sensor | W/White I.D. Mark | 28310 | 27, 3 | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | |
| | | W/Blue I.D. Mark | 28315 | 27, 3 | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | |
| | | W/Red I.D. Mark | 28320 | 27, 3 | Sensor | - | 28390 | 27, 3 | | | |
| | | W/Gold I.D. Mark | 28325 | 27, 3 | Sensor Clip | - | 22100 | - | | | |
| | | - | 22101 | - | Sensor Cradle | - | 22101 | - | | | |
| - | 22102 | - | Sensor Universal Band | - | 22102 | - | | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | | | |
|------------------------|------------------|------------------------|--------------|-------------------------------|-------------|------------------------|------------------|------------------------|---------------------------------|------------------------|--------------|--------|-----------|
| 2010 (cont.) | | | | | 2008 | | | | | | | | |
| Lincoln (cont.) | Town Car | EZ-Sensor | - | 33000* | 11.5, 1.3 | Lincoln (cont.) | Mark LT | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | |
| | | Sensor | - | 28385 | 27, 3 | | | Sensor | - | 28385 | 27, 3 | | |
| | | Sensor Clip | - | 22100 | - | | | Sensor Clip | - | 22100 | - | | |
| | | Sensor Cradle | - | 22101 | - | | | Sensor Cradle | - | 22101 | - | | |
| | | Sensor Universal Band | - | 22102 | - | | | Sensor Universal Band | - | 22102 | - | | |
| 2009 | | | | | | | | | | | | | |
| Lincoln (cont.) | Mark LT | EZ-Sensor | - | 33000* | 11.5, 1.3 | Lincoln (cont.) | MKS, MKX | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | | Sensor | - | 20315 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | |
| Lincoln (cont.) | MKS, MKX | EZ-Sensor | - | 33000* | 11.5, 1.3 | | | Sensor | W/Chrome Plated Almnm. Wheels | 28385 | 27, 3 | | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | Sensor | W/O Chrome Plated Almnm. Wheels | 28390 | 27, 3 | | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | Sensor Clip | - | 22100 | - | | |
| | | Sensor | - | 28390 | 27, 3 | | | Sensor Cradle | - | 22101 | - | | |
| | | Sensor Clip | - | 22100 | - | | | Sensor Universal Band | - | 22102 | - | | |
| | | Sensor Cradle | - | 22101 | - | | | Lincoln (cont.) | MKZ | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Sensor Universal Band | - | 22102 | - | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| Lincoln (cont.) | MKZ | EZ-Sensor | - | 33000* | 11.5, 1.3 | EZ-Sensor Service Pack | Almnm. Valve | | | 34000 | 62, 7 | | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Sensor | - | | | 28385 | 27, 3 | | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sensor Clip | - | | | 22100 | - | | |
| | | Sensor | - | 28385 | 27, 3 | Sensor Cradle | - | | | 22101 | - | | |
| | | Sensor Clip | - | 22100 | - | Sensor Universal Band | - | | | 22102 | - | | |
| | | Sensor Cradle | - | 22101 | - | Lincoln (cont.) | Navigator | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | | Sensor Universal Band | - | 22102 | - | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| Lincoln (cont.) | Navigator | EZ-Sensor | - | 33000* | 11.5, 1.3 | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | Sensor | - | 28390 | 27, 3 | | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | Sensor Clip | - | 22100 | - | | |
| | | Sensor | - | 28390 | 27, 3 | | | Sensor Cradle | - | 22101 | - | | |
| | | Sensor Clip | - | 22100 | - | | | Sensor Universal Band | - | 22102 | - | | |
| | | Sensor Cradle | - | 22101 | - | Lincoln (cont.) | Town Car | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | | Sensor Universal Band | - | 22102 | - | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| Lincoln (cont.) | Town Car | EZ-Sensor | - | 33000* | 11.5, 1.3 | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | Sensor | - | 28385 | 27, 3 | | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | Sensor Clip | - | 22100 | - | | |
| | | Sensor | - | 28385 | 27, 3 | | | Sensor Cradle | - | 22101 | - | | |
| | | Sensor Clip | - | 22100 | - | | | Sensor Universal Band | - | 22102 | - | | |
| | | Sensor Cradle | - | 22101 | - | | | | | | | | |
| | | Sensor Universal Band | - | 22102 | - | | | | | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|------------------------|------------------------|---------------------------------|--------------|----------------------------|-------------------------|------------------------|---------------------------|----------------------|----------------------------|-----------|
| 2007 | | | | | 2006 | | | | | |
| Lincoln (cont.) | Mark LT | EZ-Sensor | - | 33000* | 11.5, 1.3 | Navigator | Sensor | - | 20135** | 44, 5 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | - | 20002 | 44, 5 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Town Car | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Sensor | - | 28385 | 27, 3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | Sensor Clip | - | 22100 | - | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | Sensor Cradle | - | 22101 | - | | Sensor | - | 28385 | 27, 3 |
| | | Sensor Universal Band | - | 22102 | - | | Sensor Clip | - | 22100 | - |
| | Sensor Cradle | - | 22101 | - | Sensor Cradle | - | 22101 | - | | |
| | Sensor Universal Band | - | 22102 | - | Sensor Universal Band | - | 22102 | - | | |
| | MKX | EZ-Sensor | - | 33000* | 11.5, 1.3 | 2005 | | | | |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | Aviator | EZ-Sensor | - | 33100 | 11.5, 1.3 | |
| EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| Sensor | | W/Chrome Plated Almnm. Wheels | 28385 | 27, 3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| Sensor | | W/O Chrome Plated Almnm. Wheels | 28390 | 27, 3 | | Sensor | - | 20096** | 44, 5 | |
| Sensor Clip | | - | 22100 | - | | Service Pack | - | 20002 | 44, 5 | |
| Sensor Cradle | | - | 22101 | - | Navigator | Sensor | - | 20135** | 44, 5 | |
| Sensor Universal Band | | - | 22102 | - | | Service Pack | - | 20002 | 44, 5 | |
| MKZ | EZ-Sensor | - | 33000* | 11.5, 1.3 | 2004-2003 | | | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Aviator, Navigator | EZ-Sensor | - | 33100 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Sensor | - | 28385 | 27, 3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor Clip | - | 22100 | - | Sensor | - | 20096** | 44, 5 | | |
| | Sensor Cradle | - | 22101 | - | Service Pack | - | 20002 | 44, 5 | | |
| | Sensor Universal Band | - | 22102 | - | 2006 | | | | | |
| Navigator | EZ-Sensor | - | 33000* | 11.5, 1.3 | Coupe, Gransport, MC-12 | Service Pack | Does Not Include Valve | 20023 | - | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | W/43mm Silver Insert | 20037 | - | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | W/48mm Green Insert | 20038 | - | |
| | Sensor | - | 28390 | 27, 3 | | Service Pack | W/49mm Black Insert | 20039 | - | |
| | Sensor Clip | - | 22100 | - | Service Pack | W/51mm Orange Insert | 20040 | - | | |
| | Sensor Cradle | - | 22101 | - | Quattroporte | Sensor | Includes Transmitter Only | 20077 | 35, 4 | |
| | Sensor Universal Band | - | 22102 | - | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| | Town Car | EZ-Sensor | - | 33000* | | 11.5, 1.3 | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| Sensor | | - | 28385 | 27, 3 | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | |
| Sensor Clip | | - | 22100 | - | Spyder | Service Pack | Does Not Include Valve | 20023 | - | |
| Sensor Cradle | | - | 22101 | - | | Service Pack | W/43mm Silver Insert | 20037 | - | |
| Sensor Universal Band | | - | 22102 | - | | Service Pack | W/48mm Green Insert | 20038 | - | |
| Sensor Universal Band | | - | 22102 | - | | Service Pack | W/49mm Black Insert | 20039 | - | |
| 2005-2004 | | | | | Coupe, Gransport | Service Pack | Does Not Include Valve | 20023 | - | |
| 2006 | | | | | | Service Pack | W/43mm Silver Insert | 20037 | - | |
| 2005-2004 | | | | | | Service Pack | W/48mm Green Insert | 20038 | - | |
| 2006 | | | | | | Service Pack | W/49mm Black Insert | 20039 | - | |
| 2005-2004 | | | | | | Service Pack | W/51mm Orange Insert | 20040 | - | |

* Programming Tool Required ** Magnet Required to Activate Sensor

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | | | | | |
|--------------------------|---------------------------------------|------------------------|---------------------------|-------------------------------|---------------------------------------|------------------------------------|------------------------------|--------------|-------------------------------|---|----------------------------|------------------------|--------------|-----------|-----------|
| 2005-2004 (cont.) | | | | | | | | | | | | | | | |
| Maserati (cont.) | Quattroporte | Sensor | Includes Transmitter Only | 20077 | 35, 4 | B2300 Pickup, B4000 Pickup (cont.) | Sensor Cradle | - | 22101 | - | | | | | |
| | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | Sensor Universal Band | - | 22102 | - | | | | | |
| | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | CX-7, CX-9, MX-5 Miata, RX-8 | Sensor | - | 20093 | 71, 8 | | | | |
| | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | Service Pack | | - | 20030 | 71, 8 | | | | | |
| | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | Tribute | EZ-Sensor | - | 33000* | 11.5, 1.3 | | | | | |
| | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | | | |
| | Spyder | Service Pack | Does Not Include Valve | 20023 | - | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | | | |
| | | Service Pack | W/43mm Silver Insert | 20037 | - | | Sensor | - | 20315 | 11.5, 1.3 | | | | | |
| | | Service Pack | W/48mm Green Insert | 20038 | - | | Service Pack | - | 20018 | 11.5, 1.3 | | | | | |
| | | Service Pack | W/49mm Black Insert | 20039 | - | 2008 | | | | | | | | | |
| | 2013 | | | | | 3, 5, 6 | Sensor | - | 20093 | 71, 8 | | | | | |
| | 2, 3, 5, 6, CX-9 | Sensor | - | 20093 | 71, 8 | Service Pack | - | 20030 | 71, 8 | B2300 Pickup, B3000 Pickup, B4000 Pickup, Tribute | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | | Service Pack | - | 20030 | 71, 8 | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | 2012 | | | | | 2, 3, 5, 6, CX-9, MX-5 Miata | Sensor | - | 20093 | | 71, 8 | Sensor | - | 28385 | 27, 3 |
| Service Pack | - | 20030 | 71, 8 | Sensor Clip | - | | 22100 | - | Sensor Cradle | - | 22101 | - | | | |
| 2011 | | | | | 2, 3, 6, CX-7, CX-9, MX-5 Miata, RX-8 | Sensor | - | 20093 | 71, 8 | Sensor Universal Band | - | 22102 | - | | |
| Tribute | EZ-Sensor | - | 33000* | 11.5, 1.3 | | CX-7, CX-9, MX-5 Miata, RX-8 | Sensor | - | 20093 | 71, 8 | Tribute | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | Service Pack | - | 20030 | 71, 8 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Tribute | | EZ-Sensor | - | 33000* | 11.5, 1.3 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| Sensor | - | 20315 | 11.5, 1.3 | | | Sensor | - | 28385 | 27, 3 | Sensor Clip | | - | 22100 | - | |
| Service Pack | - | 20030 | 71, 8 | | | Sensor Cradle | - | 22101 | - | Sensor Universal Band | | - | 22102 | - | |
| 2010 | | | | | | | | | | | | | | | |
| Mazda | 3, 5, 6, CX-7, CX-9, MX-5 Miata, RX-8 | Sensor | - | 20093 | 71, 8 | 2007 | | | | | | | | | |
| | | Service Pack | - | 20030 | 71, 8 | 3, 5 | Sensor | - | 20093 | 71, 8 | | | | | |
| | Tribute | EZ-Sensor | - | 33000* | 11.5, 1.3 | Service Pack | - | 20030 | 71, 8 | B2300 Pickup, B3000 Pickup, B4000 Pickup | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sensor | - | 28385 | 27, 3 | | Sensor Clip | - | 22100 | - | |
| | | Sensor | - | 20315 | 11.5, 1.3 | Sensor Cradle | - | 22101 | - | Sensor Universal Band | - | 22102 | - | | |
| | Service Pack | - | 20018 | 11.5, 1.3 | 2009 | | | | | | | | | | |
| | 2009 | | | | | 3, 5, 6 | Sensor | - | 20093 | 71, 8 | B2300 Pickup, B4000 Pickup | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | B2300 Pickup, B4000 Pickup | EZ-Sensor | - | 33000* | 11.5, 1.3 | Service Pack | - | 20030 | 71, 8 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | B2300 Pickup, B4000 Pickup | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sensor | - | 28385 | 27, 3 | |
| Sensor | - | 28385 | 27, 3 | Sensor Clip | - | | 22100 | - | Sensor Cradle | - | 22101 | - | | | |
| Sensor Clip | - | 22100 | - | Sensor Universal Band | - | | 22102 | - | | | | | | | |
| | | | | | | | | | | | | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | |
|--|--|---------------------------|--------------|-------------------------------|---|---|---------------------------|---------------------------|-------------------------------|-----------|-----------|
| 2007 | | | | | 2012 (cont.) | | | | | | |
| Mazda (cont.) | CX-7, CX-9, MX-5 Miata, RX-8 | Sensor | - | 20093 | 71, 8 | E550, E63, G550, GL350, GL450, GL550 | EZ-Sensor | - | 33200 | 11.5, 1.3 | |
| | | Service Pack | - | 20030 | 71, 8 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | 2006 | | | | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | 3, 5, MX-5 Miata, RX-8 | Sensor | - | 20093 | 71, 8 | | Sensor | - | 28214 | 58, 6.5 | |
| | | Service Pack | - | 20030 | 71, 8 | | Service Pack | W/O Valve | 20016 | 58, 6.5 | |
| | Tribute | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Service Pack | W/Valve | 20020 | 58, 6.5 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | GLK350, ML350 | EZ-Sensor | - | 33200 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | Sensor | - | 28385 | 27, 3 | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | Sensor Clip | - | 22100 | - | | | Sensor | - | 28214 | 58, 6.5 |
| Sensor Cradle | | - | 22101 | - | Service Pack | Does Not Include Stem | | 20016 | 58, 6.5 | | |
| Sensor Universal Band | | - | 22102 | - | Service Pack | Includes Stem Only | | 20020 | 58, 6.5 | | |
| 2005-2004 | | | | | ML63 | EZ-Sensor | | - | 33200 | 11.5, 1.3 | |
| 3, RX-8 | Sensor | - | 20093 | 71, 8 | | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | - | 20030 | 71, 8 | | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| 2013 | | | | | | Sensor | | - | 28214 | 58, 6.5 | |
| Mercedes-Benz | C250, C300, C350, C63, CL550, CL600, CL63, CL65, CLS550, CLS63, E350, E550, E63, G550, GL350, GL450, GL550, GL63, GLK350, ML350, ML63, R350, S350, S400, S550, S600, S63, S65, SL550, SL63, SLK250, SLK350, SLS | EZ-Sensor | - | 33200 | | 11.5, 1.3 | Service Pack | W/O Valve | 20016 | 58, 6.5 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | | 11.5, 1.3 | Service Pack | W/Valve | 20020 | 58, 6.5 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | R350 | EZ-Sensor | - | 33200 | 11.5, 1.3 | |
| | Sensor | - | 28214 | 58, 6.5 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | Service Pack | W/O Valve | 20016 | 58, 6.5 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | | |
| | Service Pack | W/Valve | 20020 | 58, 6.5 | Sensor | | - | 28214 | 58, 6.5 | | |
| | Service Pack | Does Not Include Stem | 20016 | 58, 6.5 | Service Pack | | Does Not Include Stem | 20016 | 58, 6.5 | | |
| | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | Service Pack | | Includes Stem Only | 20020 | 58, 6.5 | | |
| | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | S350, S350, S400, S550, S600, S63, S65 | | EZ-Sensor | - | 33200 | 11.5, 1.3 | |
| | 2012 | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| C250, C300, C350, C63, CL550, CL600, CL63, CL65, CLS550, CLS63, E350 | EZ-Sensor | - | 33200 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 28214 | 58, 6.5 | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | W/O Valve | 20016 | 58, 6.5 | | |
| | Sensor | - | 28214 | 58, 6.5 | | Service Pack | W/Valve | 20020 | 58, 6.5 | | |
| | Service Pack | Does Not Include Stem | 20016 | 58, 6.5 | | SL550, SL63, SLK250, SLK350, SLS | EZ-Sensor | - | 33200 | 11.5, 1.3 | |
| | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | 2012 | | | | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| C250, C300, C350, C63, CL550, CL600, CL63, CL65, CLS550, CLS63, E350 | EZ-Sensor | - | 33200 | 11.5, 1.3 | Sensor | | - | 28214 | 58, 6.5 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | | Does Not Include Stem | 20016 | 58, 6.5 | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Service Pack | | Includes Stem Only | 20020 | 58, 6.5 | | |
| | Sensor | - | 28214 | 58, 6.5 | | | | | | | |
| | Service Pack | Does Not Include Stem | 20016 | 58, 6.5 | | | | | | | |
| | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | | | | | | |
| | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | | | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | | | | |
|-----------------------|---|---|------------------------|--|-----------------------|---------------------------|--|-----------------------------------|-------------------------------------|------------------------|-----------------------|--------------|-----------|-----------|
| 2011 | | | | | 2011 (cont.) | | | | | | | | | |
| Mercedes-Benz (cont.) | C300, C350, C63, CL550, CL63, E350, E550, E63, G55, G550, GL350, GL450, GL550, GLK350, ML350, ML450, ML550, ML63, R350, S400, S550, S600, S63, S65, SLK300, SLK350, SLS | EZ-Sensor | - | 33200 | 11.5, 1.3 | SLK300, SLK350, SLS | EZ-Sensor | - | 33200 | 11.5, 1.3 | | | | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | | |
| | | Sensor | - | 28214 | 58, 6.5 | | Sensor | - | 28214 | 58, 6.5 | | | | |
| | | Service Pack | Does Not Include Stem | 20016 | 58, 6.5 | | Service Pack | Does Not Include Stem | 20016 | 58, 6.5 | | | | |
| | | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | | | |
| | | C300, C350, C63, CL550, CL600, CL63, CL65 | EZ-Sensor | - | 33200 | 11.5, 1.3 | E350, E550, E63, G55, G550, GL350, GL450, GL550, GLK350, ML350, ML450, ML550, ML63, R350 | EZ-Sensor | - | 33200 | 11.5, 1.3 | | | |
| | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | |
| | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | |
| | | | Sensor | - | 28214 | 58, 6.5 | | Sensor | - | 28214 | 58, 6.5 | | | |
| | | | Service Pack | Does Not Include Stem | 20016 | 58, 6.5 | | Service Pack | Does Not Include Stem | 20016 | 58, 6.5 | | | |
| | | | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | | |
| | | | CLS550, CLS63 | Sensor | - | 20094 | 53, 6 | CLS550, CLS63 | Sensor | - | 20094 | 53, 6 | | |
| | | | | Service Pack | Includes Valve | 20036 | 53, 6 | | Service Pack | Includes Valve | 20036 | 53, 6 | | |
| | | | | E350, E550, E63 | EZ-Sensor | - | 33200 | 11.5, 1.3 | S400, S550, S600, S63, S65 | Sensor | - | 20094 | 53, 6 | |
| | EZ-Sensor Service Pack | | | | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | | Includes Valve | 20036 | 53, 6 | | |
| | EZ-Sensor Service Pack | | | | Almnm. Valve | 34000 | 62, 7 | SLK300, SLK350, SLK55 | | EZ-Sensor | - | 33200 | 11.5, 1.3 | |
| | Sensor | | | | - | 28214 | 58, 6.5 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | | | | Does Not Include Stem | 20016 | 58, 6.5 | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | | | | Includes Stem Only | 20020 | 58, 6.5 | | | Sensor | - | 28214 | 58, 6.5 | |
| | G55, G550, GL350, GL450, GL550, GLK350, ML350, ML450, ML550, ML63, R350 | | | | EZ-Sensor | - | 33200 | | | 11.5, 1.3 | C300, C350, C63 | EZ-Sensor | - | 33200 |
| | | EZ-Sensor Service Pack | | | Rubber Valve | 20018 | 11.5, 1.3 | | | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | | |
| | | Sensor | | - | 28214 | 58, 6.5 | Sensor | - | 28214 | 58, 6.5 | | | | |
| | | Service Pack | | Mar. & Newer; Does Not Include Stem | 20016 | 58, 6.5 | Service Pack | Does Not Include Stem | 20016 | 58, 6.5 | | | | |
| | | Service Pack | | Mar. & Newer; Includes Stem Only | 20020 | 58, 6.5 | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | | | |
| | | S400, S550, S600, S63, S65 | | EZ-Sensor | - | 33200 | 11.5, 1.3 | CL550, CL600, CL63, CL65 | Sensor | - | | 20094 | 53, 6 | |
| | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | Includes Valve | | 20036 | 53, 6 | | | | |
| | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | 2009 | C300, C350, C63 | | EZ-Sensor | - | 33200 | 11.5, 1.3 | | |
| | Sensor | | - | 28214 | 58, 6.5 | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | Service Pack | | Does Not Include Stem | 20016 | 58, 6.5 | | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | |
| | Service Pack | | Includes Stem Only | 20020 | 58, 6.5 | | | | Sensor | - | 28214 | 58, 6.5 | | |
| | SL63, SL65 | | Sensor | - | 20094 | | | | 53, 6 | Service Pack | Does Not Include Stem | 20016 | 58, 6.5 | |
| | | | | | | | | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | | |
| | | | | | | | | CL550, CL600, CL63, CL65 | Sensor | - | 20094 | 53, 6 | | |

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|--|---------------------------|-----------------------|------------------|-------------------------------|--|--|---------------------------|------------------------|-------------------------------|-----------|
| 2009 (cont.) | | | | | 2008 (cont.) | | | | | |
| CLK350, CLK550, CLK63 | EZ-Sensor | - | 33200 | 11.5, 1.3 | CL550, CL600, CL63, CL65 | Sensor | - | 20094 | 53, 6 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | Includes Valve | 20036 | 53, 6 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | CLK350, CLK 550, CLK63 | EZ-Sensor | - | 33200 | 11.5, 1.3 | |
| | Sensor | - | 28214 | 58, 6.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | Does Not Include Stem | 20016 | 58, 6.5 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | Sensor | - | 28214 | 58, 6.5 | |
| | CLS550, CLS63, E320 | Sensor | - | 20094 | | 53, 6 | Service Pack | Does Not Include Stem | 20016 | 58, 6.5 |
| | | Service Pack | Includes Valve | 20036 | | 53, 6 | Service Pack | Includes Stem Only | 20020 | 58, 6.5 |
| | | E350, E550 | Sensor | W/315 MHz Sensor | 20094 | 53, 6 | CLS550, CLS63, E320 | Sensor | - | 20094 |
| | Sensor | | W/433 MHz Sensor | 20095 | 53, 6 | Service Pack | | Includes Valve | 20036 | 53, 6 |
| Service Pack | Includes Valve | | 20036 | 53, 6 | E350, E550 | Sensor | | W/315 MHz Sensor | 20094 | 53, 6 |
| E63 | Sensor | - | 20094 | 53, 6 | | Sensor | W/433 MHz Sensor | 20095 | 53, 6 | |
| | Service Pack | Includes Valve | 20036 | 53, 6 | | Service Pack | Includes Valve | 20036 | 53, 6 | |
| G55, G550 | EZ-Sensor | - | 33200 | 11.5, 1.3 | E63 | Sensor | - | 20094 | 53, 6 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | Includes Valve | 20036 | 53, 6 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | G500, G55 | EZ-Sensor | - | 33200 | 11.5, 1.3 |
| | Sensor | - | 28214 | 58, 6.5 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Service Pack | Does Not Include Stem | 20016 | 58, 6.5 | | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | GL320, GL450, GL550, ML320, ML350, ML550, ML63, R320, R350 | Sensor | - | 28214 | 58, 6.5 | |
| GL320, GL450, GL550, ML320, ML350, ML550, ML63, R320, R350 | Sensor | - | 20095 | 53, 6 | | Service Pack | Does Not Include Stem | 20016 | 58, 6.5 | |
| | Service Pack | Includes Valve | 20036 | 53, 6 | | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | |
| S550, S600, S63, S65, SL550, SL600, SL63, SL65 | Sensor | - | 20094 | 53, 6 | | GL320, GL450, GL550, ML320, ML350, ML550, ML63, R320, R350 | Sensor | - | 20095 | 53, 6 |
| | Service Pack | Includes Valve | 20036 | 53, 6 | | | Service Pack | Includes Valve | 20036 | 53, 6 |
| SLK300, SLK350, SLK55 | EZ-Sensor | - | 33200 | 11.5, 1.3 | R550 | | Service Pack | Does Not Include Valve | 20023 | 53, 6 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | Service Pack | W/43mm Silver Insert | 20037 | 53, 6 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | | Service Pack | W/48mm Green Insert | 20038 | 53, 6 |
| | Sensor | - | 28214 | 58, 6.5 | | Service Pack | W/49mm Black Insert | 20039 | 53, 6 | |
| | Service Pack | Does Not Include Stem | 20016 | 58, 6.5 | | Service Pack | W/51mm Orange Insert | 20040 | 53, 6 | |
| | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | S550, S600, S63, S65, SL55, SL550, SL600, SL65 | Sensor | - | 20094 | 53, 6 | |
| | SLR McLaren | Sensor | - | 20094 | | 53, 6 | Service Pack | Includes Valve | 20036 | 53, 6 |
| Service Pack | | Includes Valve | 20036 | 53, 6 | SLK280, SLK350, SLK55 | EZ-Sensor | - | 33200 | 11.5, 1.3 | |
| 2008 | | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| C300, C350, C63 | EZ-Sensor | - | 33200 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 28214 | 58, 6.5 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | Service Pack | Does Not Include Stem | 20016 | 58, 6.5 | |
| | Sensor | - | 28214 | 58, 6.5 | | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | |
| | Service Pack | Does Not Include Stem | 20016 | 58, 6.5 | SLR McLaren | Sensor | - | 20094 | 53, 6 | |
| | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | Service Pack | Includes Valve | 20036 | 53, 6 | |

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|---|-------------------------------------|--|---------|-------------------------------|---|------------------------------------|---------------------------------------|----------------|-------------------------------|-------|
| 2007 | | | | | 2007 (cont.) | | | | | |
| C280 | Sensor | Mar. & Newer | 28214 | 58, 6.5 | SLK280, SLK350, SLK55 (cont.) | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | Mar. & Newer; Does Not Include Stem | 20016 | 58, 6.5 | | Sensor | May & Newer | 28214 | 58, 6.5 | |
| | Service Pack | Mar. & Newer; Includes Stem Only | 20020 | 58, 6.5 | | Service Pack | May & Newer; Does Not Include Stem | 20016 | 58, 6.5 | |
| Service Pack | Jun. & Newer | 28214 | 58, 6.5 | Service Pack | | May & Newer; Includes Stem Only | 20020 | 58, 6.5 | | |
| C350 | Sensor | Jun. & Newer | 28214 | 58, 6.5 | SLR McLaren | Service Pack | Does Not Include Valve | 20023 | 53, 6 | |
| | Service Pack | Jun. & Newer; Does Not Include Stem | 20016 | 58, 6.5 | | Service Pack | W/43mm Silver Insert | 20037 | 53, 6 | |
| | Service Pack | Jun. & Newer; Includes Stem Only | 20020 | 58, 6.5 | | Service Pack | W/48mm Green Insert | 20038 | 53, 6 | |
| Service Pack | - | 20094 | 53, 6 | Service Pack | | W/49mm Black Insert | 20039 | 53, 6 | | |
| Service Pack | Includes Valve | 20036 | 53, 6 | Service Pack | | W/51mm Orange Insert | 20040 | 53, 6 | | |
| CL550, CL600, CL63 | Sensor | - | 20094 | 53, 6 | 2006 | | | | | |
| | Service Pack | Includes Valve | 20036 | 53, 6 | CL500, CL55, CL600, CL65 | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| CLK350, CLK350, CLK550, CLK63 | EZ-Sensor | - | 33200 | 11.5, 1.3 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| | Sensor | - | 28214 | 58, 6.5 | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | |
| | Service Pack | Does Not Include Stem | 20016 | 58, 6.5 | CLK350, CLK500, CLK55 | EZ-Sensor | - | 33200 | 11.5, 1.3 | |
| | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| Service Pack | Includes Valve | 20036 | 53, 6 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | | |
| CLS550, CLS53, E320 | Sensor | - | 20094 | 53, 6 | E350 | Sensor | - | 28214 | 58, 6.5 | |
| | Service Pack | Includes Valve | 20036 | 53, 6 | | Service Pack | Does Not Include Stem | 20016 | 58, 6.5 | |
| E350, E550 | Sensor | W/315 MHz Sensor | 20094 | 53, 6 | | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | |
| | Sensor | W/433 MHz Sensor | 20095 | 53, 6 | | CLS500, CLS55, E320 | Sensor | - | 20094 | 53, 6 |
| | Service Pack | Includes Valve | 20036 | 53, 6 | | | Service Pack | Includes Valve | 20036 | 53, 6 |
| E63 | Sensor | - | 20094 | 53, 6 | E500, E55 | Sensor | W/315 MHz Sensor | 20094 | 53, 6 | |
| | Service Pack | Includes Valve | 20036 | 53, 6 | | Sensor | W/433 MHz Sensor | 20095 | 53, 6 | |
| G500, G55 | EZ-Sensor | - | 33200 | 11.5, 1.3 | | Service Pack | Includes Valve | 20036 | 53, 6 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | ML350, ML500, R350, R500 | Sensor | - | 20094 | 53, 6 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | Includes Valve | 20036 | 53, 6 | |
| | Sensor | Mar. & Newer | 28214 | 58, 6.5 | S350, S430, S500, S55, S600, S65 | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| | Service Pack | Mar. & Newer; Does Not Include Stem | 20016 | 58, 6.5 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| | Service Pack | Mar. & Newer; Includes Stem Only | 20020 | 58, 6.5 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| Service Pack | Mar. & Newer; Includes Stem Only | 20020 | 58, 6.5 | Service Pack | | W/49mm Black Insert | 20039 | 35, 4 | | |
| GL320, GL450, ML320, ML350, ML500, ML63, R320, R350, R500, R63 | Sensor | - | 20095 | 53, 6 | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | |
| | Service Pack | Includes Valve | 20036 | 53, 6 | SL500, SL55, SL600, SL65 | Sensor | - | 20094 | 53, 6 | |
| S550, S600, S63, S65, SL55, SL550, SL600, SL65 | Sensor | - | 20094 | 53, 6 | | Service Pack | Includes Valve | 20036 | 53, 6 | |
| | Service Pack | Includes Valve | 20036 | 53, 6 | SLR McLaren | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| SLK280, SLK350, SLK55 | EZ-Sensor | - | 33200 | 11.5, 1.3 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| | | | | | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| | | | | | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | |

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|--|--------------|------------------------|--------|----------------------------|----------------|------------------------|---|---------|----------------------------|
| 2005 | | | | | 1999 | | | | |
| CL500, CL55, CL600, CL65, E320, E500, E55, S430, S500, S55, S600, SL500, SL55, SL600, SL65, SLR McLaren | Service Pack | Does Not Include Valve | 20023 | 35, 4 | E55 | Service Pack | Does Not Include Valve; Jul. & Newer | 20023 | 35, 4 |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | Service Pack | W/43mm Silver Insert; Jul. & Newer | 20037 | 35, 4 |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | Service Pack | W/48mm Green Insert; Jul. & Newer | 20038 | 35, 4 |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Service Pack | W/49mm Black Insert; Jul. & Newer | 20039 | 35, 4 |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | Service Pack | W/51mm Orange Insert; Jul. & Newer | 20040 | 35, 4 |
| 2004 | | | | | 2011 | | | | |
| CL500, CL55, CL600, E320, E500, E55, S430, S500, S55, S600, SL500, SL55, SL600, SLR McLaren | Service Pack | Does Not Include Valve | 20023 | 35, 4 | Grand Marquis | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Sensor | - | 20315 | 11.5, 1.3 |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | Sensor Clip | - | 22100 | - |
| 2003 | | | | | Mariner, Milan | Sensor Cradle | - | 22101 | - |
| CL500, CL55, CL600, E320, E500, E55, S430, S500, S55, S600, SL500, SL55 | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | Sensor Universal Band | - | 22102 | - |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | Sensor | - | 20315 | 13, 1.5 | |
| 2002-2001 | | | | | Mercury | Service Pack | - | 20018 | 11.5, 1.3 |
| CL500, CL55, CL600, E320, E430, E55, S430, S500, S55, S600, SL500, SL600 | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Sensor | - | 28385 | 27, 3 |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | Sensor Clip | - | 22100 | - | |
| 2000 | | | | | Mariner, Milan | Sensor Cradle | - | 22101 | - |
| CL500, E55, S430, S500 | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | Sensor Universal Band | - | 22102 | - |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | Sensor | - | 28385 | 27, 3 | |
| | | | | | Mountaineer | Sensor Clip | - | 22100 | - |
| | | | | | | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | | | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | | | | | Sensor | - | 28385 | 27, 3 |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|--|------------------------|------------------------|--------------|-------------------------------|------------------------|-------------------------------|------------------------|--------------|-------------------------------|-----------|
| 2009 | | | | | 2008 (cont.) | | | | | |
| Mercury (cont.) | Grand Marquis | EZ-Sensor | - | 33000* | 11.5, 1.3 | Sable (cont.) | Sensor Clip | - | 22100 | - |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor Cradle | - | 22101 | - |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor Universal Band | - | 22102 | - |
| | | Sensor | - | 28385 | 27, 3 | 2007 | | | | |
| | | Sensor Clip | - | 22100 | - | Grand Marquis, Mariner, Milan | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Sensor Cradle | - | 22101 | - | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | Sensor Universal Band | - | 22102 | - | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Mariner | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sensor | - | 28385 | 27, 3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor Clip | - | 22100 | - |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor Cradle | - | 22101 | - |
| Sensor | - | 20315 | 13, 1.5 | Sensor Universal Band | - | 22102 | - | | | |
| Service Pack | - | 20018 | 11.5, 1.3 | Montego | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| Milan, Mountaineer | EZ-Sensor | - | 33000* | | 11.5, 1.3 | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | | 11.5, 1.3 | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | | 62, 7 | Sensor | - | 28390 | 27, 3 | |
| | Sensor | - | 28385 | | 27, 3 | Sensor Clip | - | 22100 | - | |
| | Sensor Clip | - | 22100 | | - | Sensor Cradle | - | 22101 | - | |
| | Sensor Cradle | - | 22101 | | - | Sensor Universal Band | - | 22102 | - | |
| | Sensor Universal Band | - | 22102 | - | Mercury (cont.) | Monterey Van, Mountaineer | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| Sable | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 28385 | 27, 3 | |
| | Sensor | - | 28390 | 27, 3 | | Sensor Clip | - | 22100 | - | |
| | Sensor Clip | - | 22100 | - | | Sensor Cradle | - | 22101 | - | |
| | Sensor Cradle | - | 22101 | - | | Sensor Universal Band | - | 22102 | - | |
| | Sensor Universal Band | - | 22102 | - | 2006 | | | | | |
| 2008 | | | | | Grand Marquis, Mariner | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| Grand Marquis, Mariner, Milan, Mountaineer | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 28385 | 27, 3 | |
| | Sensor | - | 28385 | 27, 3 | | Sensor Clip | - | 22100 | - | |
| | Sensor Clip | - | 22100 | - | | Sensor Cradle | - | 22101 | - | |
| | Sensor Cradle | - | 22101 | - | | Sensor Universal Band | - | 22102 | - | |
| | Sensor Universal Band | - | 22102 | - | Montego | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| Sable | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 28390 | 27, 3 | |
| | Sensor | - | 28390 | 27, 3 | | Sensor Clip | - | 22100 | - | |
| | Sensor | - | 28390 | 27, 3 | | | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|---------------------------|------------------------|----------------------|---------|----------------------------|
| 2006 (cont.) | | | | |
| Montego (cont.) | Sensor Cradle | - | 22101 | - |
| | Sensor Universal Band | - | 22102 | - |
| Monterey Van, Mountaineer | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 28385 | 27, 3 |
| | Sensor Clip | - | 22100 | - |
| | Sensor Cradle | - | 22101 | - |
| | Sensor Universal Band | - | 22102 | - |
| 2005 | | | | |
| Mariner | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | Oct. 3, 2005 & Newer | 28385 | 27, 3 |
| | Sensor Clip | - | 22100 | - |
| | Sensor Cradle | - | 22101 | - |
| | Sensor Universal Band | - | 22102 | - |
| | Monterey Van | Sensor | - | 20135** |
| Monterey Van | Service Pack | - | 20002 | 44, 5 |
| Mountaineer | EZ-Sensor | - | 33100 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 20096** | 44, 5 |
| | Service Pack | - | 20002 | 44, 5 |
| | Monterey Van | Sensor | - | 20135** |
| Monterey Van | Service Pack | - | 20002 | 44, 5 |
| Mountaineer | EZ-Sensor | - | 33100 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 20096** | 44, 5 |
| | Service Pack | - | 20002 | 44, 5 |
| | Mountaineer | EZ-Sensor | - | 33100 |
| Mountaineer | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| Mountaineer | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| Mountaineer | Sensor | - | 20096** | 44, 5 |
| Mountaineer | Service Pack | - | 20002 | 44, 5 |
| 2004 | | | | |
| Monterey Van | Sensor | - | 20135** | 44, 5 |
| Monterey Van | Service Pack | - | 20002 | 44, 5 |
| Mountaineer | EZ-Sensor | - | 33100 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 20096** | 44, 5 |
| | Service Pack | - | 20002 | 44, 5 |
| | Mountaineer | EZ-Sensor | - | 33100 |
| Mountaineer | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| Mountaineer | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| Mountaineer | Sensor | - | 20096** | 44, 5 |
| Mountaineer | Service Pack | - | 20002 | 44, 5 |
| 2003-2002 | | | | |
| Mountaineer | EZ-Sensor | - | 33100 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 20096** | 44, 5 |
| | Service Pack | - | 20002 | 44, 5 |
| | Mountaineer | EZ-Sensor | - | 33100 |

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|-------------------|------------------------|---------------------------|---------------------------|----------------------------|------------|
| 2013-2012 | | | | | |
| Cooper | Sensor | Includes Transmitter Only | 28081 | 35, 4 | |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | |
| 2011 | | | | | |
| Cooper | Sensor | Includes Transmitter Only | 28081 | 35, 4 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | |
| | Cooper | Sensor | Includes Transmitter Only | 28081 | 35, 4 |
| 2010 | | | | | |
| Cooper | Sensor | Includes Transmitter Only | 28081 | 35, 4 | |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | |
| 2009-2008 | | | | | |
| Cooper | Sensor | Includes Transmitter Only | 20083 | 35, 4 | |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | |
| 2014 | | | | | |
| Lancer, Outlander | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 28096 | 71, 8 | |
| | Service Pack | - | 20030 | 71, 8 | |
| | Lancer, Outlander | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| 2013 | | | | | |
| Galant | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | W/Alloy Wheels | 20034** | 49, 5.5 | |
| | Sensor | W/Steel Wheels | 28129 | 45-53, 5-6 | |
| | Service Pack | W/Alloy Wheels | 20003 | 45-53, 5-6 | |
| | Service Pack | W/Steel Wheels | 20010 | 45-53, 5-6 | |
| | Lancer, Outlander | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| Lancer, Outlander | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 28096 | 71, 8 | |
| | Service Pack | - | 20030 | 71, 8 | |
| | 2012 | | | | |
| | Eclipse | Sensor | W/Steel Wheels | 28129 | 45-53, 5-6 |
| Service Pack | | - | 20003 | 45-53, 5-6 | |

* Programming Tool Required ** Magnet Required to Activate Sensor

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | |
|---------------------------|-------------------------|------------------------|----------------|-------------------------------|--------------------------|--------------------------|---|---|-------------------------------|------------|-----------|
| 2012 (cont.) | | | | | 2010 | | | | | | |
| Mitsubishi (cont.) | Endeavor, Galant | EZ-Sensor | - | 33000* | 11.5, 1.3 | Eclipse, Endeavor | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | | Sensor | W/Alloy Wheels | 20034** | 49, 5.5 | | Sensor | - | 20034** | 45-53, 5-6 | |
| | | Sensor | W/Steel Wheels | 28129 | 45-53, 5-6 | | Service Pack | - | 20003 | 45-53, 5-6 | |
| | | Service Pack | W/Alloy Wheels | 20003 | 45-53, 5-6 | | Galant | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Service Pack | W/Steel Wheels | 20010 | 45-53, 5-6 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Lancer | EZ-Sensor | - | 33000* | 11.5, 1.3 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Sensor | | W/Alloy Wheels | 20034** | 49, 5.5 | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sensor | | W/Steel Wheels | 28129 | 45-53, 5-6 | |
| | | Sensor | W/Alloy Wheels | 20398 | 11.5, 1.3 | Service Pack | | W/Alloy Wheels | 20003 | 45-53, 5-6 | |
| | | Sensor | W/Steel Wheels | 28096 | 71, 8 | Service Pack | | W/Steel Wheels | 20010 | 45-53, 5-6 | |
| | | Service Pack | W/Alloy Wheels | 20018 | 11.5, 1.3 | Lancer, Outlander | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | |
| | | Service Pack | W/Steel Wheels | 20030 | 71, 8 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Outlander | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 28096 | 71, 8 | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20030 | 71, 8 | |
| | | Sensor | - | 28096 | 71, 8 | | 2009-2008 | | | | |
| | Service Pack | - | 20030 | 71, 8 | Eclipse, Endeavor | | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | 2011 | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| Eclipse | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 20034** | 45-53, 5-6 | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20003 | 45-53, 5-6 | | |
| | Sensor | - | 20034** | 49, 5.5 | | Galant | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Service Pack | - | 20003 | 45-53, 5-6 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| Endeavor, Galant | EZ-Sensor | - | 33000* | 11.5, 1.3 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Sensor | | W/Alloy Wheels | 20034** | 45-53, 5-6 | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sensor | | W/Steel Wheels | 28129 | 45-53, 5-6 | | |
| | Sensor | W/Alloy Wheels | 20034** | 49, 5.5 | Service Pack | | W/Alloy Wheels | 20003 | 45-53, 5-6 | | |
| | Sensor | W/Steel Wheels | 28129 | 45-53, 5-6 | Service Pack | | W/Steel Wheels | 20010 | 45-53, 5-6 | | |
| | Service Pack | W/Alloy Wheels | 20003 | 45-53, 5-6 | Lancer, Outlander | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | | |
| | Service Pack | W/Steel Wheels | 20010 | 45-53, 5-6 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| Lancer | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 28096 | 71, 8 | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20030 | 71, 8 | | |
| | Sensor | W/Alloy Wheels | 20398 | 11.5, 1.3 | | Raider | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | |
| | Sensor | W/Steel Wheels | 28096 | 71, 8 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | W/Alloy Wheels | 20030 | 71, 8 | 2012 (cont.) | | | | | | |
| | Service Pack | W/Steel Wheels | 20030 | 71, 8 | Outlander | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| EZ-Sensor | - | 33000* | 11.5, 1.3 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | | | |
| EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | | | |
| EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sensor | | - | 28096 | 71, 8 | | | |
| Sensor | - | 28096 | 71, 8 | Service Pack | | - | 20030 | 71, 8 | | | |
| Service Pack | - | 20030 | 71, 8 | 2010 | | | | | | | |

* Programming Tool Required ** Magnet Required to Activate Sensor

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|--------------------------|------------------------|---|------------|----------------------------|-------------------------|------------------------|--|--------------|----------------------------|-----------|
| 2009-2008 (cont.) | | | | | 2006 (cont.) | | | | | |
| Raider (cont.) | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Endeavor (cont.) | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 28154 | 58, 6.5 | | Sensor | Aug. & Older | 20028** | 45-53, 5-6 | |
| | Sensor | - | 28461 | 11.5, 1.3 | | Sensor | Sept. 1 & Newer | 20034** | 45-53, 5-6 | |
| | Service Pack | Does Not Include Stem | 20013 | 58, 6.5 | | Service Pack | - | 20003 | 45-53, 5-6 | |
| | Service Pack | Includes Stem Only | 20020 | 58, 6.5 | | Galant | EZ-Sensor Service Pack | - | 33100 | 11.5, 1.3 |
| 2007 | | | | | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | |
| Eclipse | EZ-Sensor | - | 33000* | 11.5, 1.3 | EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Sensor | | - | 20028** | 45-53, 5-6 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Service Pack | | - | 20003 | 45-53, 5-6 | |
| | Sensor | W/Alloy Wheels | 20034** | 45-53, 5-6 | Montero | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Sensor | W/Steel Wheels | 28129 | 45-53, 5-6 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | W/Alloy Wheels | 20003 | 45-53, 5-6 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | Service Pack | W/Steel Wheels | 20010 | 45-53, 5-6 | | Sensor | - | 20034** | 45-53, 5-6 | |
| | Service Pack | W/Steel Wheels | 20010 | 45-53, 5-6 | | Service Pack | - | 20003 | 45-53, 5-6 | |
| Endeavor | EZ-Sensor | W/315 MHz Sensor | 33000* | 11.5, 1.3 | 2005-2004 | | | | | |
| | EZ-Sensor | W/433 MHz Sensor | 33100 | 11.5, 1.3 | Endeavor, Galant | EZ-Sensor | - | 33100 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 20028** | 45-53, 5-6 | Sensor | - | 20028** | 45-53, 5-6 | | |
| Service Pack | - | 20003 | 45-53, 5-6 | Service Pack | - | 20003 | 45-53, 5-6 | | | |
| Galant | EZ-Sensor | - | 33000* | 11.5, 1.3 | Montero | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | Sensor | W/Alloy Wheels | 20034** | 45-53, 5-6 | | Sensor | - | 20034** | 45-53, 5-6 | |
| | Sensor | W/Steel Wheels | 28129 | 45-53, 5-6 | | Service Pack | - | 20003 | 45-53, 5-6 | |
| | Service Pack | W/Alloy Wheels | 20003 | 45-53, 5-6 | 2003 | | | | | |
| | Service Pack | W/Steel Wheels | 20010 | 45-53, 5-6 | Montero | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Service Pack | W/Steel Wheels | 20010 | 45-53, 5-6 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| Outlander | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 20034** | 45-53, 5-6 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | Service Pack | - | 20003 | 45-53, 5-6 | |
| | Sensor | - | 28096 | 71, 8 | 2014 | | | | | |
| | Service Pack | - | 20030 | 71, 8 | GT-R | EZ-Sensor | When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000 | 33000* | 11.5, 1.3 | |
| 2006 | | | | | | Endeavor | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| Eclipse | EZ-Sensor | - | 33000* | 11.5, 1.3 | | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | Sensor | - | 28204 | 49, 5.5 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | | Service Pack | - | 20014 | 71, 8 |
| | Sensor | W/Alloy Wheels | 20034** | 45-53, 5-6 | | | Pathfinder | Sensor | - | |
| | Sensor | W/Steel Wheels | 28129 | 45-53, 5-6 | | Service Pack | | - | | |
| | Service Pack | W/Alloy Wheels | 20003 | 45-53, 5-6 | | | | | | |
| Service Pack | W/Steel Wheels | 20010 | 45-53, 5-6 | | | | | | | |

* Programming Tool Required ** Magnet Required to Activate Sensor

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|------------------------|------------------------|--|-----------|-------------------------------|--|------------------------|--------------|-----------------------|-------------------------------|
| 2014 (cont.) | | | | | 2013 (cont.) | | | | |
| Versa (Ikey) | Sensor | - | | | Juke (IKey), Juke (non-IKey), Leaf, Maxima | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Service Pack | - | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| Versa (non-Ikey) | Sensor | - | | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Service Pack | - | | | | Sensor | - | | |
| 2013 | | | | | | Service Pack | - | | |
| 370Z | EZ-Sensor | - | 33000* | 11.5, 1.3 | Maxima GCC | EZ-Sensor | - | 33100 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | | | | Sensor | - | | |
| | Service Pack | - | 20032 | 50 - 60, 5.6 - 7.9 | | Service Pack | - | | |
| Altima | Sensor | - | | | Murano | Sensor | - | | |
| | Service Pack | - | | | | Service Pack | - | | |
| Armada | EZ-Sensor | - | 33000* | 11.5, 1.3 | NV, NV-200 | Sensor | - | 28342 | 68, 7.7 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | - | 20014 | 71, 8 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Pathfinder | Sensor | - | | |
| | Sensor | - | 28204 | 49, 5.5 | | Service Pack | - | | |
| | Service Pack | - | 20014 | 71, 8 | Quest, Rogue | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| EZ-Sensor | - | 33000* | 11.5, 1.3 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | |
| EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sensor | | - | | | |
| Sensor | - | | | Service Pack | | - | | | |
| Cube (IKey) | Service Pack | - | | | Sentra, Titan | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 28204 | 49, 5.5 |
| | Sensor | - | | | | Service Pack | - | 20014 | 71, 8 |
| Cube (non-IKey) | Service Pack | - | | | Versa (Ikey), Versa (non-Ikey) | Sensor | - | | |
| | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Service Pack | - | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Xterra | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| Sensor | - | 28204 | 49, 5.5 | Sensor | | - | 28204 | 49, 5.5 | |
| Service Pack | - | 20014 | 71, 8 | Service Pack | | - | 20014 | 71, 8 | |
| Frontier | EZ-Sensor | - | 33000* | 11.5, 1.3 | 2012 | | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | 370Z | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Sensor | - | 28204 | 49, 5.5 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Service Pack | - | 20014 | 71, 8 | | Sensor | - | | |
| | | | | Service Pack | | - | 20032 | 50 - 60, 5.6 - 7.9 | |
| GT-R | EZ-Sensor | When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000 | 33000* | 11.5, 1.3 | | | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | | | |
| | Sensor | - | 28204 | 49, 5.5 | | | | | |
| | Service Pack | - | 20014 | 71, 8 | | | | | |

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|------------------------|------------------------|------------------------|--|-------------------------------|----------------------|-------------------------|------------------------|--------------|-------------------------------|-----------|
| 2012 (cont.) | | | | | 2012 (cont.) | | | | | |
| Nissan (cont.) | Altima | EZ-Sensor | - | 33000* | 11.5, 1.3 | Juke (non-IKey) (cont.) | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 28204 | 49, 5.5 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20014 | 49, 5.5 |
| | | Sensor | - | 28204 | 66, 7.5 | Leaf | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Sensor | - | 28204 | 49, 5.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | Service Pack | - | 20014 | 71, 8 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Armada | EZ-Sensor | - | 33000* | 11.5, 1.3 | Sensor | - | | | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | - | | | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Maxima, Murano | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Sensor | - | 28204 | 49, 5.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | Service Pack | - | 20014 | 71, 8 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sensor | - | 28204 | 49, 5.5 |
| | Cube (IKey) | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | - | 20014 | 71, 8 | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | NV | Sensor | - | 28342 | 68, 7.7 |
| | | Sensor | - | | | | Service Pack | - | 20014 | 71, 8 |
| | | Service Pack | - | | | Pathfinder | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sensor | | - | 28204 | 49, 5.5 | |
| | Cube (non-IKey) | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | - | 20014 | 71, 8 | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Quest | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Sensor | - | 28204 | 49, 5.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | Service Pack | - | 20014 | 49, 5.5 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | Service Pack | - | 20014 | 49, 5.5 | | Sensor | - | | |
| Frontier | | EZ-Sensor | - | 33000* | 11.5, 1.3 | Service Pack | - | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Rogue | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Sensor | - | 28204 | 49, 5.5 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | - | 20014 | 71, 8 | | Sensor | - | 28204 | 49, 5.5 | |
| | GT-R | EZ-Sensor | When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000 | 33000* | 11.5, 1.3 | Service Pack | - | 20014 | 71, 8 | |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | Sentra | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| Sensor | | - | 28204 | 49, 5.5 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| Service Pack | | - | 20014 | 71, 8 | | Sensor | - | 28204 | 66, 7.5 | |
| Juke (IKey) | | EZ-Sensor | - | 33000* | 11.5, 1.3 | Sensor | - | 28204 | 49, 5.5 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | - | 20014 | 71, 8 | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Titan, Versa, Xterra | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Sensor | - | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | - | | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sensor | - | 28204 | 49, 5.5 | |
| Juke (non-IKey) | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | - | 20014 | 71, 8 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|------------------------|----------------------------------|------------------------|--|-------------------------------|------------------------|--------------------------------|------------------------|--------------|-------------------------------|-----------|
| 2011 | | | | | 2011 (cont.) | | | | | |
| Nissan (cont.) | 370Z | EZ-Sensor | - | 33000* | 11.5, 1.3 | Juke (non-IKey) (cont.) | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 28204 | 49, 5.5 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20014 | 49, 5.5 |
| | | Sensor | - | | | Leaf | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Service Pack | - | 20032 | 50 - 60, 5.6 - 7.9 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | | | | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| | Altima | EZ-Sensor | - | 33000* | 11.5, 1.3 | Sensor | - | | | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | - | | | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Maxima | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Sensor | - | 28204 | 49, 5.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | Service Pack | - | 20014 | 71, 8 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Armada | EZ-Sensor | - | 33000* | 11.5, 1.3 | Sensor | - | 28204 | 49, 5.5 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | - | 20014 | 71, 8 | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Murano | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Sensor | - | 28204 | 49, 5.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | Service Pack | - | 20014 | 49, 5.5 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Cube (IKey) | EZ-Sensor | - | 33000* | 11.5, 1.3 | Sensor | - | 28204 | 49, 5.5 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | - | 20014 | 49, 5.5 | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | NV | Sensor | - | 28342 | 68, 7.7 |
| | | Sensor | - | | | | Service Pack | - | 20014 | 71, 8 |
| | | Service Pack | - | | | Pathfinder | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Cube (non-IKey), Frontier | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 28204 | 49, 5.5 |
| | | Sensor | - | 28204 | 49, 5.5 | | Service Pack | - | 20014 | 49, 5.5 |
| | | Service Pack | - | 20014 | 49, 5.5 | Quest | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | GT-R | EZ-Sensor | When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000 | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | Sensor | | - | | | |
| Sensor | | - | 28204 | 49, 5.5 | Service Pack | - | | | | |
| Service Pack | | - | 20014 | 71, 8 | Rogue | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| Juke (IKey) | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 28204 | 49, 5.5 | |
| | Sensor | - | | | | Service Pack | - | 20014 | 49, 5.5 | |
| | Service Pack | - | | | Sentra | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| Juke (non-IKey) | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 28204 | 49, 5.5 | |
| | Sensor | - | | | | Service Pack | - | 20014 | 71, 8 | |
| | Service Pack | - | | | | | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|---------------------|------------------------|--------------|---------|----------------------------|-------------------------|------------------------|--|-----------|----------------------------|
| 2011 (cont.) | | | | | 2010 (cont.) | | | | |
| Titan | EZ-Sensor | - | 33000* | 11.5, 1.3 | Frontier (cont.) | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 28204 | 49, 5.5 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20014 | 49, 5.5 |
| | Sensor | - | 28204 | 49, 5.5 | GT-R | EZ-Sensor | When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000 | 33000* | 11.5, 1.3 |
| | Service Pack | - | 20014 | 49, 5.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| Versa | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 28204 | 71, 8 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20014 | 71, 8 |
| | Sensor | - | 28204 | 49, 5.5 | Maxima | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| Service Pack | - | 20014 | 71, 8 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | |
| Xterra | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 28204 | 68, 7.7 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20014 | 68, 7.7 |
| | Sensor | - | 28204 | 49, 5.5 | Murano | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| Service Pack | - | 20014 | 49, 5.5 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | |
| 2010 | | | | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| 370Z | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sensor | - | 28204 | 35, 4 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | - | 20014 | 49, 5.5 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Pathfinder | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Sensor | - | 28210 | 71, 8 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Sensor | - | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | | 20032 | 50 - 60, 5.6 - 7.9 | Sensor | - | 28204 | 49, 5.5 | |
| | Service Pack | - | 20014 | 71, 8 | Service Pack | - | 20014 | 49, 5.5 | |
| Altima | EZ-Sensor | - | 33000* | 11.5, 1.3 | Sentra | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 28204 | 71, 8 | | Sensor | - | 28204 | 68, 7.7 |
| | Service Pack | - | 20014 | 71, 8 | | Service Pack | - | 20014 | 68, 7.7 |
| Armada | EZ-Sensor | - | 33000* | 11.5, 1.3 | Titan | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 28204 | 49, 5.5 | | Sensor | - | 28204 | 49, 5.5 |
| | Service Pack | - | 20014 | 49, 5.5 | | Service Pack | - | 20014 | 49, 5.5 |
| Cube | EZ-Sensor | - | 33000* | 11.5, 1.3 | Versa | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 28204 | 71, 8 | | Sensor | - | 28204 | 71, 8 |
| | Service Pack | - | 20014 | 71, 8 | | Service Pack | - | 20014 | 71, 8 |
| Frontier | EZ-Sensor | - | 33000* | 11.5, 1.3 | | | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|------------------------------------|------------------------|--------------|--------|-------------------------------|--------------------------|------------------------|----------------|---------|-------------------------------|
| 2010 (cont.) | | | | | 2009 (cont.) | | | | |
| Xterra | EZ-Sensor | - | 33000* | 11.5, 1.3 | Rogue, Sentra | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 28204 | 49, 5.5 | | Sensor | - | 28204 | 68, 7.7 |
| | Service Pack | - | 20014 | 49, 5.5 | | Service Pack | - | 20014 | 68, 7.7 |
| 2009 | | | | | Titan | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| 350Z, 370Z, Altima | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 28204 | 49, 5.5 |
| | Sensor | - | 28204 | 71, 8 | | Service Pack | - | 20014 | 49, 5.5 |
| | Service Pack | - | 20014 | 71, 8 | Versa | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| Armada | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 28204 | 71, 8 |
| | Sensor | - | 28204 | 49, 5.5 | | Service Pack | - | 20014 | 71, 8 |
| | Service Pack | - | 20014 | 49, 5.5 | Xterra | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| Cube | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 28204 | 49, 5.5 |
| | Sensor | - | 28204 | 71, 8 | | Service Pack | - | 20014 | 49, 5.5 |
| | Service Pack | - | 20014 | 71, 8 | 2008 | | | | |
| Frontier | EZ-Sensor | - | 33000* | 11.5, 1.3 | 350Z, Altima | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 28204 | 49, 5.5 | | Sensor | - | 28204 | 71, 8 |
| | Service Pack | - | 20014 | 49, 5.5 | | Service Pack | - | 20014 | 71, 8 |
| GT-R | EZ-Sensor | - | 33000* | 11.5, 1.3 | Armada | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 28204 | 71, 8 | | Sensor | SE | 20161 | 49, 5.5 |
| | Service Pack | - | 20014 | 71, 8 | | Sensor | LE | 28204 | 49, 5.5 |
| Maxima, Murano | EZ-Sensor | - | 33000* | 11.5, 1.3 | Service Pack | SE | 20007 | 49, 5.5 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | LE | 20014 | 49, 5.5 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Frontier | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Sensor | - | 28204 | 68, 7.7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Service Pack | - | 20014 | 68, 7.7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| Path- finder, Quest | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sensor | W/Alloy Wheels | 20161 | 49, 5.5 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | W/Steel Wheels | 28204 | 49, 5.5 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Service Pack | W/Alloy Wheels | 20007 | 49, 5.5 | |
| | Sensor | - | 28204 | 49, 5.5 | Service Pack | W/Steel Wheels | 20014 | 49, 5.5 | |
| | Service Pack | - | 20014 | 49, 5.5 | | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|------------------------|------------------------|-------------------------|--------|-------------------------------|------------------------|------------------------|----------------|--------------|-------------------------------|-----------|
| 2007 (cont.) | | | | | 2006 (cont.) | | | | | |
| Titan | EZ-Sensor | - | 33000* | 11.5, 1.3 | Maxima (cont.) | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | Jun. & Newer | 20161 | 49, 5.5 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | Jun. & Newer | 20007 | 49, 5.5 | |
| | Sensor | Mar. & Older | 20161 | 49, 5.5 | Murano | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Sensor | Apr. 1 & Newer | 28204 | 49, 5.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | Mar. & Older | 20007 | 49, 5.5 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | Apr. 1 & Newer | 20014 | 49, 5.5 | | Sensor | - | 20064 | 66, 7.5 . | |
| | Versa | EZ-Sensor | - | 33000* | 11.5, 1.3 | Service Pack | - | 20007 | 66, 7.5 . | |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | Pathfinder | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| Sensor | | OEM Part No. 40700JA01A | 28167 | 71, 8 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| Sensor | | OEM Part No. 40700JA01B | 28204 | 71, 8 | | Sensor | - | 20161 | 49, 5.5 | |
| Service Pack | | - | 20014 | 71, 8 | Service Pack | - | 20007 | 49, 5.5 | | |
| Xterra | EZ-Sensor | - | 33000* | 11.5, 1.3 | Quest | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | OEM Part No. 40700JA01A | 28167 | 49, 5.5 | | Sensor | W/Steel Wheels | 20069 | 78, 8.8 | |
| | Sensor | OEM Part No. 40700JA01B | 28204 | 49, 5.5 | | Sensor | W/Alloy Wheels | 20161 | 78, 8.8 | |
| | Service Pack | - | 20014 | 49, 5.5 | | Service Pack | W/Steel Wheels | 20005 | 78, 8.8 | |
| 2006 | | | | | | 2005 | | | | |
| 350Z | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Titan | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 20064 | 49, 5.5 | Sensor | | - | 20161 | 49, 5.5 | |
| | Service Pack | - | 20007 | 49, 5.5 | Service Pack | | - | 20007 | 49, 5.5 | |
| | Altima | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Xterra | EZ-Sensor | - | 33000* |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | | Rubber Valve | 20018 | 11.5, 1.3 |
| EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | EZ-Sensor Service Pack | | | Almnm. Valve | 34000 | 62, 7 |
| Sensor | | Oct. 1 & Newer | 28204 | 71, 8 | Sensor | Submodel X | | 20069 | 49, 5.5 | |
| Service Pack | | Oct. 1 & Newer | 20014 | 71, 8 | Sensor | Exc. Submodel X | | 20161 | 49, 5.5 | |
| Armada, Frontier | | EZ-Sensor | - | 33000* | 11.5, 1.3 | Service Pack | | Submodel X | 20005 | 49, 5.5 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | Exc. Submodel X | | 20007 | 49, 5.5 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | 2005 | | | | | |
| | Sensor | W/Steel Wheels | 20069 | 49, 5.5 | 350Z | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Sensor | W/Alloy Wheels | 20161 | 49, 5.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | W/Steel Wheels | 20005 | 49, 5.5 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | W/Alloy Wheels | 20007 | 49, 5.5 | | Sensor | - | 20064 | 49, 5.5 | |
| | Service Pack | W/Alloy Wheels | 20007 | 49, 5.5 | | Service Pack | - | 20007 | 49, 5.5 | |
| Maxima | EZ-Sensor | - | 33000* | 11.5, 1.3 | | | | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|-------------------------|------------------------|----------------|--------|----------------------------|---------------------|------------------------|---------------------------|------------------------|----------------------------|-----------|
| 2005 (cont.) | | | | | 2004 (cont.) | | | | | |
| Armada, Frontier | EZ-Sensor | - | 33000* | 11.5, 1.3 | 350Z (cont.) | Sensor | - | 20064 | 49, 5.5 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | - | 20007 | 49, 5.5 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Frontier | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Sensor | W/Steel Wheels | 20069 | 49, 5.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Sensor | W/Alloy Wheels | 20161 | 49, 5.5 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | W/Steel Wheels | 20005 | 49, 5.5 | | Sensor | - | 20064 | 36-60, 4.1-6.8 | |
| | Service Pack | W/Alloy Wheels | 20007 | 49, 5.5 | | Service Pack | - | 20007 | 36-60, 4.1-6.8 | |
| Murano | EZ-Sensor | - | 33000* | 11.5, 1.3 | Murano | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 20064 | 66, 7.5 . | | Sensor | - | 20064 | 66, 7.5 . | |
| | Service Pack | - | 20007 | 66, 7.5 . | | Service Pack | - | 20007 | 66, 7.5 . | |
| Pathfinder | EZ-Sensor | - | 33000* | 11.5, 1.3 | Pathfinder | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | - | 20161 | 49, 5.5 | | Sensor | Exc. Armada; Jul. & Older | 20064 | 49, 5.5 | |
| Quest | EZ-Sensor | - | 33000* | 11.5, 1.3 | Quest | Sensor | Armada | 20069 | 49, 5.5 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | Exc. Armada; Aug. & Newer | 20069 | 49, 5.5 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | Armada | 20005 | 49, 5.5 | |
| | Sensor | W/Steel Wheels | 20069 | 78, 8.8 | | Service Pack | Exc. Armada; Aug. & Newer | 20005 | 49, 5.5 | |
| | Sensor | W/Alloy Wheels | 20161 | 78, 8.8 | | Service Pack | Exc. Armada; Jul. & Older | 20007 | 49, 5.5 | |
| | Service Pack | W/Steel Wheels | 20005 | 78, 8.8 | | Quest | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Service Pack | W/Alloy Wheels | 20007 | 78, 8.8 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Titan | EZ-Sensor | - | 33000* | | 11.5, 1.3 | Titan | EZ-Sensor Service Pack | Almnm. Valve | 34000 |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | Sensor | - | | 20069 | 78, 8.8 | |
| EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | Service Pack | - | | 20005 | 78, 8.8 | |
| Sensor | | Mar. & Older | 20069 | 49, 5.5 | Titan | EZ-Sensor | | - | 33000* | 11.5, 1.3 |
| Sensor | | Apr. 1 & Newer | 20161 | 49, 5.5 | | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 |
| Service Pack | | Mar. & Older | 20005 | 49, 5.5 | | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 |
| Xterra | | EZ-Sensor | - | 33000* | 11.5, 1.3 | Xterra | | Sensor | - | 20069 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | | - | 20005 | 49, 5.5 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Xterra | | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Sensor | - | 20161 | 36-60, 4.1-6.8 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Service Pack | - | 20007 | 36-60, 4.1-6.8 | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | 350Z | EZ-Sensor | - | 33000* | 11.5, 1.3 | | 350Z | Sensor | - | 20064 |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | - | | 20007 | 36-60, 4.1-6.8 | |
| EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | | | | | | |
| | | | | | | | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|------------------------|------------------------|------------------------|---|-------------------------------|------------------------|----------------------------|------------------------|------------------|-------------------------------|-----------|
| 2003 | | | | | 2010 | | | | | |
| Nissan (cont.) | 350Z | EZ-Sensor | - | 33000* | 11.5, 1.3 | G3, G5, G6, G8 | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | | Sensor | - | 20064 | 49, 5.5 | | Sensor | - | 20153 | 11.5, 1.3 |
| | | Service Pack | - | 20007 | 49, 5.5 | | Service Pack | - | 20008 | 11.5, 1.3 |
| | Frontier | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Solstice | EZ-Sensor | - | 33000* |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | Rubber Valve | | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | EZ-Sensor Service Pack | Almm. Valve | | 34000 | 62, 7 | |
| | Sensor | - | 20064 | 36-60, 4.1-6.8 | Sensor | - | | 20158 | 62, 7 | |
| | Service Pack | - | 20007 | 36-60, 4.1-6.8 | Service Pack | W/Schrader Sensor | | 20004 | 62, 7 | |
| | Service Pack | - | 20007 | 36-60, 4.1-6.8 | Service Pack | W/Siemens Sensor | | 20030 | 80, 9 | |
| | Murano | EZ-Sensor | - | 33000* | 11.5, 1.3 | Vibe | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | | Sensor | - | 20064 | 66, 7.5 | | Sensor | - | 28360 | 35, 4 |
| | | Service Pack | - | 20007 | 66, 7.5 | | Service Pack | - | 20032 | 35, 4 |
| | Pathfinder | EZ-Sensor | - | 33000* | 11.5, 1.3 | 2009 | | | | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | G3, G3 Wave, G5, G6, G8 | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | Sensor | - | 20064 | 49, 5.5 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | | Service Pack | - | 20007 | 49, 5.5 | | Sensor | - | 20153 | 11.5, 1.3 |
| | Service Pack | - | 20007 | 49, 5.5 | Service Pack | | - | 20008 | 11.5, 1.3 | |
| | Xterra | EZ-Sensor | - | 33000* | 11.5, 1.3 | Montana, Solstice, Torrent | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | |
| Sensor | | - | 20064 | 36-60, 4.1-6.8 | Sensor | | - | 20158 | 62, 7 | |
| Service Pack | | - | 20007 | 36-60, 4.1-6.8 | Service Pack | | W/Schrader Sensor | 20004 | 62, 7 | |
| Plymouth | 2002 | | | | | Vibe | Service Pack | W/Siemens Sensor | 20030 | 80, 9 |
| | Prowler | EZ-Sensor | Caution: Pressure by location vehicles not supported by EZ-sensor | 33100 | 11.5, 1.3 | | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | | Sensor | - | 20028** | 35, 4 | | Sensor | - | 28360 | 35, 4 |
| | | Service Pack | W/Schrader Sensor | 20003 | 35, 4 | Service Pack | - | 20032 | 35, 4 | |
| | | Service Pack | W/Siemens Sensor | 20030 | 35, 4 | Service Pack | W/Siemens Sensor | 20030 | 80, 9 | |
| | 2001-1999 | | | | | Wave | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Prowler | Sensor | - | 28004 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | Service Pack | W/Red Sensor Body | 20003 | 35, 4 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | | Service Pack | W/Black Sensor Body | 20012 | 35, 4 | | Sensor | - | 20153 | 11.5, 1.3 |
| Service Pack | - | 20008 | 11.5, 1.3 | Service Pack | - | | 20008 | 11.5, 1.3 | | |
| 1997 | | | | | | | | | | |
| Prowler | Sensor | - | 28004 | 35, 4 | | | | | | |
| | Service Pack | W/Red Sensor Body | 20003 | 35, 4 | | | | | | |
| | Service Pack | W/Black Sensor Body | 20012 | 35, 4 | | | | | | |

* Programming Tool Required ** Magnet Required to Activate Sensor

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|----------------------------|------------------------|---|--------|-------------------------------|---------------------|------------------------|---------------------------|---------------------------|-------------------------------|
| 2008 | | | | | 2014-2012 | | | | |
| G5, G6 | EZ-Sensor | - | 33000* | 11.5, 1.3 | Cayenne | Sensor | Includes Transmitter Only | 20103 | 35, 4 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 |
| | Sensor | - | 20158 | 62, 7 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 |
| | Service Pack | W/Schrader Sensor | 20004 | 62, 7 | | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 |
| | Service Pack | W/Siemens Sensor | 20030 | 80, 9 | 2011 | | | | |
| | G8 | EZ-Sensor | - | 33000* | 11.5, 1.3 | 911, Boxster | Sensor | Includes Transmitter Only | 20077 |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | | Does Not Include Valve | 20023 | 35, 4 |
| EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | Service Pack | | W/43mm Silver Insert | 20037 | 35, 4 |
| Sensor | | - | 20153 | 62, 7 | Service Pack | | W/48mm Green Insert | 20038 | 35, 4 |
| Service Pack | | - | 20008 | 62, 7 | Service Pack | | W/49mm Black Insert | 20039 | 35, 4 |
| Service Pack | | W/Siemens Sensor | 20030 | 80, 9 | Service Pack | | W/51mm Orange Insert | 20040 | 35, 4 |
| Grand Prix | EZ-Sensor | - | 33000* | 11.5, 1.3 | Cayenne | Sensor | Includes Transmitter Only | 20103 | 35, 4 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 |
| | Sensor | - | 20153 | 62, 7 | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 |
| | Sensor | Snap-In Style Only; W/Rubber Valve Stem | 20153 | 11.5, 1.3 | Cayman | Sensor | Includes Transmitter Only | 20077 | 35, 4 |
| | Sensor | Clamp-In Style Only; W/Almm. Valve Stem | 20158 | 62, 7 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 |
| | Service Pack | Clamp-In Style Only; W/Almm. Valve Stem | 20004 | 62, 7 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 |
| | Service Pack | Snap-In Style Only; W/Rubber Valve Stem | 20008 | 11.5, 1.3 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 |
| Montana, Solstice, Torrent | EZ-Sensor | - | 33000* | 11.5, 1.3 | Panamera | Sensor | Includes Transmitter Only | 28087 | 31-40, 3.5-4.5 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | W/43mm Silver Insert | 20037 | 31-40, 3.5-4.5 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | Service Pack | W/48mm Green Insert | 20038 | 31-40, 3.5-4.5 |
| | Sensor | - | 20158 | 62, 7 | | Service Pack | W/49mm Black Insert | 20039 | 31-40, 3.5-4.5 |
| | Service Pack | W/Schrader Sensor | 20004 | 62, 7 | | Service Pack | W/51mm Orange Insert | 20040 | 31-40, 3.5-4.5 |
| | Service Pack | W/Siemens Sensor | 20030 | 80, 9 | | 2010 | | | |
| | Vibe | EZ-Sensor | - | 33000* | 11.5, 1.3 | 911, Boxster | Sensor | Includes Transmitter Only | 28087 |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | | Does Not Include Valve | 20023 | 31-40, 3.5-4.5 |
| EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | Service Pack | | W/43mm Silver Insert | 20037 | 31-40, 3.5-4.5 |
| Sensor | | - | 28360 | 35, 4 | Service Pack | | W/48mm Green Insert | 20038 | 31-40, 3.5-4.5 |
| Service Pack | | - | 20032 | 35, 4 | Service Pack | | W/49mm Black Insert | 20039 | 31-40, 3.5-4.5 |
| Service Pack | | W/Siemens Sensor | 20030 | 80, 9 | Service Pack | | W/51mm Orange Insert | 20040 | 31-40, 3.5-4.5 |
| Wave | EZ-Sensor | - | 33000* | 11.5, 1.3 | Cayenne | Service Pack | Does Not Include Valve | 20023 | 31-40, 3.5-4.5 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | W/43mm Silver Insert | 20037 | 31-40, 3.5-4.5 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | Service Pack | W/48mm Green Insert | 20038 | 31-40, 3.5-4.5 |
| | Sensor | - | 20153 | 11.5, 1.3 | | Service Pack | W/49mm Black Insert | 20039 | 31-40, 3.5-4.5 |
| | Service Pack | - | 20008 | 11.5, 1.3 | | Service Pack | W/51mm Orange Insert | 20040 | 31-40, 3.5-4.5 |
| | Service Pack | W/Siemens Sensor | 20030 | 80, 9 | | 2007 | | | |
| Grand Prix, Torrent | EZ-Sensor | - | 33000* | 11.5, 1.3 | Grand Prix, Torrent | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | Sensor | - | 20158 | 62, 7 | | Sensor | - | 20158 | 62, 7 |
| | Service Pack | W/Schrader Sensor | 20004 | 62, 7 | | Service Pack | W/Schrader Sensor | 20004 | 62, 7 |
| | Service Pack | W/Siemens Sensor | 20030 | 80, 9 | | Service Pack | W/Siemens Sensor | 20030 | 80, 9 |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|-------------------------------|--------------|---------------------------|--------|-------------------------------|---|--------------|------------------------|--------|-------------------------------|-----------|
| 2010 (cont.) | | | | | 2006 | | | | | |
| Cayman, Panamera | Sensor | Includes Transmitter Only | 28087 | 31-40, 3.5-4.5 | 911, Boxster, Carrera GT, Cayenne, Cayman | Service Pack | Does Not Include Valve | 20023 | 31-40, 3.5-4.5 | |
| | Service Pack | Does Not Include Valve | 20023 | 31-40, 3.5-4.5 | | Service Pack | W/43mm Silver Insert | 20037 | 31-40, 3.5-4.5 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 31-40, 3.5-4.5 | | Service Pack | W/48mm Green Insert | 20038 | 31-40, 3.5-4.5 | |
| | Service Pack | W/48mm Green Insert | 20038 | 31-40, 3.5-4.5 | | Service Pack | W/49mm Black Insert | 20039 | 31-40, 3.5-4.5 | |
| | Service Pack | W/49mm Black Insert | 20039 | 31-40, 3.5-4.5 | | Service Pack | W/51mm Orange Insert | 20040 | 31-40, 3.5-4.5 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 31-40, 3.5-4.5 | 2005 | | | | | |
| 2009 | | | | | 911, Boxster, Cayenne | Service Pack | Does Not Include Valve | 20023 | 31-40, 3.5-4.5 | |
| 911, Boxster, Cayenne | Service Pack | Does Not Include Valve | 20023 | 31-40, 3.5-4.5 | | Service Pack | W/43mm Silver Insert | 20037 | 31-40, 3.5-4.5 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 31-40, 3.5-4.5 | | Service Pack | W/48mm Green Insert | 20038 | 31-40, 3.5-4.5 | |
| | Service Pack | W/48mm Green Insert | 20038 | 31-40, 3.5-4.5 | | Service Pack | W/49mm Black Insert | 20039 | 31-40, 3.5-4.5 | |
| | Service Pack | W/49mm Black Insert | 20039 | 31-40, 3.5-4.5 | | Service Pack | W/51mm Orange Insert | 20040 | 31-40, 3.5-4.5 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 31-40, 3.5-4.5 | 2004 | | | | | |
| Cayman | Sensor | Includes Transmitter Only | 28087 | 31-40, 3.5-4.5 | Carrera GT, Cayenne | Service Pack | Does Not Include Valve | 20023 | 31-40, 3.5-4.5 | |
| | Service Pack | Does Not Include Valve | 20023 | 31-40, 3.5-4.5 | | Service Pack | W/43mm Silver Insert | 20037 | 31-40, 3.5-4.5 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 31-40, 3.5-4.5 | | Service Pack | W/48mm Green Insert | 20038 | 31-40, 3.5-4.5 | |
| | Service Pack | W/48mm Green Insert | 20038 | 31-40, 3.5-4.5 | | Service Pack | W/49mm Black Insert | 20039 | 31-40, 3.5-4.5 | |
| | Service Pack | W/49mm Black Insert | 20039 | 31-40, 3.5-4.5 | | Service Pack | W/51mm Orange Insert | 20040 | 31-40, 3.5-4.5 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 31-40, 3.5-4.5 | 2003 | | | | | |
| 2008 | | | | | Cayenne | Service Pack | Does Not Include Valve | 20023 | 31-40, 3.5-4.5 | |
| 911, Boxster, Cayenne, Cayman | Service Pack | Does Not Include Valve | 20023 | 31-40, 3.5-4.5 | | Service Pack | W/43mm Silver Insert | 20037 | 31-40, 3.5-4.5 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 31-40, 3.5-4.5 | | Service Pack | W/48mm Green Insert | 20038 | 31-40, 3.5-4.5 | |
| | Service Pack | W/48mm Green Insert | 20038 | 31-40, 3.5-4.5 | | Service Pack | W/49mm Black Insert | 20039 | 31-40, 3.5-4.5 | |
| | Service Pack | W/49mm Black Insert | 20039 | 31-40, 3.5-4.5 | | Service Pack | W/51mm Orange Insert | 20040 | 31-40, 3.5-4.5 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 31-40, 3.5-4.5 | 2010-2007 | | | | | |
| 2007 | | | | | Phantom | Service Pack | Does Not Include Valve | 20023 | 31-40, 3.5-4.5 | |
| 911, Boxster, Cayman | Service Pack | Does Not Include Valve | 20023 | 31-40, 3.5-4.5 | | Service Pack | W/43mm Silver Insert | 20037 | 31-40, 3.5-4.5 | |
| | Service Pack | W/43mm Silver Insert | 20037 | 31-40, 3.5-4.5 | | Service Pack | W/48mm Green Insert | 20038 | 31-40, 3.5-4.5 | |
| | Service Pack | W/48mm Green Insert | 20038 | 31-40, 3.5-4.5 | | Service Pack | W/49mm Black Insert | 20039 | 31-40, 3.5-4.5 | |
| | Service Pack | W/49mm Black Insert | 20039 | 31-40, 3.5-4.5 | | Service Pack | W/51mm Orange Insert | 20040 | 31-40, 3.5-4.5 | |
| | Service Pack | W/51mm Orange Insert | 20040 | 31-40, 3.5-4.5 | 2012-2011 | | | | | |
| 2007 | | | | | Saab | 9-3, 9-5 | Sensor | - | 20159 | 88, 10 . |
| 911, Boxster, Cayman | Service Pack | Does Not Include Valve | 20023 | 31-40, 3.5-4.5 | | Service Pack | - | - | 20009 | 88, 10 . |
| | Service Pack | W/43mm Silver Insert | 20037 | 31-40, 3.5-4.5 | | 9-4X | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Service Pack | W/48mm Green Insert | 20038 | 31-40, 3.5-4.5 | | Sensor | - | - | 28206 | 11.5, 1.3 |
| | Service Pack | W/49mm Black Insert | 20039 | 31-40, 3.5-4.5 | | Service Pack | - | - | 20008 | 11.5, 1.3 |
| | Service Pack | W/51mm Orange Insert | 20040 | 31-40, 3.5-4.5 | | | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | | |
|------------------------|------------------------|-------------------|-----------|----------------------------|--------------|------------------------|------------------------|------------------------|----------------------------|-----------|-----------|-----------|
| Saab (cont.) | | | | | 2010 | | | | | | | |
| 9-3, 9-5 | Sensor | - | 20159 | 88, 10 . | Aura | EZ-Sensor | - | 33000* | 11.5, 1.3 | | | |
| | Service Pack | - | 20009 | 88, 10 . | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | |
| 2009-2008 | | | | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | |
| 9-3, 9-5 | Sensor | - | 20159 | 88, 10 . | | Sensor | - | 20153 | 11.5, 1.3 | | | |
| | Service Pack | - | 20009 | 88, 10 . | | Service Pack | - | 20008 | 11.5, 1.3 | | | |
| 9-7X | Sensor | - | 20116 | 62, 7 | | Lambda | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | Service Pack | - | 20004 | 62, 7 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| 2007-2005 | | | | | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | |
| 9-3, 9-5 | Sensor | - | 28078 | 62, 7 | | | Sensor | - | 20158 | 62, 7 | | |
| | Service Pack | - | 20009 | 62, 7 | | Service Pack | - | 20004 | 62, 7 | | | |
| 9-7X | Sensor | - | 20116 | 62, 7 | Outlook | EZ-Sensor | - | 33000* | 11.5, 1.3 | | | |
| | Service Pack | - | 20004 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | |
| 2004-2003 | | | | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | |
| 9-3, 9-5 | Sensor | - | 28078 | 62, 7 | | Sensor | - | 20153 | 11.5, 1.3 | | | |
| | Service Pack | - | 20009 | 62, 7 | Service Pack | - | 20008 | 11.5, 1.3 | | | | |
| 2010 | | | | | Sky | EZ-Sensor | - | 33000* | 11.5, 1.3 | | | |
| Astra | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 28206 | 11.5, 1.3 | | | |
| | Sensor | - | 28206 | 11.5, 1.3 | | Service Pack | - | 20008 | 11.5, 1.3 | | | |
| | Service Pack | - | 20008 | 11.5, 1.3 | | VUE | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| Aura, Outlook | EZ-Sensor | - | 33000* | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | |
| EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sensor | | | - | 20153 | 11.5, 1.3 | | | |
| Sensor | - | 20153 | 11.5, 1.3 | Service Pack | | | - | 20008 | 11.5, 1.3 | | | |
| Service Pack | - | 20008 | 11.5, 1.3 | Saturn (cont.) | VUE | Service Pack | W/Schrader Sensor | 20004 | 62, 7 | | | |
| Sky | EZ-Sensor | - | 33000* | | | 11.5, 1.3 | Service Pack | W/Siemens Sensor | 20030 | 80, 9 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | | | 11.5, 1.3 | 2008 | Astra | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | | | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Sensor | - | 20158 | | | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | W/Schrader Sensor | 20004 | | 62, 7 | Sensor | | - | 28078 | 80, 9 | | |
| Service Pack | W/Siemens Sensor | 20030 | 80, 9 | | Service Pack | - | | 20009 | 80, 9 | | | |
| VUE | EZ-Sensor | - | 33000* | | 11.5, 1.3 | Aura | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | |
| | Sensor | - | 20153 | 11.5, 1.3 | Sensor | | - | 20153 | 11.5, 1.3 | | | |
| | Service Pack | - | 20008 | 11.5, 1.3 | Service Pack | | - | 20008 | 11.5, 1.3 | | | |
| 2009 | | | | | Lambda | EZ-Sensor | - | 33000* | 11.5, 1.3 | | | |
| Astra | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | - | 20158 | 62, 7 | | | |
| | Sensor | - | 28078 | 80, 9 | | Service Pack | - | 20004 | 62, 7 | | | |
| | Service Pack | - | 20009 | 80, 9 | | | | | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | | | |
|---------------------|----------------|------------------------|-------------------|-------------------------------|------------------|------------------------|------------------------|------------------------|-------------------------------|------------------------|-----------------------|--------|-----------|
| 2008 (cont.) | | | | | 2010-2008 | | | | | | | | |
| Saturn (cont.) | Outlook | EZ-Sensor | - | 33000* | 11.5, 1.3 | Saturn (cont.) | tC, xB, xD | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | |
| | | Sensor | - | 20158 | 62, 7 | | | Sensor | - | 28365 | 35, 4 | | |
| | | Service Pack | W/Schrader Sensor | 20004 | 62, 7 | | | Service Pack | - | 20032 | 35, 4 | | |
| | | Service Pack | W/Siemens Sensor | 20030 | 62, 7 | | | 2007 | | | | | |
| Saturn (cont.) | Sky | EZ-Sensor | - | 33000* | 11.5, 1.3 | Saturn (cont.) | tC, xB | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | |
| | | Sensor | - | 20158 | 62, 7 | | | Sensor | - | 28365 | 35, 4 | | |
| | | Service Pack | W/Schrader Sensor | 20004 | 62, 7 | | | Service Pack | - | 20032 | 35, 4 | | |
| | | Service Pack | W/Siemens Sensor | 20030 | 80, 9 | | | 2006 | | | | | |
| Saturn (cont.) | VUE | EZ-Sensor | - | 33000* | 11.5, 1.3 | Saturn (cont.) | tC | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | |
| | | Sensor | - | 20153 | 11.5, 1.3 | | | Sensor | May & Newer | 28365 | 35, 4 | | |
| | | Service Pack | - | 20008 | 11.5, 1.3 | | | Service Pack | May & Newer | 20032 | 35, 4 | | |
| 2007 | | | | | 2004 | | | | | | | | |
| Saturn (cont.) | Aura, Outlook | EZ-Sensor | - | 33000* | 11.5, 1.3 | Saturn (cont.) | Fortwo | Sensor | - | | | | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | Service Pack | W/Valve | | | | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | Service Pack | W/O Valve | | | | |
| | | Sensor | - | 20158 | 62, 7 | | | 2013 | | | | | |
| | | Service Pack | W/Schrader Sensor | 20004 | 62, 7 | | | Saturn (cont.) | Fortwo | EZ-Sensor | - | 33200 | 11.5, 1.3 |
| | | Service Pack | W/Siemens Sensor | 20030 | 62, 7 | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| Saturn (cont.) | VUE | EZ-Sensor | - | 33000* | 11.5, 1.3 | EZ-Sensor Service Pack | Almnm. Valve | | | 34000 | 62, 7 | | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Sensor | - | | | 28214 | 58, 6.5 | | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Service Pack | W/O Valve | | | 20016 | 58, 6.5 | | |
| | | Sensor | - | 20153 | 11.5, 1.3 | Service Pack | W/Valve | 20020 | 58, 6.5 | | | | |
| Service Pack | - | 20008 | 11.5, 1.3 | 2012-2008 | | | | | | | | | |
| 2014 | | | | | Saturn (cont.) | Fortwo | EZ-Sensor | - | 33200 | 11.5, 1.3 | | | |
| Scion | tC | Sensor | - | 28365 | | | 35, 4 | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | | Service Pack | - | 20032 | | | 35, 4 | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | |
| 2013 | | | | | | | Saturn (cont.) | Fortwo | Sensor | - | 28214 | 53, 6 | |
| Scion | FR-S | EZ-Sensor | - | 33000* | | | | | 11.5, 1.3 | Service Pack | Does Not Include Stem | 20016 | 53, 6 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | | | | | 11.5, 1.3 | Service Pack | Includes Stem Only | 20020 | 53, 6 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | 2014 | | | | | | | |
| | | Sensor | - | 28360 | 35, 4 | Subaru | | | BRZ | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Service Pack | - | 20032 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | | 20018 | 11.5, 1.3 | | |
| Subaru | iQ, tC, xB, xD | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | | 34000 | 62, 7 | | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | | 28360 | 35, 4 | | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | | 20032 | 35, 4 | | |
| | | Sensor | - | 28365 | 35, 4 | Subaru | Forester | Sensor | - | 28203 | 11.5, 1.3 | | |
| Service Pack | - | 20032 | 35, 4 | Service Pack | - | | | 20008 | 11.5, 1.3 | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|----------------------|------------------------------|------------------------------|-----------|-------------------------------|--------------------------------------|---|--|-----------|-------------------------------|
| 2009 (cont.) | | | | | 2007-2006 | | | | |
| Tribeca | EZ-Sensor | - | 33000* | 11.5, 1.3 | B9 Tribeca, Legacy, Outback | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | Sensor | W/Metal Stem Clamp-in Sensor | 20081 | 66, 7.5 . | | Sensor | - | 20081 | 66, 7.5 . |
| | Sensor | W/Rubber Stem Snap-in Sensor | 28203 | 11.5, 1.3 | | Service Pack | - | 20011 | 66, 7.5 . |
| | Service Pack | Rubber Valve | 20008 | 11.5, 1.3 | 2005-2004 | | | | |
| | Service Pack | W/Metal Stem Clamp-in Sensor | 20011 | 66, 7.5 . | Legacy, Outback | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| 2008 | | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| B9 Tribeca | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 20081 | 66, 7.5 . |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Service Pack | - | 20011 | 66, 7.5 . | |
| | Sensor | - | 20081 | 66, 7.5 . | 2013 | | | | |
| | Service Pack | - | 20011 | 66, 7.5 . | Equator | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| Forester, Impreza | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | Sensor | - | 28204 | 49, 5.5 |
| Sensor | - | 28203 | 11.5, 1.3 | Service Pack | | - | 20014 | 49, 5.5 | |
| Service Pack | - | 20008 | 11.5, 1.3 | Grand Vitara, SX4 | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| Service Pack | W/Metal Stem Clamp-in Sensor | 20011 | 66, 7.5 . | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| Legacy | EZ-Sensor | - | 33000* | | 11.5, 1.3 | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | | 11.5, 1.3 | Sensor | - | 20087 | 80, 9 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Service Pack | - | 20009 | 80, 9 | |
| | Sensor | W/16" Or 17" Wheels | 20081 | 66, 7.5 . | 2012 | | | | |
| | Sensor | W/18" Wheels | 28203 | 11.5, 1.3 | Equator | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Service Pack | W/18" Wheels | 20008 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Service Pack | W/16" Or 17" Wheels | 20011 | 66, 7.5 . | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| Outback | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sensor | - | 28204 | 49, 5.5 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | - | 20014 | 49, 5.5 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Grand Vitara | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Sensor | - | 28203 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Service Pack | - | 20008 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| Service Pack | W/16" Or 17" Wheels | 20011 | 66, 7.5 . | Sensor | | - | 20087 | 80, 9 | |
| Tribeca | EZ-Sensor | - | 33000* | 11.5, 1.3 | Service Pack | - | 20009 | 80, 9 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Kizashi | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Sensor | W/Metal Stem Clamp-in Sensor | 20081 | 66, 7.5 . | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 |
| | Sensor | W/Rubber Stem Snap-in Sensor | 28203 | 11.5, 1.3 | | Sensor | - | 20066 | 58, 6.5 |
| | Service Pack | W/Rubber Stem Snap-in Sensor | 20008 | 11.5, 1.3 | | Sensor | - | 28308 | 11.5, 1.3 |
| | Service Pack | W/Metal Stem Clamp-in Sensor | 20011 | 66, 7.5 . | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | |
| | | | | | | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 |
| | | | | | | Service Pack | W/Siemens Sensor | 20030 | 71, 8 |

* Programming Tool Required

ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|---------------------|------------------------|---|--------|-------------------------------|------------------------|------------------------|-------------------|-----------|-------------------------------|
| 2012 (cont.) | | | | | 2009 (cont.) | | | | |
| SX4 | EZ-Sensor | - | 33000* | 11.5, 1.3 | Grand Vitara, SX4 | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 20087 | 80, 9 | | Sensor | - | 20087 | 80, 9 |
| | Service Pack | - | 20009 | 80, 9 | | Service Pack | - | 20009 | 80, 9 |
| 2011-2010 | | | | | | XL-7 | EZ-Sensor | - | 33000* |
| Equator | EZ-Sensor | - | 33000* | 11.5, 1.3 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sensor | | - | 20158 | 62, 7 |
| | Sensor | - | 28204 | 49, 5.5 | Service Pack | | W/Schrader Sensor | 20004 | 62, 7 |
| | Service Pack | - | 20014 | 49, 5.5 | Service Pack | | W/Siemens Sensor | 20030 | 62, 7 |
| Grand Vitara | EZ-Sensor | - | 33000* | 11.5, 1.3 | 2008-2007 | | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Forenza | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Sensor | - | 20087 | 80, 9 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Service Pack | - | 20009 | 80, 9 | | Sensor | - | 20153 | 11.5, 1.3 |
| Service Pack | - | 20009 | 80, 9 | Service Pack | | - | 20008 | 11.5, 1.3 | |
| Kizashi | EZ-Sensor | - | 33000* | 11.5, 1.3 | Grand Vitara | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 20066 | 58, 6.5 | | Sensor | - | 20087 | 80, 9 |
| | Sensor | - | 28308 | 11.5, 1.3 | | Service Pack | - | 20009 | 80, 9 |
| SX4 | Service Pack | W/Schrader Sensor; Does Not Include Stem | 20013 | 58, 6.5 | Reno | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Service Pack | W/Schrader Sensor; Includes Stem Only | 20020 | 58, 6.5 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Service Pack | W/Siemens Sensor | 20030 | 71, 8 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sensor | - | 20153 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | - | 20008 | 11.5, 1.3 |
| XL-7 | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | SX4 | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Sensor | - | 20158 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Service Pack | W/Schrader Sensor | 20004 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Service Pack | W/Siemens Sensor | 20030 | 62, 7 | | Sensor | - | 20087 | 80, 9 |
| | 2009 | | | | | XL-7 | Service Pack | - | 20009 |
| Equator | EZ-Sensor | - | 33000* | 11.5, 1.3 | EZ-Sensor | | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 28204 | 49, 5.5 | Sensor | | - | 20158 | 62, 7 |
| | Service Pack | - | 20014 | 49, 5.5 | Service Pack | W/Schrader Sensor | 20004 | 62, 7 | |
| | | | | | XL-7 | Service Pack | W/Siemens Sensor | 20030 | 62, 7 |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | |
|-----------------------|------------------------|------------------------|--|-------------------------------|------------------------|------------------------|------------------------|---|--|-----------|-----------|
| 2006-2005 | | | | | 2013 (cont.) | | | | | | |
| Suzuki (cont.) | Verona | EZ-Sensor | - | 33000* | 11.5, 1.3 | Toyota (cont.) | Matrix | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | Sensor | - | 20082 | 80, 9 | | | Sensor | Models made in USA.; OEM Part No. 4260706011 | 28360 | 35, 4 |
| | | Service Pack | - | 20009 | 80, 9 | | | Sensor | Models made in Japan.; OEM Part No. 4260733011 | 28365 | 35, 4 |
| | XL-7 | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Service Pack | - | 20032 | 35, 4 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Prius | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | Sensor | - | 20087 | 80, 9 | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | Service Pack | - | 20009 | 80, 9 | | | Sensor | - | 28365 | 35, 4 |
| | | | | | Service Pack | | | - | 20032 | 35, 4 | |
| | 2013 | | | | | | 2013 (cont.) | | | | |
| Toyota | 4 Runner | EZ-Sensor | - | 33000* | 11.5, 1.3 | Toyota (cont.) | RAV4 | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | Sensor | - | 28370 | 35, 4 | | | Sensor | - | 28370 | 35, 4 |
| | | Service Pack | - | 20032 | 35, 4 | | | Service Pack | - | 20032 | 35, 4 |
| | Avalon, Camry | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sequoia, Sienna | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | Sensor | - | 28360 | 35, 4 | | | Sensor | - | 28670 | 35, 4 |
| | | Service Pack | - | 20032 | 35, 4 | | | Service Pack | - | 20022 | 35, 4 |
| | Corolla | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Tacoma | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| | | Sensor | Models made in USA.; W/16" Or 17" Wheels | 28360 | 35, 4 | Sensor | | W/Alloy Wheels; W/20 Deg. Angled Valve Sensor | 28360 | 35, 4 | |
| | | Service Pack | - | 20032 | 35, 4 | Sensor | | W/Steel Wheels; W/40 Deg. Angled Valve Sensor | 28380 | 35, 4 | |
| | FJ Cruiser | EZ-Sensor | - | 33000* | 11.5, 1.3 | Service Pack | - | 20032 | 35, 4 | | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Tundra | Sensor | W/Alloy Wheels; W/TRW sensor | 28670 | 35, 4 | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20022 | 35, 4 | |
| | | Sensor | - | 28365 | 35, 4 | Venza, Yaris | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | | Service Pack | - | 20032 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | High-lander | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 28360 | 35, 4 | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20032 | 35, 4 | |
| | | Sensor | - | 28360 | 35, 4 | Land Cruiser | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| Service Pack | | - | 20032 | 35, 4 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | | |
| Land Cruiser | EZ-Sensor | - | 33000* | 11.5, 1.3 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Sensor | | - | 28365 | 35, 4 | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Service Pack | | - | 20032 | 35, 4 | | |
| | Sensor | - | 28365 | 35, 4 | | | | | | | |
| | Service Pack | - | 20032 | 35, 4 | | | | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|------------------------|------------------------|--|-----------------------------------|----------------------------|------------------------|---|------------------------|--|----------------------------|-----------|
| 2012 | | | | | 2012 (cont.) | | | | | |
| Toyota (cont.) | 4 Runner | EZ-Sensor | - | 33000* | 11.5, 1.3 | Matrix (cont.) | Sensor | Models made in Japan.; OEM Part No. 4260733011 | 28365 | 35, 4 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | - | 20032 | 35, 4 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Prius | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Sensor | - | 28370 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | Service Pack | - | 20032 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Avalon, Camry | EZ-Sensor | - | 33000* | 11.5, 1.3 | Sensor | - | 28365 | 35, 4 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | - | 20032 | 35, 4 | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Prius C | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Sensor | - | 28360 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Service Pack | - | 20032 | 35, 4 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| | Corolla | EZ-Sensor | - | 33000* | 11.5, 1.3 | Sensor | - | | | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | - | | | |
| EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | Prius V | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| Sensor | | Models made in USA.; W/16" Or 17" Wheels | 28360 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| Sensor | | Models made in Japan.; OEM Part No. 4260733011 | 28365 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| FJ Cruiser | | Sensor | Models made in USA.; W/15" Wheels | 28365 | 35, 4 | Sensor | - | 28365 | 35, 4 | |
| | Sensor | Models made in Japan.; OEM Part No. 4260733021 | 28370 | 35, 4 | Service Pack | - | 20032 | 35, 4 | | |
| | Service Pack | - | 20032 | 35, 4 | RAV4 | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| Highlander | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sensor | - | 28370 | 35, 4 | | |
| | Sensor | - | 28365 | 35, 4 | Service Pack | - | 20032 | 35, 4 | | |
| | Service Pack | - | 20032 | 35, 4 | RAV4 E | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| Land Cruiser | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sensor | - | 28360 | 35, 4 | | |
| | Sensor | - | 28360 | 35, 4 | Service Pack | - | 20032 | 35, 4 | | |
| | Service Pack | - | 20032 | 35, 4 | Sequoia, Sienna | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| Matrix | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sensor | - | 28670 | 35, 4 | | |
| | Sensor | Models made in USA.; OEM Part No. 4260706011 | 28360 | 35, 4 | Service Pack | - | 20022 | 35, 4 | | |
| | EZ-Sensor | - | 33000* | 11.5, 1.3 | Tacoma | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Sensor | Models made in USA.; OEM Part No. 4260706011 | 28360 | 35, 4 | Sensor | W/Alloy Wheels; W/20 Deg. Angled Valve Sensor | 28360 | 35, 4 | | |
| | | | | | Sensor | W/Steel Wheels; W/40 Deg. Angled Valve Sensor | 28380 | 35, 4 | | |
| | | | | | Service Pack | - | 20032 | 35, 4 | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | |
|---------------------|------------------------|--|--------------|-------------------------------|------------------------|---------------------------------|--|--|-------------------------------|-----------|-----------|
| 2012 (cont.) | | | | | 2011 (cont.) | | | | | | |
| Toyota (cont.) | Tundra | EZ-Sensor | - | 33000* | 11.5, 1.3 | Corolla | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | |
| | | Sensor | - | 28670 | 35, 4 | | Sensor | Models made in USA.; W/16" Or 17" Wheels | 28360 | 35, 4 | |
| | | Service Pack | - | 20022 | 35, 4 | | Sensor | Models made in Japan.; OEM Part No. 4260733011 | 28365 | 35, 4 | |
| | Venza | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sensor | Models made in USA.; W/15" Wheels | 28365 | 35, 4 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | Models made in Japan.; OEM Part No. 4260733021 | 28370 | 35, 4 | |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | Service Pack | - | 20032 | 35, 4 | |
| | | Sensor | - | 28360 | 35, 4 | | FJ Cruiser | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Service Pack | - | 20032 | 35, 4 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Yaris | EZ-Sensor | - | 33000* | 11.5, 1.3 | EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Sensor | | - | 28365 | 35, 4 | |
| | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Service Pack | | - | 20032 | 35, 4 | |
| | | Sensor | - | 28365 | 35, 4 | High-lander, High-lander Hybrid | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | | Service Pack | - | 20032 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| 2011 | | | | | EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | | |
| 4 Runner | EZ-Sensor | - | 33000* | 11.5, 1.3 | Sensor | | - | 28360 | 35, 4 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | | - | 20032 | 35, 4 | | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Land Cruiser | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | Sensor | - | 28370 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | Service Pack | - | 20032 | 35, 4 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | |
| Avalon | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sensor | - | 28365 | 35, 4 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | - | 20032 | 35, 4 | | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Matrix | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | Sensor | - | 28360 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | Service Pack | - | 20032 | 35, 4 | | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | | |
| Camry | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sensor | Models made in USA.; OEM Part No. 4260706011 | 28360 | 35, 4 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | Models made in Japan.; OEM Part No. 4260733011 | 28365 | 35, 4 | | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Service Pack | - | 20032 | 35, 4 | | | |
| | Sensor | Models made in USA.; OEM Part No. 4260706011 | 28360 | 35, 4 | Prius | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | Sensor | Models made in Japan.; OEM Part No. 4260733011 | 28365 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| Service Pack | - | 20032 | 35, 4 | EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | | | |
| Camry Hybrid | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sensor | Models made in USA.; OEM Part No. 4260706011 | 28360 | 35, 4 | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | Models made in Japan.; OEM Part No. 4260733011 | 28365 | 35, 4 | | |
| | EZ-Sensor Service Pack | Almm. Valve | 34000 | 62, 7 | Service Pack | - | 20032 | 35, 4 | | | |
| | Sensor | Models made in Japan.; OEM Part No. 4260733011 | 28365 | 35, 4 | Prius | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | Service Pack | - | 20032 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | |
| | | | | EZ-Sensor Service Pack | | Almm. Valve | 34000 | 62, 7 | | | |
| | | | | Sensor | | - | 28365 | 35, 4 | | | |
| | | | | Service Pack | | - | 20032 | 35, 4 | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|------------------------|------------------------|------------------------|---|----------------------------|---|------------------------|--|--|----------------------------|-----------|
| 2011 (cont.) | | | | | 2010 | | | | | |
| Toyota (cont.) | RAV4 | EZ-Sensor | - | 33000* | 11.5, 1.3 | 4 Runner | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | Sensor | - | 28370 | 35, 4 | | Sensor | - | 28370 | 35, 4 |
| | | Service Pack | - | 20032 | 35, 4 | | Service Pack | - | 20032 | 35, 4 |
| | Sequoia, Sienna | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Avalon | EZ-Sensor | - | 33000* |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 |
| | | Sensor | - | 28670 | 35, 4 | Sensor | | - | 28360 | 35, 4 |
| | | Service Pack | - | 20022 | 35, 4 | Service Pack | | - | 20032 | 35, 4 |
| | Solara | EZ-Sensor | - | 33000* | 11.5, 1.3 | Camry | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | Sensor | - | 28360 | 35, 4 | | Sensor | Models made in USA.; OEM Part No. 4260706011 | 28360 | 35, 4 |
| | | Service Pack | - | 20032 | 35, 4 | | Sensor | Models made in Japan.; OEM Part No. 4260733011 | 28365 | 35, 4 |
| | Tacoma | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Service Pack | - | 20032 | 35, 4 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Camry Hybrid | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | Sensor | W/Alloy Wheels; W/20 Deg. Angled Valve Sensor | 28360 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | Sensor | W/Steel Wheels; W/40 Deg. Angled Valve Sensor | 28380 | 35, 4 | | Sensor | Models made in Japan.; OEM Part No. 4260733011 | 28365 | 35, 4 |
| | | Service Pack | - | 20032 | 35, 4 | | Service Pack | - | 20032 | 35, 4 |
| | Tundra | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Corolla | EZ-Sensor | - | 33000* |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 |
| | | Sensor | W/Alloy Wheels; W/TRW sensor | 28670 | 35, 4 | Sensor | | Models made in USA.; W/16" Or 17" Wheels | 28360 | 35, 4 |
| | | Service Pack | - | 20022 | 35, 4 | Sensor | | Models made in Japan.; OEM Part No. 4260733011 | 28365 | 35, 4 |
| | Venza | EZ-Sensor | - | 33000* | 11.5, 1.3 | Sensor | Models made in USA.; W/15" Wheels | 28365 | 35, 4 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Sensor | Models made in Japan.; OEM Part No. 4260733021 | 28370 | 35, 4 | |
| EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | Service Pack | - | 20032 | 35, 4 | | |
| Sensor | | - | 28360 | 35, 4 | FJ Cruiser, Highlander, Highlander Hybrid, Land Cruiser | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| Service Pack | | - | 20032 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| Yaris | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 28365 | 35, 4 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20032 | 35, 4 | |
| | Sensor | - | 28365 | 35, 4 | | | | | | |
| | Service Pack | - | 20032 | 35, 4 | | | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | |
|------------------------|------------------------|---|--|-------------------------------|------------------------|--|--|--|-------------------------------|-----------|
| 2010 (cont.) | | | | | 2010 (cont.) | | | | | |
| Toyota (cont.) | Matrix | EZ-Sensor | - | 33000* | 11.5, 1.3 | Venza | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | Sensor | Models made in USA.; OEM Part No. 4260706011 | 28360 | 35, 4 | | Sensor | - | 28360 | 35, 4 |
| | | Sensor | Models made in Japan.; OEM Part No. 4260733011 | 28365 | 35, 4 | | Service Pack | - | 20032 | 35, 4 |
| | | Service Pack | - | 20032 | 35, 4 | | Yaris | EZ-Sensor | - | 33000* |
| | Prius | EZ-Sensor | - | 33000* | 11.5, 1.3 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sensor | | - | 28365 | 35, 4 |
| | | Sensor | - | 28365 | 35, 4 | Service Pack | - | 20032 | 35, 4 | |
| RAV4 | EZ-Sensor | - | 33000* | 11.5, 1.3 | 2009 | | | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | 4 Runner | EZ-Sensor ¹ | - | 33000* | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Sensor | - | 28370 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Service Pack | - | 20032 | 35, 4 | | Sensor | W/Valve Cap | 28365 | 35, 4 | |
| | Sequoia, Sienna | EZ-Sensor | - | 33000* | | 11.5, 1.3 | Sensor | W/O Valve Cap | 28370 | 35, 4 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | - | 20032 | 35, 4 | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Avalon | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| Sensor | | - | 28670 | 35, 4 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | |
| Service Pack | | - | 20022 | 35, 4 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| Solara | | EZ-Sensor | - | 33000* | 11.5, 1.3 | Sensor | - | 28360 | 35, 4 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | - | 20032 | 35, 4 | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Camry | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Sensor | - | 28360 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | - | 20032 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | Tacoma | EZ-Sensor | - | 33000* | | 11.5, 1.3 | Sensor | Models made in USA.; OEM Part No. 4260706011 | 28360 | 35, 4 |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | Sensor | Models made in Japan.; OEM Part No. 4260733011 | 28365 | 35, 4 | | |
| EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | Service Pack | - | 20032 | 35, 4 | | |
| Sensor | | W/Alloy Wheels; W/20 Deg. Angled Valve Sensor | 28360 | 35, 4 | Camry Hybrid | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| Sensor | | W/Steel Wheels; W/40 Deg. Angled Valve Sensor | 28380 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| Service Pack | | - | 20032 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| Tundra | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sensor | Models made in Japan.; OEM Part No. 4260733011 | 28365 | 35, 4 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | - | 20032 | 35, 4 | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Corolla | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Sensor | W/Alloy Wheels; W/TRW sensor | 28670 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | Service Pack | - | 20022 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|---|------------------------|--|--------|----------------------------|---------------------|--|---|--------|----------------------------|
| 2009 (cont.) | | | | | 2009 (cont.) | | | | |
| Corolla (cont.) | Sensor | Models made in USA.; W/16" Or 17" Wheels | 28360 | 35, 4 | Tacoma | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Sensor | Models made in Japan.; OEM Part No. 4260733011 | 28365 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Sensor | Models made in USA.; W/15" Wheels | 28365 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | Models made in Japan.; OEM Part No. 4260733021 | 28370 | 35, 4 | | Sensor | W/Alloy Wheels; W/20 Deg. Angled Valve Sensor | 28360 | 35, 4 |
| | Service Pack | - | 20032 | 35, 4 | | Sensor | W/Steel Wheels; W/40 Deg. Angled Valve Sensor | 28380 | 35, 4 |
| | | | | Service Pack | | - | 20032 | 35, 4 | |
| FJ Cruiser, Highlander, Highlander Hybrid, Land Cruiser | EZ-Sensor | - | 33000* | 11.5, 1.3 | Tundra | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 28365 | 35, 4 | | Sensor | W/Alloy Wheels; W/TRW sensor | 28670 | 35, 4 |
| | Service Pack | - | 20032 | 35, 4 | | Service Pack | - | 20022 | 35, 4 |
| | | | | | | | | | |
| Matrix | EZ-Sensor | - | 33000* | 11.5, 1.3 | Venza | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | Models made in USA.; OEM Part No. 4260706011 | 28360 | 35, 4 | | Sensor | - | 28360 | 35, 4 |
| | Sensor | Models made in Japan.; OEM Part No. 4260733011 | 28365 | 35, 4 | | Service Pack | - | 20032 | 35, 4 |
| | | | | | | | | | |
| Prius | EZ-Sensor | - | 33000* | 11.5, 1.3 | Yaris | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 28365 | 35, 4 | | Sensor | - | 28365 | 35, 4 |
| | Service Pack | - | 20032 | 35, 4 | | Service Pack | - | 20032 | 35, 4 |
| | | | | | | | | | |
| RAV4 | EZ-Sensor | - | 33000* | 11.5, 1.3 | 2008 | | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | 4 Runner | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Sensor | - | 28370 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Service Pack | - | 20032 | 35, 4 | | Sensor | W/Valve Cap; OEM Part No. 4260733011 | 28365 | 35, 4 |
| | | | | Sensor | | W/O Valve Cap; OEM Part No. 4260733021 | 28370 | 35, 4 | |
| Sequoia, Sienna | EZ-Sensor | - | 33000* | 11.5, 1.3 | Service Pack | - | 20032 | 35, 4 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Avalon | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Sensor | - | 28670 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Service Pack | - | 20022 | 35, 4 | | Sensor | - | 28360 | 35, 4 |
| | | | | Service Pack | | - | 20032 | 35, 4 | |
| Solara | EZ-Sensor | - | 33000* | 11.5, 1.3 | Camry | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | May & Newer | 28360 | 35, 4 | | | | | |
| | Service Pack | May & Newer | 20032 | 35, 4 | | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|-------------------------------|------------------------|--|--------|-------------------------------|------------------------|------------------------|---|--------|-------------------------------|
| 2008 (cont.) | | | | | 2008 (cont.) | | | | |
| Camry (cont.) | Sensor | Models made in USA.; OEM Part No. 4260706011 | 28360 | 35, 4 | Prius | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Sensor | Models made in Japan.; OEM Part No. 4260733011 | 28365 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Service Pack | - | 20032 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| Camry Hybrid | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sensor | - | 28365 | 35, 4 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | - | 20032 | 35, 4 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | RAV4 | EZ-Sensor | - | 33000* |
| | Sensor | Models made in Japan.; OEM Part No. 4260733011 | 28365 | 35, 4 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 |
| Service Pack | - | 20032 | 35, 4 | EZ-Sensor Service Pack | Almnm. Valve | | 34000 | 62, 7 | |
| Corolla | EZ-Sensor | - | 33000* | 11.5, 1.3 | Sensor | | - | 28370 | 35, 4 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | | - | 20032 | 35, 4 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sequoia, Sienna | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Sensor | Models made in USA.; OEM Part No. 4260706011 | 28360 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Sensor | Models made in Japan.; OEM Part No. 4260733011 | 28365 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| Service Pack | - | 20032 | 35, 4 | Sensor | | - | 28670 | 35, 4 | |
| Service Pack | - | 20032 | 35, 4 | Service Pack | | - | 20022 | 35, 4 | |
| FJ Cruiser, Highlander | EZ-Sensor | - | 33000* | 11.5, 1.3 | Solara | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | - | 28365 | 35, 4 | | Sensor | - | 28360 | 35, 4 |
| | Service Pack | - | 20032 | 35, 4 | Service Pack | - | 20032 | 35, 4 | |
| | Service Pack | - | 20032 | 35, 4 | Tacoma | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| Highlander Hybrid | Sensor | - | 28365 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Service Pack | - | 20032 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| Land Cruiser | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sensor | W/Alloy Wheels; W/20 Deg. Angled Valve Sensor | 28360 | 35, 4 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | W/Steel Wheels; W/40 Deg. Angled Valve Sensor | 28380 | 35, 4 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Service Pack | - | 20032 | 35, 4 | |
| | Sensor | - | 28365 | 35, 4 | Tundra | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Service Pack | - | 20032 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| Matrix | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | W/Alloy Wheels; W/TRW sensor | 28670 | 35, 4 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Service Pack | - | 20022 | 35, 4 | |
| | Sensor | Models made in USA.; OEM Part No. 4260706011 | 28360 | 35, 4 | Yaris | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Sensor | Models made in Japan.; OEM Part No. 4260733011 | 28365 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| Service Pack | - | 20032 | 35, 4 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| Service Pack | - | 20032 | 35, 4 | Sensor | | - | 28365 | 35, 4 | |
| | | | | | | | | | |

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | | |
|------------------------|--------------------------|--|--|-------------------------------|------------------------|------------------------------|---|---|-------------------------------|-----------|-----------|
| 2007 | | | | | 2007 (cont.) | | | | | | |
| Toyota (cont.) | 4 Runner | EZ-Sensor | - | 33000* | 11.5, 1.3 | Prius | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | | Sensor | W/Valve Cap | 28365 | 35, 4 | | Sensor | - | 28365 | 35, 4 | |
| | | Sensor | W/O Valve Cap | 28370 | 35, 4 | | Service Pack | - | 20032 | 35, 4 | |
| | | Service Pack | - | 20032 | 35, 4 | | RAV4 | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Avalon | EZ-Sensor | - | 33000* | 11.5, 1.3 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sensor | | - | 28370 | 35, 4 | |
| | | Sensor | - | 28360 | 35, 4 | Service Pack | | - | 20032 | 35, 4 | |
| | | Service Pack | - | 20032 | 35, 4 | Sequoia | | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | Camry | EZ-Sensor | - | 33000* | | 11.5, 1.3 | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | |
| | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | | Sensor | W/Steel Wheels; W/40 Deg. Angled Valve Sensor | 28300 | 35, 4 | |
| | Sensor | | Models made in USA.; OEM Part No. 4260706011 | 28360 | 35, 4 | | Sensor | W/Alloy Wheels | 28305 | 35, 4 | |
| | Sensor | | Models made in Japan.; OEM Part No. 4260733011 | 28365 | 35, 4 | | Sensor | W/Steel Wheels; W/20 Deg. Angled Valve Sensor | 28305 | 35, 4 | |
| | Service Pack | | - | 20032 | 35, 4 | | Service Pack | - | 20031 | 35, 4 | |
| | Corolla | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sienna | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | | Sensor | Models made in USA.; OEM Part No. 4260706011; Jun. & Newer | 28360 | 35, 4 | Sensor | | - | 28670 | 35, 4 | |
| | | Sensor | Models made in Japan.; OEM Part No. 4260733011; Jun. & Newer | 28365 | 35, 4 | Service Pack | - | 20022 | 35, 4 | | |
| | | Service Pack | Jun. & Newer | 20032 | 35, 4 | Solara | EZ-Sensor | - | 33000* | 11.5, 1.3 | |
| | Highlander, Land Cruiser | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | | |
| EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | Sensor | | - | 28360 | 35, 4 | | |
| Sensor | | May & Newer | 28365 | 35, 4 | Service Pack | - | 20032 | 35, 4 | | | |
| Service Pack | | May & Newer | 20032 | 35, 4 | Tacoma | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| Matrix | | EZ-Sensor | - | 33000* | | 11.5, 1.3 | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | W/Alloy Wheels; W/20 Deg. Angled Valve Sensor | 28360 | 35, 4 | | |
| | Sensor | Models made in USA.; OEM Part No. 4260706011; Jun. & Newer | 28360 | 35, 4 | | Sensor | W/Steel Wheels; W/40 Deg. Angled Valve Sensor | 28380 | 35, 4 | | |
| | Sensor | Models made in Japan.; OEM Part No. 4260733011; Jun. & Newer | 28365 | 35, 4 | | Service Pack | - | 20032 | 35, 4 | | |
| | Service Pack | Jun. & Newer | 20032 | 35, 4 | Tundra | EZ-Sensor | - | 33000* | 11.5, 1.3 | | |
| | | | | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | | | |
| | | | | EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | | | |
| | | | | Sensor | | W/Alloy Wheels; W/TRW sensor | 28670 | 35, 4 | | | |
| | | | | Sensor | | W/Steel Wheels; W/TRW sensor | | | | | |
| | | | | Service Pack | | W/Alloy Wheels; W/TRW sensor | 20022 | 35, 4 | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|------------------------|------------------------|-------------------------|--------|-------------------------------|------------------------|---|---|--------------|-------------------------------|
| 2007 (cont.) | | | | | 2006 (cont.) | | | | |
| Yaris | EZ-Sensor | - | 33000* | 11.5, 1.3 | Sequoia (cont.) | Sensor | W/Steel Wheels; W/40 Deg. Angled Valve Sensor | 28300 | 35, 4 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | W/Alloy Wheels | 28305 | 35, 4 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Sensor | W/Steel Wheels; W/20 Deg. Angled Valve Sensor | 28305 | 35, 4 |
| | Sensor | Aug. & Newer | 28365 | 35, 4 | | Service Pack | - | 20031 | 35, 4 |
| | Service Pack | Aug. & Newer | 20032 | 35, 4 | Sienna | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | 2006 | | | | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| 4 Runner | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 28670 | 35, 4 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Service Pack | - | 20022 | 35, 4 | |
| | Sensor | OEM Part No. 4260730030 | 28335 | 35, 4 | Solara | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Sensor | OEM Part No. 4260735010 | 28345 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Sensor | OEM Part No. 4260733011 | 28365 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | OEM Part No. 4260733021 | 28370 | 35, 4 | | Sensor | May & Newer | 28360 | 35, 4 |
| | Service Pack | May & Older | 20031 | 35, 4 | Service Pack | May & Newer | 20032 | 35, 4 | |
| | Service Pack | Jun. & Newer | 20032 | 35, 4 | Tacoma | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Avalon | EZ-Sensor | - | 33000* | | 11.5, 1.3 | EZ-Sensor Service Pack | Rubber Valve | 20018 |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | | Sensor | W/Alloy Wheels; W/20 Deg. Angled Valve Sensor; Jul. & Older | 28355 | 35, 4 |
| Sensor | | Aug. & Newer | 28360 | 35, 4 | Sensor | W/Alloy Wheels; W/20 Deg. Angled Valve Sensor; Aug. & Newer | 28360 | 35, 4 | |
| Service Pack | | Aug. & Newer | 20032 | 35, 4 | Sensor | W/Steel Wheels; W/40 Deg. Angled Valve Sensor | 28380 | 35, 4 | |
| Land Cruiser | | EZ-Sensor | - | 33000* | 11.5, 1.3 | Service Pack | Jul. & Older | 20031 | 35, 4 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Service Pack | Aug. & Newer | 20032 | 35, 4 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Tundra | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | Sensor | - | 28365 | 35, 4 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | Service Pack | Mar. & Older | 20031 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Service Pack | Apr. 1 & Newer | 20032 | 35, 4 | | Sensor | W/Steel Wheels; W/40 Deg. Angled Valve Sensor | 28300 | 35, 4 |
| Prius | EZ-Sensor | - | 33000* | 11.5, 1.3 | Sensor | W/Alloy Wheels; W/20 Deg. Angled Valve Sensor | 28305 | 35, 4 | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Sensor | W/Alloy Wheels; W/TRW sensor | 28670 | 35, 4 | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Sensor | W/Steel Wheels; W/TRW sensor | | | |
| | Sensor | - | 28365 | 35, 4 | Service Pack | Nov. 1 & Newer | 20022 | 35, 4 | |
| | Service Pack | - | 20032 | 35, 4 | Service Pack | Oct. 31 & Older | 20031 | 35, 4 | |
| | RAV4 | EZ-Sensor | - | 33000* | 11.5, 1.3 | 2005 | | | |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | 4 Runner | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| Sensor | | - | 28365 | 35, 4 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| Service Pack | | - | 20032 | 35, 4 | | Sensor | - | 28345 | 35, 4 |
| Service Pack | | - | 20032 | 35, 4 | | Service Pack | - | 20031 | 35, 4 |
| Sequoia | EZ-Sensor | - | 33000* | 11.5, 1.3 | | | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | | | | |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | | | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|------------------------|------------------------|--|--------------|----------------------------|--|--|---|---|----------------------------|
| 2005 (cont.) | | | | | 2004 (cont.) | | | | |
| Land Cruiser | EZ-Sensor | - | 33000* | 11.5, 1.3 | Sequoia | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | Sensor | May & Newer | 28365 | 35, 4 | | Sensor | W/Steel Wheels; W/40 Deg. Angled Valve Sensor | 28300 | 35, 4 |
| | Service Pack | May & Newer | 20031 | 35, 4 | | Sensor | W/Alloy Wheels | 28305 | 35, 4 |
| Prius | EZ-Sensor | - | 33000* | 11.5, 1.3 | | Sensor | W/Steel Wheels; W/20 Deg. Angled Valve Sensor | 28305 | 35, 4 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Service Pack | - | 20031 | 35, 4 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | 2003 | | | | |
| | Sensor | - | 28365 | 35, 4 | 4 Runner | EZ-Sensor | - | 33000* | 11.5, 1.3 |
| Service Pack | - | 20032 | 35, 4 | EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | |
| Sequoia | EZ-Sensor | - | 33000* | 11.5, 1.3 | | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | | Sensor | - | 28345 | 35, 4 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | Service Pack | - | 20031 | 35, 4 | |
| | Sensor | W/Steel Wheels; W/40 Deg. Angled Valve Sensor | 28300 | 35, 4 | 2013 | | | | |
| | Sensor | W/Alloy Wheels | 28305 | 35, 4 | CC | Sensor | - | | |
| | Sensor | W/Steel Wheels; W/20 Deg. Angled Valve Sensor | 28305 | 35, 4 | | Service Pack | - | | |
| | Service Pack | - | 20031 | 35, 4 | Eos | Sensor | - | 20088 | 71, 8 |
| | Tacoma | EZ-Sensor | - | 33000* | | 11.5, 1.3 | Service Pack | - | 20017 |
| EZ-Sensor Service Pack | | Rubber Valve | 20018 | 11.5, 1.3 | Touareg | Sensor | W/315 MHz Sensor; Includes Transmitter Only | 20077 | 35, 4 |
| EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | | Sensor | W/433 MHz Sensor; Includes Transmitter Only | 20103 | 35, 4 |
| Sensor | | W/40 Deg. Angled Valve Sensor; Nov. 30 & Older | 28300 | 35, 4 | | Service Pack | Does Not Include Valve; W/315 MHz Sensor | 20023 | 35, 4 |
| Sensor | | W/20 Deg. Angled Valve Sensor; Nov. 30 & Older | 28305 | 35, 4 | | Service Pack | W/43mm Silver Insert; W/315 MHz Sensor | 20037 | 35, 4 |
| Sensor | | W/20 Deg. Angled Valve Sensor; Dec. 1 & Newer | 28355 | 35, 4 | | Service Pack | W/48mm Green Insert; W/315 MHz Sensor | 20038 | 35, 4 |
| Sensor | | W/40 Deg. Angled Valve Sensor; Dec. 1 & Newer | 28380 | 35, 4 | | Service Pack | W/49mm Black Insert; W/315 MHz Sensor | 20039 | 35, 4 |
| Service Pack | | - | 20031 | 35, 4 | | Service Pack | W/51mm Orange Insert; W/315 MHz Sensor | 20040 | 35, 4 |
| Tundra | EZ-Sensor | - | 33000* | 11.5, 1.3 | | 2012 | | | |
| | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | CC, Eos | Sensor | - | 20088 | 71, 8 |
| | EZ-Sensor Service Pack | Almnm. Valve | 34000 | 62, 7 | | Service Pack | - | 20017 | 71, 8 |
| | Sensor | W/Steel Wheels; W/40 Deg. Angled Valve Sensor | 28300 | 35, 4 | Routan | Sensor | - | | |
| | Sensor | W/Alloy Wheels; W/20 Deg. Angled Valve Sensor | 28305 | 35, 4 | | Service Pack | - | | |
| | Service Pack | - | 20031 | 35, 4 | Tiguan | Sensor | - | 20088 | 71, 8 |
| | 4 Runner | EZ-Sensor | - | 33000* | | 11.5, 1.3 | Service Pack | - | 20017 |
| | | EZ-Sensor Service Pack | Rubber Valve | 20018 | 11.5, 1.3 | Touareg, Touareg 2 | Sensor | W/315 MHz Sensor; Includes Transmitter Only | 20077 |
| EZ-Sensor Service Pack | | Almnm. Valve | 34000 | 62, 7 | Sensor | | W/433 MHz Sensor; Includes Transmitter Only | 20103 | 35, 4 |
| Sensor | | - | 28345 | 35, 4 | Service Pack | Does Not Include Valve; W/315 MHz Sensor | 20023 | 35, 4 | |
| Service Pack | | - | 20031 | 35, 4 | Service Pack | W/43mm Silver Insert; W/315 MHz Sensor | 20037 | 35, 4 | |
| | | | | | Service Pack | W/48mm Green Insert; W/315 MHz Sensor | 20038 | 35, 4 | |
| | | | | Service Pack | W/49mm Black Insert; W/315 MHz Sensor | 20039 | 35, 4 | | |
| | | | | Service Pack | W/51mm Orange Insert; W/315 MHz Sensor | 20040 | 35, 4 | | |

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|---|---|--|--------|-------------------------------|------------------|--|---|--------|-------------------------------|
| 2011 | | | | | 2008 | | | | |
| CC, Eos | Sensor | - | 20088 | 71, 8 | Beetle, Eos | Sensor | - | 20088 | 71, 8 |
| | Service Pack | - | 20017 | 71, 8 | | Service Pack | - | 20017 | 71, 8 |
| Routan | Sensor | - | | | GLI | Service Pack | - | 20017 | 71, 8 |
| | Service Pack | - | | | Golf, GTI, Jetta | Sensor | - | 20088 | 71, 8 |
| Tiguan | Sensor | - | 20088 | 71, 8 | | Service Pack | - | 20017 | 71, 8 |
| | Service Pack | - | 20017 | 71, 8 | Passat | Sensor | W/16" Or 17" Wheels | 20088 | 71, 8 |
| Touareg 2 | Sensor | W/315 MHz Sensor; Includes Transmitter Only | 20077 | 35, 4 | | Service Pack | W/16" Or 17" Wheels | 20017 | 71, 8 |
| | Sensor | W/433 MHz Sensor; Includes Transmitter Only | 20103 | 35, 4 | R32, Rabbit | Sensor | - | 20088 | 71, 8 |
| Service Pack | Does Not Include Valve; W/315 MHz Sensor | 20023 | 35, 4 | Service Pack | | - | 20017 | 71, 8 | |
| Service Pack | W/43mm Silver Insert; W/315 MHz Sensor | 20037 | 35, 4 | Touareg 2 | Sensor | Includes Transmitter Only | 20078 | 35, 4 | |
| Service Pack | W/48mm Green Insert; W/315 MHz Sensor | 20038 | 35, 4 | | Service Pack | Does Not Include Valve | 20023 | 35, 4 | |
| Service Pack | W/49mm Black Insert; W/315 MHz Sensor | 20039 | 35, 4 | | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | |
| Service Pack | W/51mm Orange Insert; W/315 MHz Sensor | 20040 | 35, 4 | | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | |
| 2010 | | | | | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | |
| Beetle, CC, Eos, Golf, GTI, Jetta, Passat | Sensor | - | 20088 | | 71, 8 | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 |
| | Service Pack | - | 20017 | 71, 8 | 2007 | | | | |
| Routan | Sensor | - | | | Eos | Sensor | - | 20088 | 71, 8 |
| | Service Pack | - | | | | Service Pack | - | 20017 | 71, 8 |
| Tiguan | Sensor | - | 20088 | 71, 8 | GTI | Sensor | W/16" Or 17" Wheels | 20088 | 71, 8 |
| | Service Pack | - | 20017 | 71, 8 | | Service Pack | W/16" Or 17" Wheels | 20017 | 71, 8 |
| Touareg 2 | Sensor | Includes Transmitter Only | 20103 | 35, 4 | Jetta | Sensor | - | 20088 | 71, 8 |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | Service Pack | - | 20017 | 71, 8 |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | Passat | Sensor | W/16" Or 17" Wheels | 20088 | 71, 8 |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | Service Pack | W/16" Or 17" Wheels | 20017 | 71, 8 |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | Rabbit | Sensor | W/15" Wheels | 20088 | 71, 8 |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | Service Pack | W/15" Wheels | 20017 | 71, 8 |
| 2009 | | | | | Touareg | Service Pack | Does Not Include Valve | 20023 | 62, 7 |
| Beetle, CC, Eos | Sensor | - | 20088 | 71, 8 | | Service Pack | W/43mm Silver Insert | 20037 | 62, 7 |
| | Service Pack | - | 20017 | 71, 8 | | Service Pack | W/48mm Green Insert | 20038 | 62, 7 |
| GLI | Service Pack | - | 20017 | 71, 8 | | Service Pack | W/49mm Black Insert | 20039 | 62, 7 |
| Golf, GTI, Jetta, Passat, Rabbit | Sensor | - | 20088 | 71, 8 | | Service Pack | W/51mm Orange Insert | 20040 | 62, 7 |
| | Service Pack | - | 20017 | 71, 8 | | 2006 | | | |
| Routan | Sensor | - | | | Golf | Service Pack | GTI | 20017 | 71, 8 |
| | Service Pack | - | | | GTI | Sensor | W/16" Or 17" Wheels | 20088 | 71, 8 |
| Tiguan | Sensor | - | 20088 | 71, 8 | | Service Pack | W/16" Or 17" Wheels | 20017 | 71, 8 |
| | Service Pack | - | 20017 | 71, 8 | Jetta | Sensor | - | 20088 | 71, 8 |
| Touareg 2 | Sensor | Includes Transmitter Only | 20078 | 35, 4 | | Service Pack | - | 20017 | 71, 8 |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | Passat | Sensor | W/16" Or 17" Wheels | 20088 | 71, 8 |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | Service Pack | W/16" Or 17" Wheels | 20017 | 71, 8 |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | Phaeton | Sensor | Includes Transmitter Only; W/315 MHz Sensor | 20077 | 35, 4 |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | Sensor | Includes Transmitter Only; W/433 MHz Sensor | 20078 | 35, 4 |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | Service Pack | Does Not Include Valve; W/315 MHz Sensor | 20023 | 35, 4 |
| 2007 | | | | | | Service Pack | W/43mm Silver Insert; W/315 MHz Sensor | 20037 | 35, 4 |
| Beetle, CC, Eos | Sensor | - | 20088 | 71, 8 | | Service Pack | W/48mm Green Insert; W/315 MHz Sensor | 20038 | 35, 4 |
| | Service Pack | - | 20017 | 71, 8 | | Service Pack | W/49mm Black Insert; W/315 MHz Sensor | 20039 | 35, 4 |
| GLI | Service Pack | - | 20017 | 71, 8 | Service Pack | W/51mm Orange Insert; W/315 MHz Sensor | 20040 | 35, 4 | |
| | Golf, GTI, Jetta, Passat, Rabbit | Sensor | - | 20088 | 71, 8 | | | | |
| Service Pack | | - | 20017 | 71, 8 | | | | | |
| Routan | Sensor | - | | | | | | | |
| | Service Pack | - | | | | | | | |
| Tiguan | Sensor | - | 20088 | 71, 8 | | | | | |
| | Service Pack | - | 20017 | 71, 8 | | | | | |
| Touareg 2 | Sensor | Includes Transmitter Only | 20078 | 35, 4 | | | | | |
| | Service Pack | Does Not Include Valve | 20023 | 35, 4 | | | | | |
| | Service Pack | W/43mm Silver Insert | 20037 | 35, 4 | | | | | |
| | Service Pack | W/48mm Green Insert | 20038 | 35, 4 | | | | | |
| | Service Pack | W/49mm Black Insert | 20039 | 35, 4 | | | | | |
| | Service Pack | W/51mm Orange Insert | 20040 | 35, 4 | | | | | |

Volkswagen (cont.)

Volkswagen (cont.)

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

| Model | Application | Details | Part # | Torque In-lbs, Torque N.m. | Model | Application | Details | Part # | Torque In-lbs, Torque N.m. |
|--|----------------------|---|--------|----------------------------|---------------------|------------------|------------------|--------|----------------------------|
| 2006 (cont.) | | | | | 2009-2008 | | | | |
| Rabbit | Sensor | W/15" Wheels | 20088 | 71, 8 | C30, C70, S40 | Sensor | - | 20097 | 71, 8 |
| | Service Pack | W/15" Wheels | 20017 | 71, 8 | | Service Pack | - | 20003 | 71, 8 |
| Touareg | Service Pack | Does Not Include Valve | 20023 | 62, 7 | S60 | Sensor | - | 20156 | 44, 5 |
| | Service Pack | W/43mm Silver Insert | 20037 | 62, 7 | | Service Pack | - | 20010 | 44, 5 |
| | Service Pack | W/48mm Green Insert | 20038 | 62, 7 | S80, V50, V70, XC70 | Sensor | - | 20097 | 71, 8 |
| | Service Pack | W/49mm Black Insert | 20039 | 62, 7 | | Service Pack | - | 20003 | 71, 8 |
| Service Pack | W/51mm Orange Insert | 20040 | 62, 7 | XC90 | Sensor | W/315 MHz Sensor | 20156 | 44, 5 | |
| | | | | | Service Pack | | 20010 | 44, 5 | |
| 2005-2004 | | | | | 2007 | | | | |
| Phaeton | Sensor | Includes Transmitter Only; W/315 MHz Sensor | 20077 | 35, 4 | C30, C70, S40 | Sensor | - | 20097 | 71, 8 |
| | Sensor | Includes Transmitter Only; W/433 MHz Sensor | 20078 | 35, 4 | | Service Pack | - | 20003 | 71, 8 |
| | Service Pack | Does Not Include Valve; W/315 MHz Sensor | 20023 | 35, 4 | S60 | Sensor | - | 20156 | 44, 5 |
| | Service Pack | W/43mm Silver Insert; W/315 MHz Sensor | 20037 | 35, 4 | | Service Pack | - | 20010 | 44, 5 |
| | Service Pack | W/48mm Green Insert; W/315 MHz Sensor | 20038 | 35, 4 | S80, V50 | Sensor | - | 20097 | 71, 8 |
| | Service Pack | W/49mm Black Insert; W/315 MHz Sensor | 20039 | 35, 4 | | Service Pack | - | 20003 | 71, 8 |
| | Service Pack | W/51mm Orange Insert; W/315 MHz Sensor | 20040 | 35, 4 | V70, XC70, X90 | Sensor | W/315 MHz Sensor | 20156 | 44, 5 |
| | | | | Service Pack | | W/315 MHz Sensor | 20010 | 44, 5 | |
| Touareg | Service Pack | Does Not Include Valve | 20023 | 62, 7 | 2006 | | | | |
| | Service Pack | W/43mm Silver Insert | 20037 | 62, 7 | S60, S80 | Sensor | - | 20156 | 44, 5 |
| | Service Pack | W/48mm Green Insert | 20038 | 62, 7 | | Service Pack | - | 20010 | 44, 5 |
| | Service Pack | W/49mm Black Insert | 20039 | 62, 7 | V50 | Sensor | - | 20097 | 71, 8 |
| | Service Pack | W/51mm Orange Insert | 20040 | 62, 7 | | Service Pack | - | 20003 | 71, 8 |
| | | | | | V70, XC70, XC90 | Sensor | W/315 MHz Sensor | 20156 | 44, 5 |
| | | | | Service Pack | | W/315 MHz Sensor | 20010 | 44, 5 | |
| 2013-2012 | | | | | 2005 | | | | |
| C30, C70, S40, S60, S80, XC60, XC70 | Sensor | - | 20097 | 71, 8 | S60 | Sensor | W/315 MHz Sensor | 20156 | 44, 5 |
| | Service Pack | - | 20003 | 71, 8 | | Service Pack | W/315 MHz Sensor | 20010 | 44, 5 |
| XC90 | Sensor | - | 28362 | 11.5, 1.3 | S80 | Sensor | - | 20156 | 44, 5 |
| | Service Pack | - | 20008 | 11.5, 1.3 | | Service Pack | - | 20010 | 44, 5 |
| 2011 | | | | | V50 | Sensor | - | 20097 | 71, 8 |
| C30, C70, S40, S60, S80, V50, XC60, XC70 | Sensor | - | 20097 | 71, 8 | | Service Pack | - | 20003 | 71, 8 |
| | Service Pack | - | 20003 | 71, 8 | V70, XC70, XC90 | Sensor | W/315 MHz Sensor | 20156 | 44, 5 |
| XC90 | Sensor | W/315 MHz Sensor | 20156 | 44, 5 | | Service Pack | W/315 MHz Sensor | 20010 | 44, 5 |
| | Service Pack | - | 20010 | 44, 5 | 2004 | | | | |
| 2010 | | | | | S60 | Sensor | W/315 MHz Sensor | 20156 | 44, 5 |
| C30, C70, S40, S80, V50, V70, XC60, XC70 | Sensor | - | 20097 | 71, 8 | | Service Pack | W/315 MHz Sensor | 20010 | 44, 5 |
| | Service Pack | - | 20003 | 71, 8 | S80 | Sensor | - | 20156 | 44, 5 |
| XC90 | Sensor | W/315 MHz Sensor | 20156 | 44, 5 | | Service Pack | - | 20010 | 44, 5 |
| | Service Pack | - | 20010 | 44, 5 | V70, XC70 | Sensor | W/315 MHz Sensor | 20156 | 44, 5 |
| | | | | Service Pack | | W/315 MHz Sensor | 20010 | 44, 5 | |
| | | | | XC90 | Sensor | - | 20156 | 44, 5 | |
| | | | | | Service Pack | - | 20010 | 44, 5 | |

Application guides subject to change without notice. Please refer to the manufacturer's websites for the most up-to-date application data.

SCHRADER 2014 TPMS APPLICATION GUIDE

MANUFACTURER'S PART NUMBERS

| OEM Sensor # | Schrader Sensor # | OEM Sensor # | Schrader Sensor # | OEM Sensor # | Schrader Sensor # | OEM Sensor # | Schrader Sensor # |
|--------------|-------------------|--------------|-------------------|---------------|-------------------|---------------|-------------------|
| 0009054100 | 28214 | 313020960 | 20097 | 42753STP6A82 | 20100 | 56053036AA | 20066 |
| 0009054100 | 28214 | 36106790054 | 28081 | 42753SWA306 | 20099 | 5L1Z1A150AA | 20135 |
| 0025406817 | 20094 | 36106798872 | 28126 | 42753SWA316 | 20099 | 68001696AA | 20066 |
| 0025406917 | 20095 | 36106856227 | 28081 | 42753TK4A01 | 20720 | 68001696AA | 28308 |
| 0025407917 | 20094 | 36118378682 | 20080 | 42753TL2A51 | 20098 | 68001696AA | 28434 |
| 0025408017 | 20095 | 36146752128 | 28082 | 42753TL2A52 | 20098 | 68001696AB | 20066 |
| 0025408617 | 28214 | 36236781847 | 20083 | 42753TP6A82 | 20100 | 68001696AB | 28308 |
| 0025409017 | 28214 | 36236798726 | 28081 | 42753TR0A81 | 28720 | 68001698AA | 28155 |
| 0035400217 | 28214 | 40700-1AA0B | 28204 | 42753TX4A51 | 28128 | 68001698AA | 28434 |
| 0045421518 | 28214 | 40700-1AA0D | 28204 | 4313054J20 | 20087 | 68001698AB | 28155 |
| 06421S3VA02 | 28981 | 40700-1PA0A | 28342 | 4313054J21 | 20087 | 68001698AB | 28434 |
| 06421S3VA03 | 28981 | 40700-CD001 | 20064 | 4313054J22 | 20087 | 68006771AA | 20089 |
| 06421S3VA04 | 28981 | 40700-CK001 | 20161 | 4313057L00 | 20066 | 68038945AA | 20089 |
| 06421S9VA01 | 28982 | 40700-CK002 | 20069 | 4313057L00 | 20066 | 68078861AA | 20066 |
| 06421S9VA03 | 28982 | 40700-JA00C | 28204 | 4313057L00 | 28308 | 68078861AA | 28308 |
| 185189 | 20077 | 40700-JA01A | 28167 | 4313078J10 | 20158 | 68193586AA | 28586 |
| 10394110 | 20158 | 40700-JA01B | 28204 | 4313085Z00 | 20153 | 68193586AB | 28586 |
| 10438853 | 28006 | 40700-JA01C | 28204 | 4313086Z20 | 20082 | 68239720AA | 28984 |
| 12768826 | 28206 | 40700-JA02B | 28204 | 4321182Z10 | 28204 | 6F2Z1A189A | 28385 |
| 13172567 | 28078 | 40700-JK00B | 28210 | 4815132 | 28004 | 7L1Z1A189A | 28390 |
| 13227143 | 20159 | 42508875 | 28129 | 4815132AB | 28004 | 7P0907275 | 20103 |
| 13581558 | 28206 | 4250A030 | 28129 | 4D0907275 | 20077 | 7P0907275A | 20077 |
| 13581560 | 20223 | 4250A225 | 28096 | 4D0907275C | 20077 | 7P0907275D | 20103 |
| 13586335 | 20153 | 4250B668 | 20398 | 4D0907275D | 20079 | 7PP907275F | 20103 |
| 15114379 | 20107 | 4250B875 | 28129 | 4F0907275B | 20078 | 86517000 | 20156 |
| 15122618 | 20131 | 4250B877 | 20034 | 4F0907275D | 20103 | 88974915 | 28360 |
| 15136883 | 20115 | 4250B8975 | 28096 | 4F0907275H | 20077 | 8257740060 | 20116 |
| 15254101 | 20153 | 4260702010 | 28365 | 4L2Z 1A150 BA | 20096 | 8973271890 | 20028 |
| 15268606 | 20158 | 4260704010 | 28380 | 5096808AA | 20028 | 8C2Z1A189A | 28395 |
| 15825475 | 20158 | 4260706011 | 28360 | 5127335AB | 20335 | 95536105300 | 20077 |
| 15921013 | 20158 | 4260706020 | 28360 | 5142340AA | 20066 | 95836166100 | 20103 |
| 15922396 | 20153 | 4260708010 | 28670 | 52088990AC | 20028 | 99760602120 | 28087 |
| 1K0907253D | 20088 | 4260724010 | 28310 | 52088990AD | 20028 | 9L3Z1A189A | 20315 |
| 20922900 | 28206 | 4260724020 | 28315 | 529331FA00 | 28983 | BBM2-37-140B | 20093 |
| 20923680 | 20153 | 4260724030 | 28320 | 529332F000 | 28849 | C2C25519 | 20090 |
| 20925924 | 20158 | 4260724030 | 28320 | 529332F001 | 28849 | C2C40476 | 20090 |
| 20964159 | 28423 | 4260724040 | 28325 | 529332G200 | 20086 | C2C40725 | 20091 |
| 224549 | 20077 | 4260730030 | 28335 | 529332G201 | 20086 | C2S40710 | 20091 |
| 224551 | 20084 | 4260730060 | 28370 | 529332M000 | 20092 | C2Z15016 | 20091 |
| 22853741 | 20153 | 4260733011 | 28360 | 529332M001 | 20092 | C2Z15017 | 20090 |
| 22854866 | 28206 | 4260733011 | 28365 | 529332M550 | 20092 | CM5T 1A180 AA | 20315 |
| 22959744 | 28206 | 4260733021 | 28370 | 529332V000 | 28505 | DE8T-1A180-AA | 20315 |
| 24437708 | 28078 | 4260733022 | 28370 | 529334D200 | 20085 | GN3A37140B | 20093 |
| 25758220 | 20076 | 4260735010 | 28345 | 52933A5000 | 20092 | GS1D37140 | 20093 |
| 25773946 | 20117 | 4260775010 | 28345 | 56029319AA | 28154 | LR010532 | 20091 |
| 25774006 | 20116 | 426070C010 | 28300 | 56029319AB | 28154 | LR010533 | 20090 |
| 25799331 | 20153 | 426070C020 | 28305 | 56029359AA | 28155 | LR018860 | 20090 |
| 25920615 | 20153 | 426070C030 | 28670 | 56029359AB | 28155 | LR018861 | 20091 |
| 28103AG00A | 20081 | 426070C050 | 28670 | 56029359AC | 28155 | LR021936 | 20090 |
| 28103AG01A | 28203 | 42607AD020 | 28355 | 56029398AA | 20398 | LR0500461 | 20090 |
| 28103AG01B | 28203 | 426070E011 | 28370 | 56029398AB | 20398 | MN103033 | 20028 |
| 28103AG01C | 28203 | 42753SHA53 | 28981 | 56029400AB | 28291 | MN103081 | 20034 |
| 28103SA001 | 28203 | 42753SHA54 | 28981 | 56029400AC | 28291 | MN103081 | 20034 |
| 28103SA002 | 28203 | 42753SHA82 | 28983 | 56029400AD | 28291 | RQH500471 | 20091 |
| 28103SG000 | 28203 | 42753SNA83 | 28720 | 56029465AB | 20066 | XR855949 | 20091 |
| 28103SG010 | 28203 | 42753SNA84 | 28720 | 56029465AC | 20066 | XR855950 | 20090 |
| 307489910 | 20156 | 42753STKA01 | 20098 | 56029479AA | 20066 | YBD000060 | 28082 |
| 31200923 | 20156 | 42753STKA02 | 20098 | 56029479AB | 28308 | YBD000061 | 28082 |
| 312009230 | 20156 | 42753STKA03 | 20098 | 56029481AB | 28434 | ZZC137140 | 28385 |
| 312802970 | 20097 | 42753STKA04 | 20098 | 56053030AB | 20066 | ZZDA37140 | 20315 |

SCHRADER 2014 TPMS APPLICATION GUIDE

NUMERICAL LISTING: Sensors/Transmitters

| Part # | Year | Model |
|-------------------|-----------------|--------------------|
| 20028 (433 MHz) | Chrysler | |
| | 2002 - 2004 | 300M |
| | 2002 - 2004 | Concorde |
| | 2004 - 2008 | Crossfire |
| | 2002 - 2004 | Intrepid |
| | 2003 - 2004 | Pacifica |
| | 2002 | Prowler |
| | 2002 - 2003 | Town & Country Van |
| | 2002 - 2003 | Voyager |
| | Dodge | |
| | 2002 - 2003 | Caravan |
| | 2002 - 2003 | Grand Caravan |
| | 2002 - 2004 | Intrepid |
| | 2003 - 2011 | Viper |
| | Isuzu | |
| 2004 | Rodeo | |
| Jeep | | |
| 2002 - 2004 | Grand Cherokee | |
| 2002 - 2004 | Liberty | |
| Mitsubishi | | |
| 2004 - 2006 | Endeavor | |
| 2004 - 2006 | Galant | |
| Plymouth | | |
| 2002 | Prowler | |
| Mitsubishi | | |
| 2006 - 11 | Eclipse | |
| 2006 - 12 | Endeavor | |
| 2007 - 13 | Galant | |
| 2003 - 06 | Montero | |
| Infiniti | | |
| 2003 - 2007 | FX35 | |
| 2003 - 2007 | FX45 | |
| 2003 - 2006 | G35 | |
| 2006 - 2007 | M35 | |
| 2003 - 2007 | M45 | |
| 2003 - 2006 | Q45 | |
| 2003 | QX4 | |
| Nissan | | |
| 2003 - 2006 | 350Z | |
| 2003 - 2004 | Frontier | |
| 2003 - 2006 | Murano | |
| 2003 - 2004 | Pathfinder | |
| 2003 - 2004 | Xterra | |

| Part # | Year | Model |
|-------------------|-----------------|------------|
| 20069 (315 MHz) | Infiniti | |
| | 2004 - 2006 | QX56 |
| | Nissan | |
| | 2005 - 2006 | Armada |
| | 2005 - 2007 | Frontier |
| | 2004 | Pathfinder |
| 20076 (315 MHz) | 2004 - 2006 | Quest |
| | 2004 - 2005 | Titan |
| | 2006 | Xterra |
| | Cadillac | |
| 2005 - 2008 | STS | |
| 2004 - 2009 | XLR | |
| Chevrolet | | |
| 2005 - 2009 | Corvette | |
| Audi | | |
| 2011 | A6 | |
| 2003 - 2010 | A8 | |
| 2011 | Q7 | |
| 2011 | S6 | |
| 2003 - 2009 | S8 | |
| Bentley | | |
| 2003 - 2005 | Continental | |
| Ferrari | | |
| 2001 - 2002 | 550 Maranello | |
| 2002 - 2005 | 575M Maranello | |
| 2004 - 2009 | 612 Scaglietti | |
| 2005 - 2009 | F430 | |
| Maserati | | |
| 2004 - 2006 | Quattroporte | |
| Porsche | | |
| 2011 | 911 | |
| 2011 | Boxster | |
| 2011 | Cayman | |
| Volkswagen | | |
| 2004 - 2006 | Phaeton | |
| 2012 - 2013 | Touareg | |
| 2011 - 2012 | Touareg 2 | |
| Audi | | |
| 2002 - 2008 | A4 | |
| 2005 - 2009 | A6 | |
| 2007 - 2009 | Q7 | |
| 2008 - 2009 | R8 | |
| 2007 - 2008 | RS4 | |

| Part # | Year | Model |
|-------------------------|---------------------|-----------------|
| 20078 (433 MHz) (cont.) | Audi (cont.) | |
| | 2004 - 2009 | S4 |
| | 2007 - 2009 | S6 |
| | Bentley | |
| 2006 - 2010 | Continental | |
| Volkswagen | | |
| 2004 - 2006 | Phaeton | |
| 2008 - 2009 | Touareg 2 | |
| 20079 (315 MHz) | Audi | |
| | 2001 - 2003 | A8 |
| | 2001 - 2005 | Allroad Quattro |
| 2001 - 2003 | S8 | |
| BMW | | |
| 2002 - 2005 | 320i | |
| 2002 - 2006 | 325Ci | |
| 2002 - 2006 | 325i | |
| 2002 - 2006 | 325Xi | |
| 2002 - 2006 | 330Ci | |
| 2002 - 2006 | 330i | |
| 2002 - 2006 | 330Xi | |
| 2002 - 2005 | 525i | |
| 2002 - 2005 | 530i | |
| 2002 - 2003 | 540i | |
| 2004 - 2005 | 545i | |
| 2004 - 2005 | 645Ci | |
| 2002 - 2005 | 745i | |
| 2002 - 2005 | 745Li | |
| 2004 - 2005 | 760i | |
| 2003 | 760Li | |
| 2011 | Alpina B7 | |
| 2002 - 2003 | M3 | |
| 2000 - 2003 | M5 | |
| 2003 | Z8 | |
| 20080 (433 MHz) | Subaru | |
| | 2006 - 2011 | B9 Tribeca |
| | 2004 - 2008 | Legacy |
| | 2004 - 2007 | Outback |
| 2008 - 2011 | Tribeca | |
| 20081 (315 MHz) | Suzuki | |
| | 2005 - 2006 | Verona |
| 20082 (315 MHz) | | |

SCHRADER 2014 TPMS APPLICATION GUIDE

NUMERICAL LISTING: Sensors/Transmitters

| Part # | Year | Model |
|-----------------|--------------------|-----------|
| 20083 (315 MHz) | BMW | |
| | 2008 - 2011 | 128I |
| | 2008 - 2010 | 135I |
| | BMW (cont.) | |
| | 2006 - 2010 | 323I |
| | 2007 - 2009 | 328I |
| | 2007 - 2008 | 328XI |
| | 2009 | 335D |
| | 2007 - 2009 | 335I |
| | 2007 - 2008 | 335XI |
| | 2006 - 2007 | 525I |
| | 2006 - 2007 | 525XI |
| | 2008 - 2011 | 528I |
| | 2008 - 2009 | 528XI |
| | 2006 - 2007 | 530I |
| | 2006 - 2007 | 530XI |
| | 2008 - 2011 | 535I |
| | 2008 | 535XI |
| | 2010 | 535XI |
| | 2006 - 2011 | 550I |
| | 2006 - 2010 | 650I |
| | 2011 | 740I |
| | 2011 | 740LI |
| | 2006 - 2011 | 750I |
| | 2006 - 2011 | 750LI |
| | 2006 | 760I |
| | 2004 - 2011 | 760LI |
| | 2007 - 2008 | Alpina B7 |
| | 2004 - 2009 | M3 |
| | 2006 - 2010 | M5 |
| | 2006 - 2010 | M6 |
| | 2006 - 2011 | X3 |
| | 2005 - 2011 | X5 |
| 2008 - 2011 | X6 | |
| 2003 - 2011 | Z4 | |
| Mini | | |
| 2008 - 2009 | Cooper | |
| Ferrari | | |
| 2003 - 2004 | Enzo | |
| Hyundai | | |
| 2007 - 2009 | Entourage | |
| 2007 - 2008 | Santa Fe | |
| 2007 - 2008 | Veracruz | |

| Part # | Year | Model |
|-------------------------|-------------------|--------------|
| 20085 (315 MHz) (cont.) | Kia | |
| | 2006 - 2008 | Sedona |
| 20086 (315 MHz) | Hyundai | |
| | 2006 - 2013 | Azera |
| | 2007 - 2010 | Elantra |
| | 2009 - 2010 | Santa Fe |
| | 2009 - 2012 | Veracruz |
| | Kia | |
| | 2008 - 2010 | Magentis |
| | 2006 - 2010 | Optima |
| | 2006 - 2011 | Rondo |
| | 2009 - 2013 | Sedona |
| 20087 (315 MHz) | Suzuki | |
| | 2007 - 2013 | Grand Vitara |
| | 2007 - 2013 | SX4 |
| 20088 (315 MHz) | 2005 - 2006 | XL-7 |
| | Audi | |
| | 2008 - 2012 | A3 |
| | 2009 - 2012 | A4 |
| | 2008 - 2012 | A5 |
| | 2009 - 2012 | Q5 |
| | 2010 - 2011 | S4 |
| | 2008 - 2012 | S5 |
| | 2008 - 2011 | TT |
| | Volkswagen | |
| | 2008 - 2010 | Beetle |
| | 2009 - 2012 | CC |
| | 2007 - 2013 | Eos |
| 2008 - 2010 | Golf | |
| 2006 - 2010 | GTI | |
| 2006 - 2010 | Jetta | |
| 2006 - 2010 | Passat | |
| 2008 | R32 | |
| 2006 - 2009 | Rabbit | |
| 2009 - 2012 | Tiguan | |
| Dodge | | |
| 2007 - 2010 | Sprinter | |
| Freightliner | | |
| 2007 - 2008 | Sprinter | |
| Jaguar | | |
| 2008 | S-Type | |
| 2005 - 2009 | Super V8 | |
| 2004 - 2008 | Vanden Plas | |

| Part # | Year | Model |
|-------------------------|-----------------------|--------|
| 20090 (315 MHz) (cont.) | Jaguar (cont.) | |
| | 2009 - 2012 | XF |
| | 2010 - 2011 | XFR |
| | 2010 - 2012 | XJ |
| | 2004 - 2009 | XJ8 |
| | 2004 - 2009 | XJR |
| | 2007 - 2012 | XK |
| | 2007 - 2011 | XKR |
| | 2008 | X-Type |
| | Land Rover | |
| | 2012 - 2013 | Evoque |
| 2008 - 2013 | LR2 | |
| 2006 - 2009 | LR3 | |
| 2010 - 2013 | LR4 | |
| 2006 - 2013 | Range Rover | |
| Jaguar | | |
| 2008 | S-Type | |
| 2005 - 2009 | Super V8 | |
| 2004 - 2009 | Vanden Plas | |
| 2009 - 2012 | XF | |
| 2010 - 2011 | XFR | |
| 2010 - 2012 | XJ | |
| 2004 - 2009 | XJ8 | |
| 2004 - 2009 | XJR | |
| 2007 - 2012 | XK | |
| 2007 - 2011 | XKR | |
| 2008 | X-Type | |
| Land Rover | | |
| 2006 - 2009 | LR3 | |
| 2010 - 2011 | LR4 | |
| 2006 - 2011 | Range Rover | |
| Hyundai | | |
| 2012 - 2014 | Accent | |
| 2010 - 2012 | Elantra Touring | |
| 2014 | Equus | |
| 2010 - 2012 | Genesis | |
| 2013 - 2014 | Santa Fe | |
| 2011 - 2014 | Sonata | |
| Kia | | |
| 2014 | Cadenza | |
| 2010 - 2013 | Forte | |
| 2011 - 2013 | Optima | |
| 2011 - 2013 | Sorento | |
| 2010 - 2013 | Soul | |

NUMERICAL LISTING: Sensors/Transmitters **SCHRADER 2014** TPMS APPLICATION **GUIDE**

| Part # | Year | Model |
|-----------------|----------------------|------------|
| 20093 (315 MHz) | Mazda | |
| | 2011 - 2013 | 2 |
| | 2004 - 2013 | 3 |
| | 2006 - 2013 | 5 |
| | 2008 - 2013 | 6 |
| | 2007 - 2011 | CX-7 |
| | 2007 - 2013 | CX-9 |
| | 2006 - 2012 | MX-5 Miata |
| | 2004 - 2011 | RX-8 |
| 20094 (433 MHz) | Mercedes-Benz | |
| | 2007 - 2009 | CL550 |
| | 2007 - 2009 | CL600 |
| | 2007 - 2009 | CL63 |
| | 2008 - 2009 | CL65 |
| | 2006 | CLS500 |
| | 2006 | CLS55 |
| | 2007 - 2011 | CLS550 |
| | 2007 - 2011 | CLS63 |
| | 2006 - 2009 | E320 |
| | 2006 - 2009 | E350 |
| | 2006 | E500 |
| | 2006 | E55 |
| | 2007 - 2009 | E550 |
| | 2007 - 2009 | E63 |
| | 2010 | S400 |
| | 2007 - 2010 | S550 |
| | 2007 - 2010 | S600 |
| | 2007 - 2010 | S63 |
| | 2007 - 2010 | S65 |
| | 2006 | SL500 |
| | 2006 - 2008 | SL55 |
| 2007 - 2009 | SL550 | |
| 2006 - 2009 | SL600 | |
| 2009 - 2011 | SL63 | |
| 2006 - 2011 | SL65 | |
| 2008 - 2009 | SLR McLaren | |
| 20095 (433 MHz) | Mercedes-Benz | |
| | 2006 - 2009 | E350 |
| | 2007 - 2009 | E550 |
| | 2007 - 2009 | GL320 |
| | 2007 - 2009 | GL450 |
| | 2008 - 2009 | GL550 |
| | 2007 - 2009 | ML320 |
| | 2006 - 2009 | ML350 |
| 2006 - 2007 | ML500 | |

| Part # | Year | Model |
|-------------------------|------------------------------|-------------|
| 20095 (433 MHz) (cont.) | Mercedes-Benz (cont.) | |
| | 2008 - 2009 | ML550 |
| | 2007 - 2009 | ML63 |
| | 2007 - 2009 | R320 |
| | 2006 - 2009 | R350 |
| | 2006 - 2007 | R500 |
| | 2007 | R63 |
| 20096 (433 MHz) | Ford | |
| | 2003 - 2004 | Expedition |
| | 2002 - 2005 | Explorer |
| | Lincoln | |
| | 2003 - 2005 | Aviator |
| | 2003 - 2004 | Navigator |
| | Mercury | |
| | 2002 - 2005 | Mountaineer |
| | Volvo | |
| | 2007 - 2013 | C30 |
| 20097 (433 MHz) | 2007 - 2013 | C70 |
| | 2007 - 2013 | S40 |
| | 2011 - 2013 | S60 |
| | 2007 - 2013 | S80 |
| | 2005 - 2011 | V50 |
| | 2008 - 2010 | V70 |
| | 2009 - 2013 | XC60 |
| | 2008 - 2013 | XC70 |
| | Acura | |
| | 2007 - 2013 | MDX |
| 20098 (315 MHz) | 2007 - 2012 | RDX |
| | 2007 - 2014 | TSX |
| | Honda | |
| | 2009 - 2014 | Pilot |
| | Honda | |
| 20099 (315 MHz) | 2008 - 2012 | Accord |
| | 2007 - 2011 | CR-V |
| | 2008 | Fit |
| 20100 (315 MHz) | Honda | |
| | 2010 - 2011 | Accord |
| | 2012 - 2014 | Crosstour |
| 20103 (433 MHz) | 2012 - 2013 | CR-V |
| | Audi | |
| | 2009 - 2010 | A6 |
| | 2010 - 2012 | Q7 |
| | 2010 - 2014 | R8 |
| 2010 | S6 | |

| Part # | Year | Model |
|-------------------------|-------------------|-------------------------|
| 20103 (433 MHz) (cont.) | Bentley | |
| | 2007 - 2014 | Azure |
| | 2012 - 2014 | Continental |
| | 2011 - 2014 | Mulsanne |
| | Porsche | |
| | 2011 - 2014 | Cayenne |
| | Volkswagen | |
| | 2011 - 2013 | Touareg |
| | 2010 - 2012 | Touareg 2 |
| | Cadillac | |
| 2005 - 2006 | Escalade | |
| 20107 (315 MHz) | Chevrolet | |
| | 2005 - 2006 | Avalanche |
| | 2005 - 2007 | Silverado Series Pickup |
| | 2005 - 2006 | Suburban |
| | 2005 - 2006 | Tahoe |
| | GMC | |
| | 2005 - 2007 | Sierra Series Pickup |
| 2005 - 2006 | Yukon | |
| 20115 (315 MHz) | Cadillac | |
| | 2004 | Escalade |
| | Chevrolet | |
| | 2004 | Avalanche |
| | 2004 | Silverado Series Pickup |
| | 2004 | Suburban |
| | 2004 | Tahoe |
| | GMC | |
| | 2004 | Sierra Series Pickup |
| | 2004 | Yukon |
| 20116 (315 MHz) | Buick | |
| | 2006 - 2007 | Rainier |
| | Cadillac | |
| | 2004 - 2007 | CTS |
| | 2004 - 2006 | SRX |
| | Chevrolet | |
| | 2006 | SSR |
| | 2006 - 2009 | Trailblazer |
| | GMC | |
| | 2006 - 2009 | Envoy |
| 20117 (315 MHz) | Isuzu | |
| | 2006 - 2008 | Ascender |
| | Saab | |
| | 2005 - 2009 | 9-7X |
| | Cadillac | |
| 2001 - 2005 | Deville | |
| 2001 - 2004 | Seville | |
| Chevrolet | | |
| 2001 - 2004 | Corvette | |

SCHRADER 2014 TPMS APPLICATION GUIDE

NUMERICAL LISTING: Sensors/Transmitters

| Part # | Year | Model |
|-----------------|-------------------------|--------------|
| 20131 (315 MHz) | Chevrolet | |
| | 2007 - 2012 | Colorado |
| | GMC | |
| | 2007 - 2012 | Canyon |
| | Hummer | |
| | 2006 - 2010 | H3 |
| | 2006 - 2010 | H3T |
| | Isuzu | |
| | 2007 - 2009 | I-290 |
| | 2007 - 2009 | I-370 |
| 20135 (315 MHz) | Ford | |
| | 2005 - 2006 | Expedition |
| | 2004 - 2005 | Freestar |
| | Lincoln | |
| | 2005 - 2006 | Navigator |
| | Mercury | |
| | 2004 - 2005 | Monterey Van |
| | Buick | |
| | 2009 | Allure |
| | 2009 - 2014 | Enclave |
| 20153 (315 MHz) | 2009 | Lacrosse |
| | 2007 | LeSabre |
| | 2007 - 2011 | Lucerne |
| | Cadillac | |
| | 2008 - 2013 | CTS |
| | 2007 - 2011 | DTS |
| | 2007 - 2013 | Escalade |
| | 2007 - 2009 | SRX |
| | 2009 - 2011 | STS |
| | Chevrolet | |
| 2007 - 2013 | Avalanche | |
| 2007 - 2012 | Aveo | |
| 2012 - 2013 | Captiva | |
| 2008 - 2009 | Cobalt | |
| 2010 - 2014 | Express | |
| 2008 - 2011 | HHR | |
| 2007 - 2013 | Impala | |
| 2008 - 2012 | Malibu | |
| 2007 | Monte Carlo | |
| 2007 - 2013 | Silverado Series Pickup | |
| 2007 - 2013 | Suburban | |
| 2007 - 2013 | Tahoe | |
| 2009 - 2014 | Traverse | |

| Part # | Year | Model |
|-------------------------|----------------|----------------------|
| 20153 (315 MHz) (cont.) | GMC | |
| | 2009 - 2014 | Acadia |
| | 2010 - 2014 | Savana |
| | 2007 - 2014 | Sierra Series Pickup |
| | 2007 - 2013 | Yukon |
| | Hummer | |
| | 2008 - 2010 | H2 |
| | Pontiac | |
| | 2009 - 2010 | G3 |
| | 2009 | G3 Wave |
| 20156 (315 MHz) | 2009 - 2010 | G5 |
| | 2009 - 2010 | G6 |
| | 2008 - 2010 | G8 |
| | 2008 | Grand Prix |
| | 2008 - 2009 | Wave |
| | Saturn | |
| | 2008 - 2010 | Aura |
| | 2009 - 2010 | Outlook |
| | 2007 - 2010 | VUE |
| | Suzuki | |
| 2007 - 2008 | Forenza | |
| 2007 - 2008 | Reno | |
| Volvo | | |
| 2004 - 2009 | S60 | |
| 2004 - 2006 | S80 | |
| 2004 - 2007 | V70 | |
| 2004 - 2007 | XC70 | |
| 2004 - 2011 | XC90 | |
| Buick | | |
| 2007 - 2008 | Allure | |
| 2008 | Enclave | |
| 2007 - 2008 | Lacrosse | |
| Cadillac | | |
| 2009 - 2013 | CTS - V | |
| 2006 | DTS | |
| 2007 | Escalade | |
| 2009 | STS - V | |
| Chevrolet | | |
| 2007 | Avalanche | |
| 2011 - 2013 | Caprice | |
| 2008 | Cobalt | |
| 2010 - 2013 | Corvette | |
| 2007 - 2009 | Equinox | |
| 2008 - 2009 | Express | |
| 2008 - 2009 | HHR | |
| 2006 - 2007 | Impala | |

| Part # | Year | Model |
|-------------------------|--------------------------|-------------------------|
| 20158 (315 MHz) (cont.) | Chevrolet (cont.) | |
| | 2008 | Malibu |
| | 2006 - 2007 | Monte Carlo |
| | 2007 | Silverado Series Pickup |
| | 2007 | Suburban |
| | 2007 | Tahoe |
| | 2008 - 2009 | Uplander |
| | GMC | |
| | 2007 - 2008 | Acadia |
| | 2008 - 2009 | Savana |
| Pontiac | | |
| 2007 | Sierra Series Pickup | |
| 2007 | Yukon | |
| Saturn | | |
| 2008 | G5 | |
| 2008 | G6 | |
| 2007 - 2008 | Grand Prix | |
| 2008 - 2009 | Montana | |
| 2008 - 2010 | Solstice | |
| 2007 - 2009 | Torrent | |
| Suzuki | | |
| 2007 | Aura | |
| 2008 - 2009 | Lambda | |
| 2007 - 2008 | Outlook | |
| 2008 - 2010 | Sky | |
| Saab | | |
| 2007 - 2011 | XL-7 | |
| Suzuki | | |
| 2007 - 2011 | XL-7 | |
| Saab | | |
| 2008 - 2012 | 9-3 | |
| 2008 - 2012 | 9-5 | |
| Infiniti | | |
| 2005 - 2007 | QX56 | |
| Nissan | | |
| 2005 - 2008 | Armada | |
| 2005 - 2008 | Frontier | |
| 2006 - 2007 | Maxima | |
| 2005 - 2006 | Pathfinder | |
| 2005 - 2006 | Quest | |
| 2007 | Sentra | |
| 2005 - 2007 | Titan | |
| 2005 - 2006 | Xterra | |
| Chevrolet | | |
| 2014 | Corvette | |

SCHRADER 2014 TPMS APPLICATION GUIDE

NUMERICAL LISTING: Sensors/Transmitters

| Part # | Year | Model | |
|-----------------|-----------------|--------------------|---------|
| 20315 (315 MHz) | Ford | | |
| | 2012 - 2014 | C-MAX | |
| | 2010 - 2014 | E Series Van | |
| | 2010 - 2013 | E350 Super Duty | |
| | 2011 - 2014 | Edge | |
| | 2009 - 2014 | Escape | |
| | 2011 - 2014 | Expedition | |
| | 2011 - 2014 | Explorer | |
| | 2009 - 2014 | F Series Pickup | |
| | 2011 - 2014 | Fiesta | |
| | 2011 - 2014 | Flex | |
| | 2010 - 2014 | Focus | |
| | 2010 - 2014 | Fusion | |
| | 2010 - 2014 | Mustang | |
| | 2011 - 2014 | Super Duty Pickup | |
| | 2010 - 2011 | Super Duty Van | |
| | 2010 - 2014 | Taurus | |
| | 2010 - 2014 | Transit Connect | |
| | 20335 (315 MHz) | Lincoln | |
| | | 2009 | Mark LT |
| 2011 - 2014 | | MKS | |
| 2011 - 2014 | | MKT | |
| 2011 - 2014 | | MKX | |
| 2010 - 2014 | | MKZ | |
| 2011 - 2014 | | Navigator | |
| 2011 | | Town Car | |
| Mazda | | | |
| 2009 - 2011 | | Tribute | |
| 20335 (315 MHz) | Mercury | | |
| | 2011 | Grand Marquis | |
| | 2009 - 2011 | Mariner | |
| | 2010 - 2011 | Milan | |
| 20335 (315 MHz) | Chrysler | | |
| | 2004 - 2005 | Pacifica | |
| | 2004 - 2005 | Town & Country Van | |
| | Dodge | | |
| 2004 - 2005 | Caravan | | |
| 2004 - 2005 | Grand Caravan | | |
| 20398 (433 MHz) | Chrysler | | |
| | 2010 - 2014 | 300 | |
| | 2011 - 2014 | Town & Country Van | |
| | Dodge | | |
| | 2010 - 2014 | Challenger | |
| | 2010 - 2014 | Charger | |
| | 2011 - 2014 | Durango | |
| | 2011 - 2014 | Grand Caravan | |
| | 2010 - 2014 | Journey | |
| | 2010 - 2011 | Magnum | |

| Part # | Year | Model |
|-------------------------|----------------------|----------------|
| 20398 (433 MHz) (cont.) | Dodge (cont.) | |
| | 2012 | Ram 4500HD |
| | 2012 | Ram 5500HD |
| | 2010 - 2013 | Ram 1500 |
| | 2010 - 2013 | Ram 2500 |
| | Fiat | |
| | 2011 - 2014 | 500 |
| | 2013 - 2014 | 500 Arbarth |
| | 2013 - 2014 | 500c |
| | 2013 - 2014 | 500e |
| 2011 - 2014 | 500L | |
| 20720 (433 MHz) | Jeep | |
| | 2011 - 2014 | Grand Cherokee |
| | 2013 - 2014 | Wrangler |
| 28004 (315 MHz) | Mitsubishi | |
| | 2011 - 2012 | Lancer |
| 28006 (315 MHz) | Acura | |
| | 2009 - 2013 | TL |
| 28007 (433 MHz) | Chrysler | |
| | 2010 - 2013 | ZDX |
| 28006 (315 MHz) | Chrysler | |
| | 1997 - 2001 | Prowler |
| 28006 (315 MHz) | Chevrolet | |
| | 1997 - 2000 | Corvette |
| 28078 (433 MHz) | Saab | |
| | 2003 - 2007 | 9-3 |
| | 2003 - 2007 | 9-5 |
| | Saturn | |
| 2008 - 2009 | Astra | |
| 28081 (433 MHz) | BMW | |
| | 2012 | 128i |
| | 2012 - 2013 | 135i |
| | 2013 | 135iS |
| | 2010 - 2013 | 328i |
| | 2010 - 2012 | 335D |
| | 2010 - 2013 | 335i |
| | 2012 - 2013 | 335iS |
| | 2010 | 335xi |
| | 2012 - 2013 | 528i |
| | 2012 - 2014 | 535i |
| | 2012 - 2013 | 550i |
| | 2012 - 2014 | 640i |
| | 2012 - 2014 | 650i |
| 2012 - 2013 | 740i | |
| 2012 - 2013 | 740Li | |
| 2012 - 2013 | 750i | |
| 2012 - 2013 | 750Li | |
| 2012 | ActiveE | |

| Part # | Year | Model |
|-------------------------|--------------------|---------------|
| 28081 (433 MHz) (cont.) | BMW (cont.) | |
| | 2012 | M1 |
| | 2010 - 2013 | M3 |
| | 2013 | M5 |
| | 2013 - 2014 | M6 |
| | 2014 | M6 Gran Coupe |
| | 2012 - 2014 | X1 |
| | 2012 - 2014 | X3 |
| | 2012 - 2014 | X5 |
| | 2012 - 2014 | X6 |
| 2012 - 2014 | Z4 | |
| 28082 (433 MHz) | Mini | |
| | 2010 - 2013 | Cooper |
| 28087 (433 MHz) | BMW | |
| | 2000 - 2004 | X5 |
| 28087 (433 MHz) | Land Rover | |
| | 2005 | LR3 |
| 28087 (433 MHz) | Porsche | |
| | 2002 - 2005 | Range Rover |
| 28087 (433 MHz) | Porsche | |
| | 2010 | 911 |
| | 2010 | Boxster |
| | 2009 - 2010 | Cayman |
| 28096 (315 MHz) | Porsche | |
| | 2010 - 2011 | Panamera |
| 28096 (315 MHz) | Mitsubishi | |
| | 2008 - 2014 | Lancer |
| 28126 (433 MHz) | Mitsubishi | |
| | 2007 - 2014 | Outlander |
| 28126 (433 MHz) | BMW | |
| | 2014 | 328i |
| | 2014 | 335i |
| 28128 (315 MHz) | BMW | |
| | 2014 | 335iS |
| 28128 (315 MHz) | Acura | |
| | 2014 | MDX |
| | 2013 - 2014 | RDX |
| | Mitsubishi | |
| 2006 - 2007 | Eclipse | |
| 2012 | Eclipse | |
| 2011 - 2012 | Endeavor | |
| 2007 - 2013 | Galant | |
| 28167 (315 MHz) | Nissan | |
| | 2007 | Pathfinder |
| | 2007 | Versa |
| 28203 (315 MHz) | Nissan | |
| | 2007 | Xterra |
| | Subaru | |
| | 2008 - 2014 | Forester |
| | 2008 - 2013 | Impreza |
| | 2008 - 2014 | Legacy |
| | 2008 - 2014 | Outback |
| 2008 - 2014 | Tribeca | |
| 2013 | XV Crosstrek | |

SCHRADER 2014 TPMS APPLICATION GUIDE

NUMERICAL LISTING: Sensors/Transmitters

| Part # | Year | Model |
|-----------------|-----------------|-----------------|
| 28204 (315 MHz) | Infiniti | |
| | 2007 - 2008 | FX35 |
| | 2007 - 2008 | FX45 |
| | 2007 | G35 |
| | 2008 - 2012 | M35 |
| | 2012 | M35H |
| | 2011 - 2012 | M37 |
| | 2008 - 2010 | M45 |
| | 2011 - 2012 | M56 |
| | 2006 | Q45 |
| | 2007 - 2008 | QX56 |
| | 2009 - 2010 | QX56 |
| | Nissan | |
| | 2007 - 2009 | 350Z |
| | 2006 - 2012 | Altima |
| | 2008 - 2013 | Armada |
| | 2009 - 2010 | Cube |
| | 2011 - 2012 | Cube (non-IKey) |
| | 2008 - 2013 | Frontier |
| | 2009 - 2014 | GT-R |
| | 2011 - 2012 | Juke (non-IKey) |
| | 2007 - 2012 | Maxima |
| | 2007 - 2012 | Murano |
| | 2007 - 2012 | Pathfinder |
| | 2007 - 2009 | Quest |
| | 2008 - 2012 | Rogue |
| | 2007 - 2013 | Sentra |
| | 2007 - 2013 | Titan |
| 2007 - 2012 | Versa | |
| 2007 - 2013 | Xterra | |
| Suzuki | | |
| 2009 - 2013 | Equator | |
| Buick | | |
| 2010 | Allure | |
| 2013 - 2014 | Encore | |
| 2010 - 2014 | Lacrosse | |
| 2011 - 2014 | Regal | |
| 2012 - 2014 | Verano | |
| Cadillac | | |
| 2013 - 2014 | ATS | |
| 2014 | CTS | |
| 2014 | ELR | |
| 2014 | Escalade | |
| 2010 - 2014 | SRX | |
| 2013 - 2014 | XTS | |

| Part # | Year | Model |
|---------------------------|----------------------|-------------------------|
| 28206 (314.9 MHz) (cont.) | Chevrolet | |
| | 2010 - 2014 | Camaro |
| | 2010 | Cobalt |
| | 2011 - 2014 | Cruze |
| | 2010 - 2014 | Equinox |
| | 2010 | HHR |
| | 2014 | Impala |
| | 2010 | Malibu |
| | 2013 - 2014 | Malibu |
| | 2012 | Orlando |
| | 2014 | Silverado Series Pickup |
| | 2012 - 2014 | Sonic |
| | 2013 - 2014 | Spark |
| | 2014 | Spark EV |
| | 2014 | Suburban |
| | 2014 | Tahoe |
| | 2011 - 2014 | Volt |
| | GMC | |
| | 2010 - 2014 | Terrain |
| | 2014 | Yukon |
| | Saab | |
| | 2011 - 2012 | 9-4X |
| | Saturn | |
| | 2010 | Astra |
| | Infiniti | |
| | 2008 - 2010 | EX35 |
| | 2009 - 2010 | FX35 |
| | 2009 - 2010 | FX50 |
| 2007 - 2008 | G35 | |
| 2008 - 2010 | G37 | |
| Nissan | | |
| 2009 - 2010 | 370Z | |
| Mercedes-Benz | | |
| 2012 - 2013 | C250 | |
| 2007 | C280 | |
| 2008 - 2012 | C300 | |
| 2013 | C300 | |
| 2007 - 2013 | C350 | |
| 2008 - 2013 | C63 | |
| 2010 - 2013 | CL550 | |
| 2010 - 2013 | CL600 | |
| 2010 - 2013 | CL63 | |
| 2010 - 2013 | CL65 | |
| 2006 - 2009 | CLK350 | |
| 2006 | CLK500 | |
| 2006 | CLK55 | |
| 2007 - 2009 | CLK550 | |
| 28210 (315 MHz) | Infiniti | |
| | 2008 - 2010 | EX35 |
| | 2009 - 2010 | FX35 |
| | 2009 - 2010 | FX50 |
| | 2007 - 2008 | G35 |
| | 2008 - 2010 | G37 |
| | Nissan | |
| | 2009 - 2010 | 370Z |
| | Mercedes-Benz | |
| | 2012 - 2013 | C250 |
| | 2007 | C280 |
| | 2008 - 2012 | C300 |
| | 2013 | C300 |
| | 2007 - 2013 | C350 |
| | 2008 - 2013 | C63 |
| | 2010 - 2013 | CL550 |
| | 2010 - 2013 | CL600 |
| | 2010 - 2013 | CL63 |
| | 2010 - 2013 | CL65 |
| | 2006 - 2009 | CLK350 |
| | 2006 | CLK500 |
| | 2006 | CLK55 |
| | 2007 - 2009 | CLK550 |

| Part # | Year | Model |
|-------------------------|------------------------------|--------|
| 28214 (433 MHz) (cont.) | Mercedes-Benz (cont.) | |
| | 2007 - 2009 | CLK63 |
| | 2012 - 2013 | CLS550 |
| | 2012 - 2013 | CLS63 |
| | 2010 - 2013 | E350 |
| | 2010 - 2013 | E550 |
| | 2010 - 2013 | E63 |
| | 2007 - 2008 | G500 |
| | 2007 - 2011 | G55 |
| | 2009 - 2013 | G550 |
| | 2010 - 2013 | GL350 |
| | 2010 - 2013 | GL450 |
| | 2010 - 2013 | GL550 |
| | 2013 | GL63 |
| | 2010 - 2013 | GLK350 |
| | 2010 - 2013 | ML350 |
| | 2010 - 2011 | ML450 |
| | 2010 - 2011 | ML550 |
| | 2010 - 2013 | ML63 |
| | 2010 - 2013 | R350 |
| | 2012 - 2013 | S350 |
| | 2011 - 2013 | S400 |
| | 2011 - 2013 | S550 |
| | 2011 - 2013 | S600 |
| | 2011 - 2013 | S63 |
| | 2011 - 2013 | S65 |
| | 2012 - 2013 | SL550 |
| | 2012 - 2013 | SL63 |
| 2012 - 2013 | SLK250 | |
| 2007 - 2009 | SLK280 | |
| 2010 - 2011 | SLK300 | |
| 2007 - 2013 | SLK350 | |
| 2007 - 2010 | SLK55 | |
| 2011 - 2013 | SLS | |
| Smart | | |
| 2008 - 2013 | Fortwo | |
| Chrysler | | |
| 2009 - 2010 | 300 | |
| Dodge | | |
| 2008 - 2012 | Challenger | |
| 2009 - 2010 | Charger | |
| 2009 | Magnum | |
| Toyota | | |
| 2004 - 2007 | Sequoia | |
| 2005 | Tacoma | |
| 2005 - 2006 | Tundra | |

SCHRADER 2014 TPMS APPLICATION GUIDE

NUMERICAL LISTING: Sensors/Transmitters

| Part # | Year | Model |
|--------------------|-----------------|--------------------|
| 28305 (315 MHz) | Toyota | |
| | 2004 - 2007 | Sequoia |
| | 2005 | Tacoma |
| | 2005 - 2006 | Tundra |
| 28308 (315 MHz) | Chrysler | |
| | 2011 - 2014 | 200 |
| | 2005 - 2007 | 300 |
| | 2007 - 2009 | Aspen |
| | 2005 | Crossfire |
| | 2006 - 2008 | Pacifica |
| | 2008 - 2010 | PT Cruiser |
| | 2007 - 2010 | Sebring |
| | 2006 - 2008 | Town & Country Van |
| | Dodge | |
| | 2008 - 2014 | Avenger |
| | 2007 - 2012 | Caliber |
| | 2006 - 2007 | Caravan |
| | 2005 - 2007 | Charger |
| | 2011 | Dakota |
| | 2007 - 2010 | Durango |
| | 2006 - 2007 | Grand Caravan |
| | 2005 - 2007 | Magnum |
| | 2007 - 2012 | Nitro |
| | Jeep | |
| 2006 - 2007 | Commander | |
| 2007 - 2014 | Compass | |
| 2005 - 2007 | Grand Cherokee | |
| 2005 - 2012 | Liberty | |
| 2007 - 2014 | Patriot | |
| 2007 - 2008 | Wrangler | |
| 2011 - 2012 | Wrangler | |
| Suzuki | | |
| 2010 - 2012 | Kizashi | |
| Lexus | | |
| 2002 - 2006 | SC430 | |
| Lexus | | |
| 2002 - 2006 | SC430 | |
| Lexus | | |
| 2002 - 2006 | SC430 | |
| Lexus | | |
| 2002 - 2006 | SC430 | |

| Part # | Year | Model |
|-----------------|----------------|------------------|
| 28335 (315 MHz) | Lexus | |
| | 2006 | GS300 |
| | 2005 - 2006 | GS430 |
| | 2006 | GX470 |
| | 2006 | IS250 |
| | 2006 | IS350 |
| 28342 (315 MHz) | Toyota | |
| | 2006 | 4 Runner |
| 28345 (315 MHz) | Nissan | |
| | 2011 - 2013 | NV |
| | 2013 | NV-200 |
| 28355 (315 MHz) | Lexus | |
| | 2004 - 2006 | GX470 |
| 28360 (315 MHz) | Toyota | |
| | 2010 - 2012 | HS250h |
| 28362 (315 MHz) | Toyota | |
| | 2003 - 2006 | 4 Runner |
| | Toyota | |
| | 2005 - 2006 | Tacoma |
| | Pontiac | |
| | 2008 - 2010 | Vibe |
| | Scion | |
| | 2013 | FR-S |
| | Subaru | |
| | 2013 - 2014 | BRZ |
| | Toyota | |
| | 2006 - 2013 | Avalon |
| | 2007 - 2011 | Camry (USA Mfg.) |
| | 2007 - 2013 | Corolla |
| 2011 - 2013 | Highlander | |
| 2007 - 2013 | Matrix | |
| 2012 | RAV4 E | |
| 2006 - 2011 | Solara | |
| 2006 - 2013 | Tacoma | |
| 2009 - 2013 | Venza | |
| 2013 | Yaris | |
| Volvo | | |
| 2012 - 2013 | XC90 | |
| 28365 (315 MHz) | Lexus | |
| | 2006 | GX470 |
| | 2005 - 2006 | LX470 |
| | 2006 | LX470 |
| | Scion | |
| | 2011 - 2013 | iQ |
| | 2006 - 2014 | tC |
| | 2007 - 2013 | xB |
| 2008 - 2013 | xD | |

| Part # | Year | Model |
|-------------------------|---------------|--------------------|
| 28365 (315 MHz) (cont.) | Toyota | |
| | 2006 - 2009 | 4 Runner |
| | 2007 - 2011 | Camry (Japan Mfg.) |
| | 2008 - 2011 | Camry Hybrid |
| | 2007 - 2013 | Corolla |
| | 2008 - 2013 | FJ Cruiser |
| | 2007 - 2010 | Highlander |
| | 2008 - 2010 | Highlander Hybrid |
| | 2005 - 2013 | Land Cruiser |
| | 2007 - 2013 | Matrix |
| | 2005 - 2013 | Prius |
| | 2012 | Prius V |
| | 2006 | RAV4 |
| | 2007 - 2012 | Yaris |
| | Lexus | |
| | 2011 - 2013 | CT200h |
| | 2013 - 2014 | ES300h |
| | 2007 - 2014 | ES350 |
| | 2007 - 2011 | GS350 |
| | 2006 - 2007 | GS430 |
| 2007 - 2013 | GS450h | |
| 2008 - 2012 | GS460 | |
| 2013 | GX460 | |
| 2007 - 2009 | GX470 | |
| 2006 - 2012 | IS C | |
| 2006 - 2013 | IS F | |
| 2006 - 2013 | IS250 | |
| 2006 - 2013 | IS300H | |
| 2006 - 2014 | IS350 | |
| 2011 - 2013 | LFA | |
| 2007 - 2013 | LS460 | |
| 2008 - 2013 | LS600h | |
| 2006 - 2007 | LX470 | |
| 2008 - 2014 | LX570 | |
| 2006 | RX330 | |
| 2007 - 2013 | RX350 | |
| 2006 - 2012 | RX400h | |
| 2010 - 2014 | RX450h | |
| 2013 | RXF Sport | |
| 2006 - 2010 | SC430 | |
| Toyota | | |
| 2006 - 2013 | 4 Runner | |
| 2009 - 2012 | Corolla | |
| 2007 - 2013 | RAV4 | |

SCHRADER 2014 TPMS APPLICATION GUIDE

NUMERICAL LISTING: Sensors/Transmitters

| Part # | Year | Model |
|--------------------|----------------|---------------------|
| 28380 (315 MHz) | Toyota | |
| | 2005 - 2013 | Tacoma |
| | Ford | |
| | 2006 - 2011 | Crown Victoria |
| | 2007 | E Series Van |
| | 2007 - 2008 | Edge |
| | 2005 - 2008 | Escape |
| | 2006 - 2010 | Explorer |
| | 2006 - 2010 | Explorer Sport Trac |
| | 2007 - 2008 | F Series Pickup |
| | 2007 | Focus |
| | 2006 - 2007 | Freestar |
| | 2007 - 2009 | Fusion |
| | 2006 - 2011 | Grand Marquis |
| | 2007 - 2009 | Mustang |
| | 2007 - 2011 | Ranger |
| | Lincoln | |
| | 2007 - 2008 | Mark LT |
| | 2007 - 2008 | MKX |
| 2007 - 2009 | MKZ | |
| 2006 - 2010 | Town Car | |
| Mazda | | |
| 2007 - 2009 | B2300 Pickup | |
| 2007 - 2008 | B3000 Pickup | |
| 2007 - 2009 | B4000 Pickup | |
| 2006 | Tribute | |
| 2008 | Tribute | |
| Mercury | | |
| 2006 - 2010 | Grand Marquis | |
| 2005 - 2008 | Mariner | |
| 2007 - 2009 | Milan | |
| 2006 - 2007 | Monterey Van | |
| 2006 - 2010 | Mountaineer | |
| Ford | | |
| 2007 - 2010 | Edge | |
| 2007 - 2010 | Expedition | |
| 2006 - 2007 | Five Hundred | |
| 2009 - 2010 | Flex | |
| 2008 - 2009 | Focus | |
| 2008 - 2010 | Taurus | |
| 2008 - 2009 | Taurus X | |
| Lincoln | | |
| 2009 - 2010 | MKS | |
| 2010 | MKT | |
| 2007 - 2010 | MKX | |
| 2007 - 2010 | Navigator | |

| Part # | Year | Model |
|-------------------------|--------------------|-------------------|
| 28390 (315 MHz) (cont.) | Mercury | |
| | 2006 - 2007 | Montego |
| | 2008 - 2009 | Sable |
| 28395 (315 MHz) | Ford | |
| | 2008 - 2010 | E Series Van |
| | 2007 - 2009 | E350 Super Duty |
| | 2008 | F Series Pickup |
| | 2008 - 2010 | F450 Super Duty |
| | 2010 | F550 Super Duty |
| | 2008 - 2010 | Super Duty Pickup |
| | 2008 - 2010 | Super Duty Van |
| | Cadillac | |
| | 2014 | ATS-V |
| 2014 | CTS - V | |
| Chevrolet | | |
| 2012 - 2014 | Camaro - ZL1 | |
| 2014 | SS | |
| Chrysler | | |
| 2007 - 2008 | 300 | |
| 2008 - 2010 | Town & Country Van | |
| Dodge | | |
| 2008 | Challenger | |
| 2008 | Charger | |
| 2008 - 2010 | Grand Caravan | |
| 2009 - 2010 | Journey | |
| 2008 | Magnum | |
| 2009 - 2010 | Ram 1500 | |
| 2009 - 2010 | Ram 2500 | |
| Jeep | | |
| 2008 - 2011 | Commander | |
| 2008 - 2010 | Grand Cherokee | |
| 2009 | Liberty | |
| 2009 - 2010 | Wrangler | |
| Dodge | | |
| 2008 - 2010 | Dakota | |
| 2008 | Ram 1500 | |
| 2008 | Ram 2500 | |
| Mitsubishi | | |
| 2008 - 2009 | Raider | |
| Hyundai | | |
| 2012 - 2013 | Veloster | |
| Dodge | | |
| 2012 - 2014 | Dart | |
| Toyota | | |
| 2008 - 2013 | Sequoia | |
| 2006 - 2013 | Sienna | |
| 2006 - 2013 | Tundra | |

| Part # | Year | Model |
|-----------------|----------------|---------|
| 28720 (315 MHz) | Acura | |
| | 2008 - 2011 | CSX |
| | Honda | |
| | 2008 - 2014 | Civic |
| | 2011 - 2014 | CR-Z |
| | 2009 - 2011 | Element |
| | 2009 - 2013 | Fit |
| | 2010 - 2014 | Insight |
| | 2011 - 2014 | Odyssey |
| | Hyundai | |
| 2008 - 2011 | Accent | |
| 2011 - 2013 | Equus | |
| 2011 - 2012 | Genesis | |
| 2009 - 2010 | Sonata | |
| 2010 - 2013 | Tucson | |
| Kia | | |
| 2009 - 2011 | Borrego | |
| 2007 - 2011 | Rio | |
| 2006 - 2009 | Spectra | |
| 2009 - 2013 | Sportage | |
| Acura | | |
| 2004 - 2006 | MDX | |
| 2005 - 2012 | RL | |
| 2005 - 2008 | TL | |
| Honda | | |
| 2005 - 2007 | Odyssey | |
| 2005 - 2008 | Pilot | |
| 2006 - 2014 | Ridgeline | |
| Honda | | |
| 2005 | Pilot | |
| 2006 - 2008 | Ridgeline | |
| Honda | | |
| 2009 - 2010 | Odyssey | |
| Hyundai | | |
| 2007 - 2008 | Sonata | |
| 2007 - 2008 | Tiburon | |
| 2006 - 2009 | Tucson | |
| Kia | | |
| 2007 - 2009 | Amanti | |
| 2007 - 2009 | Sorento | |
| 2005 - 2008 | Sportage | |
| Dodge | | |
| 2014 | Ram 1500 | |
| 2014 | Ram 2500 | |
| 2014 | Ram 3500 SRW | |
| Jeep | | |
| 2014 | Cherokee | |

Application guides subject to change without notice. Please refer to the manufacturer's websites for the most up-to-date application data.

SCHRADER 2014 TPMS APPLICATION GUIDE

NUMERICAL LISTING: Service Packs

| Part # | Year | Model |
|-------------------|--------------------|--------------|
| 20002 | Ford | |
| | 2003 - 2006 | Expedition |
| | 2002 - 2005 | Explorer |
| | 2004 - 2005 | Freestar |
| | Lincoln | |
| | 2003 - 2005 | Aviator |
| | 2003 - 2006 | Navigator |
| | Mercury | |
| | 2004 - 2005 | Monterey Van |
| | 2002 - 2005 | Mountaineer |
| | Cadillac | |
| | 2001 - 2005 | Deville |
| | 2001 - 2004 | Seville |
| | Chevrolet | |
| | 2001 - 2004 | Corvette |
| | 2001 - 2004 | Corvette C5 |
| 2001 - 2004 | Corvette Z06 | |
| Chrysler | | |
| 2002 - 2004 | 300M | |
| 2002 - 2004 | Concorde | |
| 2004 - 2008 | Crossfire | |
| 2002 - 2004 | Intrepid | |
| 2003 - 2004 | Pacifica | |
| 2001 - 2002 | Prowler | |
| 2002 - 2003 | Town & Country Van | |
| 2002 - 2003 | Voyager | |
| Dodge | | |
| 2002 - 2003 | Caravan | |
| 2002 - 2003 | Grand Caravan | |
| 2002 - 2004 | Intrepid | |
| 2003 - 2011 | Viper | |
| Isuzu | | |
| 2004 | Rodeo | |
| Jeep | | |
| 2002 - 2004 | Grand Cherokee | |
| 2002 - 2004 | Liberty | |
| Mitsubishi | | |
| 2006 - 2012 | Eclipse | |
| 2004 - 2012 | Endeavor | |
| 2004 - 2013 | Galant | |
| 2003 - 2006 | Montero | |
| Plymouth | | |
| 1997 | Prowler | |
| 1999 - 2002 | Prowler | |
| Volvo | | |
| 2007 - 2013 | C30 | |
| 2007 - 2013 | C70 | |
| 2007 - 2013 | S40 | |
| 2011 - 2013 | S60 | |
| 2007 - 2013 | S80 | |

| Part # | Year | Model |
|------------------|-------------------------|----------|
| 20003 (cont.) | Volvo (cont.) | |
| | 2005 - 2011 | V50 |
| | 2008 - 2010 | V70 |
| | 2009 - 2013 | XC60 |
| | 2008 - 2013 | XC70 |
| | Buick | |
| | 2007 - 2008 | Allure |
| | 2008 | Enclave |
| | 2007 - 2008 | Lacrosse |
| | 2006 - 2007 | Rainier |
| Cadillac | | |
| 2014 | ATS-V | |
| 2004 - 2013 | CTS | |
| 2009 - 2014 | CTS - V | |
| 2006 | DTS | |
| 2004 - 2006 | Escalade | |
| 2004 - 2006 | SRX | |
| 2005 - 2008 | STS | |
| 2004 - 2009 | XLR | |
| Chevrolet | | |
| 2004 - 2006 | Avalanche | |
| 2012 - 2014 | Camaro ZL1 | |
| 2011 - 2013 | Caprice | |
| 2008 - 2009 | Cobalt | |
| 2005 - 2013 | Corvette | |
| 2006 - 2013 | Corvette | |
| 2005 - 2009 | Corvette C6 | |
| 2005 - 2012 | Corvette Z06 | |
| 2007 - 2009 | Equinox | |
| 2008 - 2009 | Express | |
| 2008 - 2009 | HHR | |
| 2006 - 2007 | Impala | |
| 2008 | Malibu | |
| 2006 - 2007 | Monte Carlo | |
| 2004 - 2007 | Silverado Series Pickup | |
| 2014 | SS | |
| 2006 | SSR | |
| 2004 - 2006 | Suburban | |
| 2004 - 2006 | Tahoe | |
| 2006 - 2009 | Trailblazer | |
| 2008 - 2009 | Uplander | |
| GMC | | |
| 2007 - 2008 | Acadia | |
| 2006 - 2009 | Envoy | |
| 2008 - 2009 | Savana | |
| 2004 - 2007 | Sierra Series Pickup | |
| 2004 - 2006 | Yukon | |
| Isuzu | | |
| 2006 - 2008 | Ascender | |

| Part # | Year | Model |
|------------------|----------------|------------|
| 20004 (cont.) | Pontiac | |
| | 2008 | G5 |
| | 2008 | G6 |
| | 2007 - 2008 | Grand Prix |
| | 2008 - 2009 | Montana |
| | 2008 - 2010 | Solstice |
| | 2007 - 2009 | Torrent |
| | Saab | |
| | 2005 - 2009 | 9-7X |
| | Saturn | |
| | 2007 | Aura |
| | 2008 - 2009 | Lambda |
| 2007 - 2008 | Outlook | |
| 2008 - 2010 | Sky | |
| Suzuki | | |
| 2007 - 2011 | XL-7 | |
| Infiniti | | |
| 2004 - 2006 | QX56 | |
| 2005 - 2006 | Armada | |
| Nissan | | |
| 2005 - 2007 | Frontier | |
| 2004 | Pathfinder | |
| 2004 - 2006 | Quest | |
| 2004 - 2005 | Titan | |
| 2006 | Xterra | |
| Chevrolet | | |
| 2007 - 2012 | Colorado | |
| GMC | | |
| 2007 - 2012 | Canyon | |
| Hummer | | |
| 2006 - 2010 | H3 | |
| 2006 - 2010 | H3T | |
| Isuzu | | |
| 2007 - 2009 | I-290 | |
| 2007 - 2009 | I-370 | |
| Infiniti | | |
| 2003 - 2007 | FX35 | |
| 2003 - 2007 | FX45 | |
| 2003 - 2006 | G35 | |
| 2007 | M35 | |
| 2003 - 2004 | M45 | |
| 2006 - 2007 | M45 | |
| 2003 - 2006 | Q45 | |
| 2003 | QX4 | |
| 2005 - 2007 | QX56 | |
| Nissan | | |
| 2003 - 2006 | 350Z | |
| 2005 - 2008 | Armada | |
| 2003 - 2008 | Frontier | |
| 2006 - 2007 | Maxima | |

SCHRADER 2014 TPMS APPLICATION GUIDE

NUMERICAL LISTING: Service Packs

| Part # | Year | Model |
|---------------|-------------------------|-------------|
| 20007 (cont.) | Nissan (cont.) | |
| | 2003 - 2006 | Murano |
| | 2003 - 2006 | Pathfinder |
| | 2005 - 2006 | Quest |
| | 2007 | Sentra |
| | 2005 - 2007 | Titan |
| | 2003 - 2006 | Xterra |
| 20008 | Buick | |
| | 2009 - 2010 | Allure |
| | 2010 | Allure |
| | 2009 - 2014 | Enclave |
| | 2013 - 2014 | Encore |
| | 2009 - 2014 | Lacrosse |
| | 2007 | LeSabre |
| | 2007 - 2011 | Lucerne |
| | 2011 - 2014 | Regal |
| | 2012 - 2014 | Verano |
| | Cadillac | |
| | 2013 - 2014 | ATS |
| | 2008 - 2014 | CTS |
| | 2007 - 2011 | DTS |
| | 2014 | ELR |
| | 2007 - 2014 | Escalade |
| | 2007 - 2014 | SRX |
| | 2009 - 2011 | STS |
| | 2013 - 2014 | XTS |
| | Chevrolet | |
| | 2007 - 2013 | Avalanche |
| | 2007 - 2012 | Aveo |
| | 2010 - 2014 | Camaro |
| | 2012 - 2013 | Captiva |
| | 2008 - 2010 | Cobalt |
| | 2011 - 2014 | Cruze |
| | 2010 - 2014 | Equinox |
| | 2010 - 2014 | Express |
| | 2008 - 2011 | HHR |
| | 2007 - 2014 | Impala |
| | 2008 - 2014 | Malibu |
| | 2007 | Monte Carlo |
| | 2012 | Orlando |
| 2007 - 2014 | Silverado Series Pickup | |
| 2012 - 2014 | Sonic | |
| 2013 - 2014 | Spark | |
| 2014 | Spark EV | |
| 2007 - 2014 | Suburban | |
| 2007 - 2014 | Tahoe | |
| 2009 - 2014 | Traverse | |
| 2011 - 2014 | Volt | |
| Dodge | | |
| 2011 | Dakota | |

| Part # | Year | Model |
|-------------------|-------------------|----------------------|
| 20008 (cont.) | GMC | |
| | 2009 - 2014 | Acadia |
| | 2010 - 2014 | Savana |
| | 2007 - 2014 | Sierra Series Pickup |
| | 2010 - 2014 | Terrain |
| | 2007 - 2014 | Yukon |
| | Hummer | |
| | 2008 - 2010 | H2 |
| | Hyundai | |
| | 2012 - 2013 | Veloster |
| | Mitsubishi | |
| | 2012 | Lancer |
| | Pontiac | |
| | 2009 - 2010 | G3 |
| | 2009 | G3 Wave |
| | 2009 - 2010 | G5 |
| | 2009 - 2010 | G6 |
| | 2008 - 2010 | G8 |
| | 2008 | Grand Prix |
| | 2008 - 2009 | Wave |
| | Saab | |
| | 2011 - 2012 | 9-4X |
| | Saturn | |
| | 2010 | Astra |
| | 2008 - 2010 | Aura |
| | 2009 - 2010 | Outlook |
| | 2007 - 2010 | VUE |
| Subaru | | |
| 2008 - 2014 | Forester | |
| 2008 - 2013 | Impreza | |
| 2008 - 2014 | Legacy | |
| 2008 - 2014 | Outback | |
| 2008 - 2014 | Tribeca | |
| 2013 | XV Crosstrek | |
| Suzuki | | |
| 2007 - 2008 | Forenza | |
| 2007 - 2008 | Reno | |
| Volvo | | |
| 2012 - 2013 | XC90 | |
| Saab | | |
| 2003 - 2012 | 9-3 | |
| 2003 - 2012 | 9-5 | |
| Saturn | | |
| 2008 - 2009 | Astra | |
| Suzuki | | |
| 2007 - 2013 | Grand Vitara | |
| 2007 - 2013 | SX4 | |
| 2005 - 2006 | Verona | |
| 2005 - 2006 | XL-7 | |
| Mitsubishi | | |
| 2006 - 2007 | Eclipse | |
| 2011 - 2012 | Endeavor | |
| 2007 - 2013 | Galant | |

| Part # | Year | Model |
|---------------|-------------------|--------------------|
| 20010 (cont.) | Volvo | |
| | 2004 - 2009 | S60 |
| | 2004 - 2006 | S80 |
| | 2004 - 2007 | V70 |
| | 2004 - 2007 | XC70 |
| 2004 - 2011 | XC90 | |
| 20011 | Subaru | |
| | 2006 - 2011 | B9 Tribeca |
| | 2004 - 2008 | Legacy |
| 2004 - 2007 | Outback | |
| 2008 - 2009 | Tribeca | |
| 20012 | Chevrolet | |
| | 1997 - 2000 | Corvette |
| | Chrysler | |
| | 2001 | Prowler |
| | Plymouth | |
| 1997 | Prowler | |
| 1999 - 2001 | Prowler | |
| 20013 | Chrysler | |
| | 2011 - 2012 | 200 |
| | 2005 - 2008 | 300 |
| | 2007 - 2009 | Aspen |
| | 2005 | Crossfire |
| | 2006 - 2008 | Pacifica |
| | 2008 - 2010 | PT Cruiser |
| | 2007 - 2010 | Sebring |
| | 2006 - 2010 | Town & Country Van |
| | Dodge | |
| | 2008 - 2012 | Avenger |
| 2007 - 2012 | Caliber | |
| 2006 - 2007 | Caravan | |
| 2005 - 2008 | Charger | |
| 2008 - 2010 | Dakota | |
| 2007 - 2010 | Durango | |
| 2006 - 2010 | Grand Caravan | |
| 2009 - 2010 | Journey | |
| 2005 - 2009 | Magnum | |
| 2007 - 2012 | Nitro | |
| 2008 - 2010 | Ram Series Pickup | |
| 2007 | Stratus | |
| 2006 - 2011 | Commander | |
| 2007 - 2011 | Compass | |
| 2005 - 2010 | Grand Cherokee | |
| 2005 - 2012 | Liberty | |
| 2007 - 2012 | Patriot | |
| 2007 - 2011 | Wrangler | |
| 2008 - 2009 | Raider | |
| Suzuki | | |
| 2010 - 2012 | Kizashi | |
| 20014 | Infiniti | |
| | 2008 - 2010 | EX35 |
| | 2007 - 2010 | FX35 |
| | 2007 - 2008 | FX45 |
| 2009 - 2010 | FX50 | |

■ NUMERICAL LISTING: Service Packs

SCHRADER 2014 TPMS APPLICATION GUIDE

| Part # | Year | Model |
|------------------|-------------------------|-----------------|
| 20014 (cont.) | Infiniti (cont.) | |
| | 2007 - 2008 | G35 |
| | 2008 - 2010 | G37 |
| | 2008 - 2012 | M35 |
| | 2012 | M35H |
| | 2011 - 2012 | M37 |
| | 2008 - 2010 | M45 |
| | 2011 - 2012 | M56 |
| | 2006 | Q45 |
| | 2007 - 2010 | QX56 |
| | Nissan | |
| | 2007 - 2009 | 350Z |
| | 2009 - 2010 | 370Z |
| | 2006 - 2012 | Altima |
| | 2008 - 2013 | Armada |
| | 2009 - 2010 | Cube |
| | 2011 - 2012 | Cube (non-IKey) |
| | 2008 - 2013 | Frontier |
| | 2009 - 2014 | GT-R |
| | 2011 - 2012 | Juke (non-IKey) |
| | 2007 - 2012 | Maxima |
| | 2007 | Murano |
| | 2009 - 2012 | Murano |
| | 2011 - 2013 | NV |
| | 2013 | NV-200 |
| | 2007 - 2012 | Pathfinder |
| | 2007 - 2009 | Quest |
| | 2008 - 2009 | Rogue |
| | 2011 - 2012 | Rogue |
| | 2007 - 2013 | Sentra |
| | 2007 - 2013 | Titan |
| | 2007 - 2012 | Versa |
| 2007 - 2013 | Xterra | |
| Suzuki | | |
| 2009 - 2013 | Equator | |
| Cadillac | | |
| 2007 | Escalade | |
| Chevrolet | | |
| 2007 | Avalanche | |
| 2007 | Silverado Series Pickup | |
| 2007 | Suburban | |
| 2007 | Tahoe | |
| GMC | | |
| 2007 | Sierra Series Pickup | |
| 2007 | Yukon | |
| Chrysler | | |
| 2009 - 2010 | 300 | |
| 2012 | 300 | |
| Dodge | | |
| 2008 - 2012 | Challenger | |
| 2009 - 2010 | Charger | |
| 2009 | Magnum | |

| Part # | Year | Model |
|---------------|----------------------|--------|
| 20016 (cont.) | Mercedes-Benz | |
| | 2012 - 2013 | C250 |
| | 2007 | C280 |
| | 2008 - 2013 | C300 |
| | 2007 - 2013 | C350 |
| | 2008 - 2013 | C63 |
| | 2010 - 2013 | CL550 |
| | 2010 - 2013 | CL600 |
| | 2010 - 2013 | CL63 |
| | 2010 - 2013 | CL65 |
| | 2006 - 2009 | CLK350 |
| | 2006 | CLK500 |
| | 2006 | CLK55 |
| | 2007 - 2009 | CLK550 |
| | 2007 - 2009 | CLK63 |
| | 2012 - 2013 | CLS550 |
| | 2012 - 2013 | CLS63 |
| | 2010 - 2013 | E350 |
| | 2010 - 2013 | E550 |
| | 2010 - 2013 | E63 |
| | 2007 - 2008 | G500 |
| | 2007 - 2011 | G55 |
| | 2009 - 2013 | G550 |
| | 2010 - 2013 | GL350 |
| | 2010 - 2013 | GL450 |
| | 2010 - 2013 | GL550 |
| | 2013 | GL63 |
| | 2010 - 2013 | GLK350 |
| | 2010 - 2013 | ML350 |
| | 2010 - 2011 | ML450 |
| | 2010 - 2011 | ML550 |
| | 2010 - 2013 | ML63 |
| | 2010 - 2013 | R350 |
| | 2012 - 2013 | S350 |
| | 2011 - 2013 | S400 |
| | 2011 - 2013 | S550 |
| | 2011 - 2013 | S600 |
| | 2011 - 2013 | S63 |
| | 2011 - 2013 | S65 |
| | 2012 - 2013 | SL550 |
| | 2012 - 2013 | SL63 |
| | 2012 - 2013 | SLK250 |
| | 2007 - 2008 | SLK280 |
| | 2009 - 2011 | SLK300 |
| | 2007 - 2013 | SLK350 |
| | 2007 - 2010 | SLK55 |
| | 2011 - 2013 | SLS |
| | 2012 - 2013 | SLS |
| | Smart | |
| | 2008 - 2013 | Fortwo |

| Part # | Year | Model |
|-----------------|--------------------|--------|
| 20017 | Audi | |
| | 2008 - 2012 | A3 |
| | 2009 - 2012 | A4 |
| | 2008 - 2012 | A5 |
| | 2009 - 2012 | Q5 |
| | 2010 - 2011 | S4 |
| | 2008 - 2012 | S5 |
| | 2008 - 2011 | TT |
| | Volkswagen | |
| | 2008 - 2010 | Beetle |
| | 2009 - 2012 | CC |
| | 2007 - 2013 | Eos |
| | 2008 - 2009 | GLI |
| | 2006 - 2010 | Golf |
| | 2006 - 2010 | GTI |
| | 2006 - 2010 | Jetta |
| | 2006 - 2010 | Passat |
| | 2008 | R32 |
| | 2006 - 2009 | Rabbit |
| | 2009 - 2012 | Tiguan |
| Chrysler | | |
| 2012 - 2014 | 200 | |
| 2011 - 2014 | 300 | |
| 2011 - 2014 | Town & Country Van | |
| Dodge | | |
| 2013 - 2014 | Avenger | |
| 2010 - 2014 | Challenger | |
| 2010 - 2014 | Charger | |
| 2011 - 2014 | Durango | |
| 2011 - 2014 | Grand Caravan | |
| 2010 - 2014 | Journey | |
| 2010 - 2011 | Magnum | |
| 2012 | Ram 4500HD | |
| 2012 | Ram 5500HD | |
| 2010 - 2013 | Ram Series Pickup | |
| Fiat | | |
| 2011 - 2014 | 500 | |
| 2013 - 2014 | 500 Arbarth | |
| 2013 - 2014 | 500c | |
| 2013 - 2014 | 500e | |
| 2011 - 2014 | 500L | |
| Ford | | |
| 2012 - 2014 | C-MAX | |
| 2010 - 2014 | E Series Van | |
| 2010 - 2013 | E350 Super Duty | |
| 2011 - 2014 | Edge | |
| 2009 - 2014 | Escape | |
| 2012 - 2014 | Expedition | |
| 2012 - 2014 | Explorer | |
| 2009 - 2014 | F Series Pickup | |

SCHRADER 2014 TPMS APPLICATION GUIDE

NUMERICAL LISTING: Service Packs

| Part # | Year | Model |
|----------------|---------------------|--------------------|
| 20018 (cont.) | Ford (cont.) | |
| | 2011 - 2014 | Fiesta |
| | 2011 - 2014 | Flex |
| | 2010 - 2014 | Focus |
| | 2010 - 2014 | Fusion |
| | 2010 - 2014 | Mustang |
| | 2012 - 2014 | Super Duty Pickup |
| | 2010 | Super Duty Van |
| | 2010 - 2014 | Taurus |
| | 2014 | Transit |
| | 2010 - 2014 | Transit Connect |
| | Jeep | |
| | 2006 - 2011 | Commander |
| | 2007 - 2014 | Compass |
| 2005 - 2014 | Grand Cherokee | |
| 2010 - 2012 | Liberty | |
| 2012 - 2014 | Patriot | |
| 2012 - 2014 | Wrangler | |
| Lincoln | | |
| 2011 - 2014 | MKS | |
| 2011 - 2014 | MKT | |
| 2011 - 2014 | MKX | |
| 2010 - 2014 | MKZ | |
| 2011 - 2014 | Navigator | |
| 2011 | Town Car | |
| Mazda | | |
| 2009 - 2010 | Tribute | |
| Mercury | | |
| 2009 - 2011 | Mariner | |
| 2010 - 2011 | Milan | |
| 20019 | Acura | |
| | 2008 - 2011 | CSX |
| | 2009 - 2013 | TL |
| | 2010 - 2013 | ZDX |
| | Honda | |
| | 2008 - 2014 | Civic |
| | 2011 - 2014 | CR-Z |
| | 2009 - 2011 | Element |
| | 2009 - 2013 | Fit |
| | 2010 - 2014 | Insight |
| | 2011 - 2014 | Odyssey |
| | Hyundai | |
| | 2010 - 2013 | Elantra |
| | Kia | |
| 2012 - 2013 | Rio | |
| 20020 | Chrysler | |
| | 2011 - 2012 | 200 |
| | 2005 - 2012 | 300 |
| | 2007 - 2009 | Aspen |
| | 2005 | Crossfire |
| | 2006 - 2008 | Pacifica |
| | 2008 - 2010 | PT Cruiser |
| | 2007 - 2010 | Sebring |
| | 2006 - 2010 | Town & Country Van |

| Part # | Year | Model |
|----------------------|----------------|-------------------|
| 20020 (cont.) | Dodge | |
| | 2008 - 2012 | Avenger |
| | 2007 - 2012 | Caliber |
| | 2006 - 2007 | Caravan |
| | 2008 - 2012 | Challenger |
| | 2005 - 2010 | Charger |
| | 2008 - 2010 | Dakota |
| | 2007 - 2010 | Durango |
| | 2006 - 2010 | Grand Caravan |
| | 2009 - 2010 | Journey |
| | 2005 - 2008 | Magnum |
| | 2007 - 2012 | Nitro |
| | 2008 - 2010 | Ram Series Pickup |
| | 2007 | Stratus |
| Jeep | | |
| 2006 - 2011 | Commander | |
| 2007 - 2011 | Compass | |
| 2005 - 2010 | Grand Cherokee | |
| 2005 - 2012 | Liberty | |
| 2007 - 2012 | Patriot | |
| 2007 - 2011 | Wrangler | |
| Mercedes-Benz | | |
| 2012 - 2013 | C250 | |
| 2007 | C280 | |
| 2008 - 2013 | C300 | |
| 2007 - 2013 | C350 | |
| 2008 - 2013 | C63 | |
| 2010 - 2013 | CL550 | |
| 2010 - 2013 | CL600 | |
| 2010 - 2013 | CL63 | |
| 2010 - 2013 | CL65 | |
| 2006 - 2009 | CLK350 | |
| 2006 | CLK500 | |
| 2006 | CLK55 | |
| 2007 - 2009 | CLK550 | |
| 2007 - 2009 | CLK63 | |
| 2012 - 2013 | CLS550 | |
| 2012 - 2013 | CLS63 | |
| 2010 - 2013 | E350 | |
| 2010 - 2013 | E550 | |
| 2010 - 2013 | E63 | |
| 2007 - 2008 | G500 | |
| 2007 - 2011 | G55 | |
| 2009 - 2013 | G550 | |
| 2010 - 2013 | GL350 | |
| 2010 - 2013 | GL450 | |
| 2010 - 2013 | GL550 | |
| 2013 | GL63 | |
| 2010 - 2013 | GLK350 | |
| 2010 - 2013 | ML350 | |

| Part # | Year | Model |
|-------------------|------------------------------|-----------------|
| 20020 (cont.) | Mercedes-Benz (cont.) | |
| | 2010 - 2011 | ML450 |
| | 2010 - 2011 | ML550 |
| | 2010 - 2013 | ML63 |
| | 2010 - 2013 | R350 |
| | 2012 - 2013 | S350 |
| | 2011 - 2013 | S400 |
| | 2011 - 2013 | S550 |
| | 2011 - 2013 | S600 |
| | 2011 - 2013 | S63 |
| | 2011 - 2013 | S65 |
| | 2012 - 2013 | SL550 |
| | 2012 - 2013 | SL63 |
| | 2012 - 2013 | SLK250 |
| 2007 - 2008 | SLK280 | |
| 2009 - 2011 | SLK300 | |
| 2007 - 2013 | SLK350 | |
| 2007 - 2010 | SLK55 | |
| 2011 - 2013 | SLS | |
| Mitsubishi | | |
| 2008 - 2009 | Raider | |
| Smart | | |
| 2008 - 2013 | Fortwo | |
| Suzuki | | |
| 2010 - 2012 | Kizashi | |
| 20022 | Hyundai | |
| | 2008 - 2011 | Accent |
| | 2011 - 2014 | Equus |
| | 2009 | Genesis |
| | 2011 - 2012 | Genesis |
| | 2009 - 2010 | Sonata |
| | 2010 - 2013 | Tucson |
| | Kia | |
| | 2009 - 2011 | Borrego |
| | 2007 - 2011 | Rio |
| | 2006 - 2009 | Spectra |
| | 2009 - 2013 | Sportage |
| | Toyota | |
| | 2008 - 2013 | Sequoia |
| 2006 - 2013 | Sienna | |
| 2006 - 2013 | Tundra | |
| 20023 | Audi | |
| | 2002 - 2008 | A4 |
| | 2005 - 2011 | A6 |
| | 2001 - 2010 | A8 |
| | 2001 - 2005 | Allroad Quattro |
| | 2007 - 2012 | Q7 |
| | 2008 - 2014 | R8 |
| | 2007 - 2008 | RS4 |
| | 2004 - 2009 | S4 |
| | 2007 - 2011 | S6 |
| 2001 - 2003 | S8 | |
| 2007 - 2009 | S8 | |

NUMERICAL LISTING: Service Packs

SCHRADER 2014 TPMS APPLICATION GUIDE

| Part # | Year | Model |
|----------------|-------------|-------|
| Bentley | | |
| 2007 - 2009 | Azure | |
| 2012 - 2014 | Azure | |
| 2003 - 2010 | Continental | |
| 2004 - 2010 | Continental | |
| 2012 - 2014 | Continental | |
| 2011 - 2014 | Mulsanne | |
| BMW | | |
| 2008 - 2012 | 128i | |
| 2008 - 2013 | 135i | |
| 2013 | 135iS | |
| 2001 - 2005 | 320i | |
| 2000 | 323Ci | |
| 2000 | 323i | |
| 2006 - 2010 | 323i | |
| 2001 - 2006 | 325Ci | |
| 2001 - 2006 | 325i | |
| 2001 - 2006 | 325xi | |
| 2000 | 328Ci | |
| 2000 | 328i | |
| 2007 - 2014 | 328i | |
| 2007 - 2008 | 328xi | |
| 2001 - 2006 | 330Ci | |
| 2001 - 2006 | 330i | |
| 2001 - 2006 | 330xi | |
| 2009 - 2012 | 335D | |
| 2007 - 2014 | 335i | |
| 2012 - 2014 | 335iS | |
| 2007 - 2010 | 335xi | |
| 2001 - 2007 | 525i | |
| 2006 - 2007 | 525xi | |
| 1997 - 2000 | 528i | |
| 2008 - 2013 | 528i | |
| 2008 - 2009 | 528xi | |
| 2001 - 2007 | 530i | |
| 2006 - 2007 | 530xi | |
| 2008 - 2014 | 535i | |
| 2008 | 535xi | |
| 2010 | 535xi | |
| 1997 - 2003 | 540i | |
| 2004 - 2013 | 545i | |
| 2012 - 2014 | 640i | |
| 2004 - 2005 | 645Ci | |
| 2006 - 2010 | 650i | |
| 2012 - 2014 | 650i | |
| 1997 - 2001 | 740i | |
| 2011 - 2013 | 740i | |
| 1997 - 2001 | 740iL | |
| 2011 - 2013 | 740Li | |
| 2002 - 2005 | 745i | |
| 2002 - 2005 | 745Li | |

| Part # | Year | Model |
|----------------------|----------------|-------|
| BMW (cont.) | | |
| 2006 - 2013 | 750i | |
| 1997 - 2001 | 750iL | |
| 2006 - 2013 | 750Li | |
| 2004 - 2006 | 760i | |
| 2003 - 2008 | 760Li | |
| 2010 - 2011 | 760Li | |
| 2007 - 2008 | Alpina B7 | |
| 2011 | Alpina B7 | |
| 2012 | M1 | |
| 2001 - 2006 | M3 | |
| 2008 - 2013 | M3 | |
| 2000 - 2003 | M5 | |
| 2006 - 2010 | M5 | |
| 2013 | M5 | |
| 2006 - 2010 | M6 | |
| 2013 - 2014 | M6 | |
| 2014 | M6 Gran Coupe | |
| 2012 - 2014 | X1 | |
| 2006 - 2014 | X3 | |
| 2000 - 2014 | X5 | |
| 2008 - 2014 | X6 | |
| 2000 - 2002 | Z3 | |
| 2003 - 2014 | Z4 | |
| 2000 - 2003 | Z8 | |
| Bugatti | | |
| 2006 | Veyron | |
| Ferrari | | |
| 2001 - 2002 | 550 Maranello | |
| 2002 - 2005 | 575M Maranello | |
| 2004 - 2009 | 612 Scaglietti | |
| 2003 - 2004 | Enzo | |
| 2005 - 2009 | F430 | |
| Land Rover | | |
| 2005 | LR3 | |
| 2002 - 2005 | Range Rover | |
| Maserati | | |
| 2004 - 2006 | Coupe | |
| 2004 - 2006 | Gransport | |
| 2006 | MC12 | |
| 2004 - 2006 | Quattroporte | |
| 2004 - 2006 | Spyder | |
| Mercedes-Benz | | |
| 2000 - 2006 | CL500 | |
| 2001 - 2006 | CL55 | |
| 2001 - 2006 | CL600 | |
| 2005 - 2006 | CL65 | |
| 2001 - 2005 | E320 | |
| 2001 - 2002 | E430 | |
| 2003 - 2005 | E500 | |
| 1999 - 2005 | E55 | |
| 2008 | R550 | |

| Part # | Year | Model |
|------------------------------|--------------------|-------|
| Mercedes-Benz (cont.) | | |
| 2006 | S350 | |
| 2000 - 2006 | S430 | |
| 2000 - 2006 | S500 | |
| 2001 - 2006 | S55 | |
| 2001 - 2006 | S600 | |
| 2001 - 2005 | SL500 | |
| 2003 - 2005 | SL55 | |
| 2001 - 2005 | SL600 | |
| 2005 | SL65 | |
| 2004 - 2007 | SLR McLaren | |
| Mini | | |
| 2008 - 2013 | Cooper | |
| Porsche | | |
| 2005 - 2011 | 911 | |
| 2005 - 2011 | Boxster | |
| 2004 - 2006 | Carrera GT | |
| 2003 - 2006 | Cayenne | |
| 2008 - 2010 | Cayenne | |
| 2006 - 2011 | Cayman | |
| Rolls-Royce | | |
| 2007 - 2010 | Phantom | |
| Volkswagen | | |
| 2004 - 2006 | Phaeton | |
| 2004 - 2007 | Touareg | |
| 2011 - 2013 | Touareg | |
| 2008 - 2012 | Touareg 2 | |
| Buick | | |
| 2007 - 2008 | Allure | |
| 2008 | Enclave | |
| 2007 - 2008 | Lacrosse | |
| Chevrolet | | |
| 2007 - 2009 | Equinox | |
| 2008 - 2009 | Express | |
| Chrysler | | |
| 2005 - 2008 | 300 | |
| 2002 - 2004 | 300M | |
| 2007 - 2009 | Aspen | |
| 2002 - 2004 | Concorde | |
| 2004 - 2008 | Crossfire | |
| 2002 - 2004 | Intrepid | |
| 2004 - 2008 | Pacifica | |
| 2002 | Prowler | |
| 2008 - 2010 | PT Cruiser | |
| 2007 - 2009 | Sebring | |
| 2004 - 2010 | Town & Country Van | |
| Dodge | | |
| 2008 - 2009 | Avenger | |
| 2007 - 2010 | Caliber | |
| 2004 - 2007 | Caravan | |
| 2005 - 2008 | Charger | |
| 2007 - 2008 | Durango | |
| 2004 - 2010 | Grand Caravan | |

SCHRADER 2014 TPMS APPLICATION GUIDE

NUMERICAL LISTING: Service Packs

| Part # | Year | Model |
|----------------------|------|----------------|
| Dodge (cont.) | | |
| 2009 - 2010 | | Journey |
| 2005 - 2009 | | Magnum |
| 2007 - 2008 | | Nitro |
| GMC | | |
| 2007 - 2008 | | Acadia |
| 2008 - 2009 | | Savana |
| Jaguar | | |
| 2008 | | S-Type |
| 2005 - 2009 | | Super V8 |
| 2004 - 2009 | | Vanden Plas |
| 2009 - 2012 | | XF |
| 2010 - 2011 | | XFR |
| 2010 - 2012 | | XJ |
| 2004 - 2009 | | XJ8 |
| 2004 - 2009 | | XJR |
| 2007 - 2012 | | XK |
| 2007 - 2011 | | XKR |
| 2008 | | X-Type |
| Jeep | | |
| 2006 - 2007 | | Commander |
| 2007 - 2010 | | Compass |
| 2005 - 2007 | | Grand Cherokee |
| 2005 - 2008 | | Liberty |
| 2007 - 2010 | | Patriot |
| 2007 - 2008 | | Wrangler |
| Land Rover | | |
| 2012 - 2013 | | Evoque |
| 2008 - 2013 | | LR2 |
| 2006 - 2009 | | LR3 |
| 2010 - 2013 | | LR4 |
| 2006 - 2013 | | Range Rover |
| Mazda | | |
| 2011 - 2013 | | 2 |
| 2004 - 2013 | | 3 |
| 2006 - 2013 | | 5 |
| 2008 - 2013 | | 6 |
| 2007 - 2011 | | CX-7 |
| 2007 - 2013 | | CX-9 |
| 2006 - 2012 | | MX-5 Miata |
| 2004 - 2011 | | RX-8 |
| 2011 | | Tribute |
| Mitsubishi | | |
| 2008 - 2014 | | Lancer |
| 2007 - 2014 | | Outlander |
| Plymouth | | |
| 2002 | | Prowler |
| Pontiac | | |
| 2008 | | G5 |
| 2008 | | G6 |
| 2007 | | Grand Prix |
| 2008 - 2009 | | Montana |
| 2008 - 2010 | | Solstice |
| 2007 - 2009 | | Torrent |

20030 (cont.)

| Part # | Year | Model |
|---------------|------|--------------|
| Saturn | | |
| 2007 | | Aura |
| 2007 - 2008 | | Outlook |
| 2008 - 2010 | | Sky |
| Suzuki | | |
| 2010 - 2012 | | Kizashi |
| 2007 - 2011 | | XL-7 |
| Lexus | | |
| 2006 | | GS300 |
| 2005 - 2006 | | GS430 |
| 2004 - 2006 | | GX470 |
| 2006 | | IS250 |
| 2006 | | IS350 |
| 2005 - 2006 | | LX470 |
| 2006 | | RX330 |
| Toyota | | |
| 2003 - 2006 | | 4 Runner |
| 2005 - 2006 | | Land Cruiser |
| 2004 - 2007 | | Sequoia |
| 2005 - 2006 | | Tacoma |
| 2005 - 2006 | | Tundra |
| Honda | | |
| 2008 - 2012 | | Accord |
| 2012 - 2014 | | Crosstour |
| 2007 - 2013 | | CR-V |
| 2008 | | Fit |
| 2009 - 2014 | | Pilot |
| 2008 - 2009 | | S2000 |
| Lexus | | |
| 2011 - 2013 | | CT200h |
| 2013 - 2014 | | ES300h |
| 2007 - 2014 | | ES350 |
| 2007 - 2011 | | GS350 |
| 2006 - 2007 | | GS430 |
| 2007 - 2013 | | GS450h |
| 2008 - 2013 | | GS460 |
| 2006 - 2009 | | GX470 |
| 2010 - 2012 | | HS250h |
| 2006 - 2012 | | IS C |
| 2008 - 2013 | | IS F |
| 2006 - 2013 | | IS250 |
| 2006 - 2013 | | IS300H |
| 2006 - 2014 | | IS350 |
| 2006 - 2013 | | IS F |
| 2011 - 2013 | | LFA |
| 2007 - 2013 | | LS460 |
| 2008 - 2013 | | LS600h |
| 2006 - 2007 | | LX470 |
| 2008 - 2014 | | LX570 |
| 2006 | | RX330 |
| 2007 - 2013 | | RX350 |
| 2006 - 2012 | | RX400h |
| 2010 - 2014 | | RX450h |
| 2013 | | RXF Sport |
| 2006 - 2010 | | SC430 |

20030 (cont.)

20031

20032

| Part # | Year | Model |
|----------------|------|-------------------|
| Nissan | | |
| 2010 - 2013 | | 370Z |
| Pontiac | | |
| 2008 - 2010 | | Vibe |
| Scion | | |
| 2013 | | FR-S |
| 2011 - 2013 | | iQ |
| 2006 - 2014 | | tC |
| 2007 - 2013 | | xB |
| 2008 - 2013 | | xD |
| Subaru | | |
| 2013 - 2014 | | BRZ |
| Toyota | | |
| 2006 - 2013 | | 4 Runner |
| 2006 - 2013 | | Avalon |
| 2007 - 2013 | | Camry |
| 2008 - 2011 | | Camry Hybrid |
| 2007 - 2013 | | Corolla |
| 2008 - 2013 | | FJ Cruiser |
| 2007 - 2013 | | Highlander |
| 2008 - 2011 | | Highlander Hybrid |
| 2006 - 2013 | | Land Cruiser |
| 2007 - 2013 | | Matrix |
| 2005 - 2013 | | Prius |
| 2012 | | Prius V |
| 2006 - 2013 | | RAV4 |
| 2012 | | RAV4 E |
| 2006 - 2011 | | Solara |
| 2006 - 2013 | | Tacoma |
| 2009 - 2013 | | Venza |
| 2007 - 2013 | | Yaris |
| Honda | | |
| 2005 | | Pilot |
| 2006 - 2008 | | Ridgeline |
| Acura | | |
| 2004 - 2006 | | MDX |
| 2005 - 2012 | | RL |
| 2005 - 2008 | | TL |
| Dodge | | |
| 2007 - 2008 | | Sprinter |
| Honda | | |
| 2007 - 2008 | | Element |
| 2005 - 2010 | | Odyssey |
| 2005 - 2008 | | Pilot |
| 2006 - 2014 | | Ridgeline |
| Hyundai | | |
| 2006 - 2013 | | Azera |
| 2007 - 2010 | | Elantra |
| 2007 - 2009 | | Entourage |
| 2007 - 2010 | | Santa Fe |
| 2007 - 2008 | | Sonata |
| 2007 - 2008 | | Tiburon |
| 2006 - 2009 | | Tucson |
| 2007 - 2012 | | Veracruz |

20032 (cont.)

20035

20036

■ NUMERICAL LISTING: Service Packs

SCHRADER 2014 TPMS APPLICATION GUIDE

| Part # | Year | Model |
|---------------|----------------------|-------------|
| 20036 (cont.) | Kia | |
| | 2007 - 2009 | Amanti |
| | 2008 - 2010 | Magentis |
| | 2006 - 2010 | Optima |
| | 2006 - 2011 | Rondo |
| | 2006 - 2013 | Sedona |
| | 2007 - 2009 | Sorento |
| | 2005 - 2008 | Sportage |
| | Mercedes-Benz | |
| | 2007 - 2009 | CL550 |
| | 2007 - 2009 | CL600 |
| | 2007 - 2009 | CL63 |
| | 2008 - 2009 | CL65 |
| | 2006 | CLS500 |
| | 2006 | CLS55 |
| | 2007 - 2011 | CLS550 |
| | 2007 - 2011 | CLS63 |
| | 2006 - 2009 | E320 |
| | 2006 - 2009 | E350 |
| | 2006 | E500 |
| | 2006 | E55 |
| | 2007 - 2009 | E550 |
| | 2007 - 2009 | E63 |
| | 2007 - 2009 | GL320 |
| | 2007 - 2009 | GL450 |
| | 2008 - 2009 | GL550 |
| | 2007 - 2009 | ML320 |
| | 2006 - 2009 | ML350 |
| | 2006 - 2007 | ML500 |
| | 2008 - 2009 | ML550 |
| | 2007 - 2009 | ML63 |
| | 2007 - 2009 | R320 |
| | 2006 - 2009 | R350 |
| | 2006 - 2007 | R500 |
| | 2007 | R63 |
| | 2010 | S400 |
| | 2007 - 2010 | S550 |
| | 2007 - 2010 | S600 |
| | 2007 - 2010 | S63 |
| | 2007 - 2010 | S65 |
| | 2006 | SL500 |
| | 2006 - 2008 | SL55 |
| | 2007 - 2009 | SL550 |
| | 2006 - 2009 | SL600 |
| | 2009 | SL63 |
| | 2006 - 2009 | SL65 |
| | 2008 - 2009 | SLR McLaren |
| 20037 | Audi | |
| | 2002 - 2008 | A4 |
| | 2005 - 2011 | A6 |
| | 2001 - 2010 | A8 |

| Part # | Year | Model |
|--------|---------------------|-----------------|
| 20037 | Audi (cont.) | |
| | 2001 - 2005 | Allroad Quattro |
| | 2007 - 2012 | Q7 |
| | 2008 - 2012 | R8 |
| | 2014 | R8 |
| | 2007 - 2008 | RS4 |
| | 2004 - 2009 | S4 |
| | 2007 - 2011 | S6 |
| | 2001 - 2003 | S8 |
| | 2007 - 2009 | S8 |
| | Bentley | |
| | 2007 - 2009 | Azure |
| | 2012 - 2014 | Azure |
| | 2003 - 2014 | Continental |
| | 2011 - 2014 | Mulsanne |
| | BMW | |
| | 2008 - 2012 | 128i |
| | 2008 - 2013 | 135i |
| | 2013 | 135iS |
| | 2001 - 2005 | 320i |
| | 2000 | 323Ci |
| | 2000 | 323i |
| | 2006 - 2010 | 323i |
| | 2001 - 2006 | 325Ci |
| | 2001 - 2006 | 325i |
| | 2001 - 2006 | 325Xi |
| | 2000 | 328Ci |
| | 2000 | 328i |
| | 2007 - 2014 | 328i |
| | 2007 - 2008 | 328Xi |
| | 2001 - 2006 | 330Ci |
| | 2001 - 2006 | 330i |
| | 2001 - 2006 | 330Xi |
| | 2009 - 2012 | 335D |
| | 2007 - 2014 | 335i |
| | 2012 - 2014 | 335iS |
| | 2007 - 2008 | 335Xi |
| | 2010 | 335Xi |
| | 2001 - 2007 | 525i |
| | 2006 - 2007 | 525Xi |
| | 1997 - 2000 | 528i |
| | 2008 - 2013 | 528i |
| | 2008 - 2009 | 528Xi |
| | 2001 - 2007 | 530i |
| | 2006 - 2007 | 530Xi |
| | 2008 - 2014 | 535i |
| | 2008 | 535Xi |
| | 2010 | 535Xi |
| | 1997 - 2005 | 540i |
| | 2006 - 2013 | 550i |

| Part # | Year | Model |
|--------|--------------------|----------------|
| 20037 | BMW (cont.) | |
| | 2012 - 2014 | 640i |
| | 2004 - 2005 | 645Ci |
| | 2006 - 2014 | 650i |
| | 1997 - 2001 | 740i |
| | 2011 - 2013 | 740i |
| | 1997 - 2001 | 740iL |
| | 2011 - 2013 | 740Li |
| | 2002 - 2005 | 745i |
| | 2002 - 2005 | 745Li |
| | 2006 - 2013 | 750i |
| | 1997 - 2001 | 750iL |
| | 2006 - 2013 | 750Li |
| | 2004 - 2006 | 760i |
| | 2003 - 2008 | 760Li |
| | 2010 - 2011 | 760Li |
| | 2007 - 2008 | Alpina B7 |
| | 2011 | Alpina B7 |
| | 2012 | M1 |
| | 2001 - 2006 | M3 |
| | 2008 - 2013 | M3 |
| | 2000 - 2003 | M5 |
| | 2006 - 2013 | M5 |
| | 2006 - 2010 | M6 |
| | 2013 - 2014 | M6 |
| | 2014 | M6 Gran Coupe |
| | 2012 - 2014 | X1 |
| | 2006 - 2014 | X3 |
| | 2000 - 2014 | X5 |
| | 2008 - 2014 | X6 |
| | 2000 - 2002 | Z3 |
| | 2003 - 2014 | Z4 |
| | 2000 - 2003 | Z8 |
| | Bugatti | |
| | 2006 | Veyron |
| | Ferrari | |
| | 2001 - 2002 | 550 Maranello |
| | 2002 - 2005 | 575M Maranello |
| | 2004 - 2009 | 612 Scaglietti |
| | 2003 - 2004 | Enzo |
| | 2005 - 2009 | F430 |
| | Land Rover | |
| | 2005 | LR3 |
| | 2002 - 2005 | Range Rover |
| | Maserati | |
| | 2004 - 2006 | Coupe |
| | 2004 - 2006 | Gransport |
| | 2006 | MC12 |
| | 2004 - 2006 | Quattroporte |
| | 2004 - 2006 | Spyder |

SCHRADER 2014 TPMS APPLICATION GUIDE

NUMERICAL LISTING: Service Packs

| Part # | Year | Model |
|---------------|----------------------|-----------------|
| 20037 (cont.) | Mercedes-Benz | |
| | 2000 - 2006 | CL500 |
| | 2001 - 2006 | CL55 |
| | 2001 - 2006 | CL600 |
| | 2005 - 2006 | CL65 |
| | 2001 - 2005 | E320 |
| | 2001 - 2002 | E430 |
| | 2003 - 2005 | E500 |
| | 1999 - 2005 | E55 |
| | 2008 | R550 |
| | 2006 | S350 |
| | 2000 - 2006 | S430 |
| | 2000 - 2006 | S500 |
| | 2001 - 2006 | S55 |
| | 2001 - 2005 | S600 |
| | 2006 | S600 |
| | 2006 | S65 |
| | 2001 - 2005 | SL500 |
| | 2003 - 2005 | SL55 |
| | 2001 - 2002 | SL600 |
| | 2004 - 2005 | SL600 |
| | 2005 | SL65 |
| | 2004 - 2007 | SLR McLaren |
| | Mini | |
| | 2008 - 2013 | Cooper |
| | Porsche | |
| | 2005 - 2011 | 911 |
| | 2005 - 2011 | Boxster |
| | 2004 - 2006 | Carrera GT |
| | 2003 - 2006 | Cayenne |
| | 2008 - 2014 | Cayenne |
| | 2006 - 2011 | Cayman |
| | 2010 - 2011 | Panamera |
| | Rolls-Royce | |
| | 2007 - 2010 | Phantom |
| | Volkswagen | |
| | 2004 - 2006 | Phaeton |
| | 2004 - 2007 | Touareg |
| | 2011 - 2013 | Touareg |
| | 2008 - 2012 | Touareg 2 |
| | Audi | |
| | 2002 - 2008 | A4 |
| | 2005 - 2011 | A6 |
| | 2001 - 2010 | A8 |
| | 2001 - 2005 | Allroad Quattro |
| | 2007 - 2012 | Q7 |
| | 2008 - 2012 | R8 |
| | 2014 | R8 |
| 2007 - 2008 | RS4 | |
| 2004 - 2009 | S4 | |
| 2007 - 2011 | S6 | |
| 2001 - 2003 | S8 | |
| 2007 - 2009 | S8 | |

| Part # | Year | Model |
|---------------|----------------|-------------|
| 20038 (cont.) | Bentley | |
| | 2007 - 2009 | Azure |
| | 2012 - 2014 | Azure |
| | 2003 - 2014 | Continental |
| | 2011 - 2014 | Mulsanne |
| | BMW | |
| | 2008 - 2012 | 128i |
| | 2008 - 2013 | 135i |
| | 2013 | 135iS |
| | 2001 - 2005 | 320i |
| | 2000 | 323Ci |
| | 2000 | 323i |
| | 2006 - 2010 | 323i |
| | 2001 - 2006 | 325Ci |
| | 2001 - 2006 | 325i |
| | 2001 - 2006 | 325Xi |
| | 2000 | 328Ci |
| | 2000 | 328i |
| | 2007 - 2014 | 328i |
| | 2007 - 2008 | 328Xi |
| | 2001 - 2006 | 330Ci |
| | 2001 - 2006 | 330i |
| | 2001 - 2006 | 330Xi |
| | 2009 - 2012 | 335D |
| | 2007 - 2014 | 335i |
| | 2012 - 2014 | 335iS |
| | 2007 - 2008 | 335Xi |
| | 2010 | 335Xi |
| | 2001 - 2007 | 525i |
| | 2006 - 2007 | 525Xi |
| | 1997 - 2000 | 528i |
| | 2008 - 2013 | 528i |
| | 2008 - 2009 | 528Xi |
| | 2001 - 2007 | 530i |
| | 2006 - 2007 | 530Xi |
| | 2008 - 2014 | 535i |
| | 2008 | 535Xi |
| | 2010 | 535Xi |
| | 1997 - 2005 | 540i |
| | 2006 - 2013 | 550i |
| | 2012 - 2014 | 640i |
| | 2004 - 2005 | 645Ci |
| | 2006 - 2014 | 650i |
| | 1997 - 2001 | 740i |
| | 2011 - 2013 | 740i |
| | 1997 - 2001 | 740iL |
| | 2011 - 2013 | 740Li |
| | 2002 - 2005 | 745i |
| 2002 - 2005 | 745Li | |
| 2006 - 2013 | 750i | |
| 1997 - 2001 | 750iL | |

| Part # | Year | Model |
|---------------|----------------------|----------------|
| 20038 (cont.) | BMW | |
| | 2006 - 2013 | 750Li |
| | 2004 - 2006 | 760i |
| | 2003 - 2008 | 760Li |
| | 2010 - 2011 | 760Li |
| | 2007 - 2008 | Alpina B7 |
| | 2011 | Alpina B7 |
| | 2012 | M1 |
| | 2001 - 2006 | M3 |
| | 2008 - 2013 | M3 |
| | 2000 - 2003 | M5 |
| | 2006 - 2013 | M5 |
| | 2006 - 2010 | M6 |
| | 2013 - 2014 | M6 |
| | 2014 | M6 Gran Coupe |
| | 2012 - 2014 | X1 |
| | 2006 - 2014 | X3 |
| | 2000 - 2014 | X5 |
| | 2008 - 2014 | X6 |
| | 2000 - 2002 | Z3 |
| | 2003 - 2014 | Z4 |
| | 2000 - 2003 | Z8 |
| | Bugatti | |
| | 2006 | Veyron |
| | Ferrari | |
| | 2001 - 2002 | 550 Maranello |
| | 2002 - 2005 | 575M Maranello |
| | 2004 - 2009 | 612 Scaglietti |
| | 2003 - 2004 | Enzo |
| | 2005 - 2009 | F430 |
| | Land Rover | |
| | 2005 | LR3 |
| | 2002 - 2005 | Range Rover |
| | Maserati | |
| | 2004 - 2006 | Coupe |
| | 2004 - 2006 | Gransport |
| | 2006 | MC12 |
| | 2004 - 2006 | Quattroporte |
| | 2004 - 2006 | Spyder |
| | Mercedes-Benz | |
| | 2000 - 2006 | CL500 |
| | 2001 - 2006 | CL55 |
| | 2001 - 2006 | CL600 |
| | 2005 - 2006 | CL65 |
| | 2001 - 2005 | E320 |
| | 2001 - 2002 | E430 |
| | 2003 - 2005 | E500 |
| | 1999 - 2005 | E55 |
| 2008 | R550 | |
| 2006 | S350 | |
| 2000 - 2006 | S430 | |
| 2000 - 2006 | S500 | |
| 2001 - 2006 | S55 | |

NUMERICAL LISTING: Service Packs

SCHRADER 2014 TPMS APPLICATION GUIDE

| Part # | Year | Model |
|--------------------|------------------------------|-----------------|
| 20038 (cont.) | Mercedes-Benz (cont.) | |
| | 2001 - 2005 | S600 |
| | 2006 | S600 |
| | 2006 | S65 |
| | 2001 - 2005 | SL500 |
| | 2003 - 2005 | SL55 |
| | 2001 - 2002 | SL600 |
| | 2004 - 2005 | SL600 |
| | 2005 | SL65 |
| | 2004 - 2007 | SLR McLaren |
| | Mini | |
| | 2008 - 2013 | Cooper |
| | Porsche | |
| | 2005 - 2011 | 911 |
| | 2005 - 2011 | Boxster |
| | 2004 - 2006 | Carrera GT |
| | 2003 - 2006 | Cayenne |
| | 2008 - 2014 | Cayenne |
| | 2006 - 2011 | Cayman |
| 2010 - 2011 | Panamera | |
| Rolls-Royce | | |
| 2007 - 2010 | Phantom | |
| Volkswagen | | |
| 2004 - 2006 | Phaeton | |
| 2004 - 2007 | Touareg | |
| 2011 - 2013 | Touareg | |
| 2008 - 2012 | Touareg 2 | |
| 20039 | Audi | |
| | 2002 - 2008 | A4 |
| | 2005 - 2011 | A6 |
| | 2001 - 2010 | A8 |
| | 2001 - 2005 | Allroad Quattro |
| | 2007 - 2012 | Q7 |
| | 2008 - 2012 | R8 |
| | 2014 | R8 |
| | 2007 - 2008 | RS4 |
| | 2004 - 2009 | S4 |
| | 2007 - 2011 | S6 |
| | 2001 - 2003 | S8 |
| | 2007 - 2009 | S8 |
| | Bentley | |
| | 2007 - 2009 | Azure |
| | 2012 - 2014 | Azure |
| | 2003 - 2014 | Continental |
| | 2011 - 2014 | Mulsanne |
| | BMW | |
| | 2008 - 2012 | 128i |
| | 2008 - 2013 | 135i |
| | 2013 | 135iS |
| | 2001 - 2005 | 320i |
| | 2000 | 323Ci |
| | 2000 | 323i |
| | 2006 - 2010 | 323i |

| Part # | Year | Model |
|---------------|--------------------|-----------|
| 20039 (cont.) | BMW (cont.) | |
| | 2001 - 2006 | 325Ci |
| | 2001 - 2006 | 325i |
| | 2001 - 2006 | 325Xi |
| | 2000 | 328Ci |
| | 2000 | 328i |
| | 2007 - 2014 | 328i |
| | 2007 - 2008 | 328Xi |
| | 2001 - 2006 | 330Ci |
| | 2001 - 2006 | 330i |
| | 2001 - 2006 | 330Xi |
| | 2009-2012 | 335D |
| | 2007 - 2014 | 335i |
| | 2012 - 2014 | 335iS |
| | 2007 - 2008 | 335Xi |
| | 2010 | 335Xi |
| | 2001 - 2007 | 525i |
| | 2006 - 2007 | 525Xi |
| | 1997 - 2000 | 528i |
| | 2008 - 2013 | 528i |
| | 2008 - 2009 | 528Xi |
| | 2001 - 2007 | 530i |
| | 2006 - 2007 | 530Xi |
| | 2008 - 2014 | 535i |
| | 2008 | 535Xi |
| | 2010 | 535Xi |
| | 1997 - 2005 | 540i |
| | 2006 - 2013 | 550i |
| | 2012 - 2014 | 640i |
| | 2004 - 2005 | 645Ci |
| | 2006 - 2014 | 650i |
| | 1997 - 2001 | 740i |
| | 2011 - 2013 | 740i |
| | 1997 - 2001 | 740iL |
| | 2011 - 2013 | 740Li |
| | 2002 - 2005 | 745i |
| | 2002 - 2005 | 745Li |
| | 2006 - 2013 | 750i |
| | 1997 - 2001 | 750iL |
| | 2006 - 2013 | 750Li |
| | 2004 - 2006 | 760i |
| | 2003 - 2008 | 760Li |
| | 2010 - 2011 | 760Li |
| | 2007 - 2008 | Alpina B7 |
| | 2011 | Alpina B7 |
| | 2012 | M1 |
| | 2001 - 2006 | M3 |
| | 2008 - 2013 | M3 |
| | 2000 - 2003 | M5 |
| | 2006 - 2013 | M5 |
| | 2006 - 2010 | M6 |
| | 2013 - 2014 | M6 |
| 2014 | M6 Gran Coupe | |
| 2012 - 2014 | X1 | |

| Part # | Year | Model |
|----------------|----------------------|----------------|
| 20039 (cont.) | BMW (cont.) | |
| | 2006 - 2014 | X3 |
| | 2000 - 2014 | X5 |
| | 2008 - 2014 | X6 |
| | 2000 - 2002 | Z3 |
| | 2003 - 2014 | Z4 |
| | 2000 - 2003 | Z8 |
| | Bugatti | |
| | 2006 | Veyron |
| | Ferrari | |
| | 2001 - 2002 | 550 Maranello |
| | 2002 - 2005 | 575M Maranello |
| | 2004 - 2009 | 612 Scaglietti |
| | 2003 - 2004 | Enzo |
| | 2005 - 2009 | F430 |
| | Land Rover | |
| | 2005 | LR3 |
| | 2002 - 2005 | Range Rover |
| | Maserati | |
| | 2004 - 2006 | Coupe |
| | 2004 - 2006 | Gransport |
| | 2006 | MC12 |
| | 2004 - 2006 | Quattroporte |
| | 2004 - 2006 | Spyder |
| | Mercedes-Benz | |
| | 2000 - 2006 | CL500 |
| | 2001 - 2006 | CL55 |
| | 2001 - 2006 | CL600 |
| | 2005 - 2006 | CL65 |
| | 2001 - 2005 | E320 |
| | 2001 - 2002 | E430 |
| | 2003 - 2005 | E500 |
| | 1999 - 2005 | E55 |
| 2008 | R550 | |
| 2006 | S350 | |
| 2000 - 2006 | S430 | |
| 2000 - 2006 | S500 | |
| 2001 - 2006 | S55 | |
| 2001 - 2005 | S600 | |
| 2006 | S600 | |
| 2006 | S65 | |
| 2001 - 2005 | SL500 | |
| 2003 - 2005 | SL55 | |
| 2001 - 2002 | SL600 | |
| 2004 - 2005 | SL600 | |
| 2005 | SL65 | |
| 2004 - 2007 | SLR McLaren | |
| Mini | | |
| 2008 - 2013 | Cooper | |
| Porsche | | |
| 2005 - 2011 | 911 | |
| 2005 - 2011 | Boxster | |
| 2004 - 2006 | Carrera GT | |
| 2003 - 2006 | Cayenne | |

SCHRADER 2014 TPMS APPLICATION GUIDE

NUMERICAL LISTING: Service Packs

| Part # | Year | Model |
|---------------|------------------------|-----------------|
| 20039 (cont.) | Porsche (cont.) | |
| | 2008 - 2014 | Cayenne |
| | 2006 - 2011 | Cayman |
| | 2010 - 2011 | Panamera |
| | Rolls-Royce | |
| | 2007 - 2010 | Phantom |
| | Volkswagen | |
| | 2004 - 2006 | Phaeton |
| | 2004 - 2007 | Touareg |
| | 2011 - 2013 | Touareg |
| 2008 - 2012 | Touareg 2 | |
| 20040 | Audi | |
| | 2002 - 2008 | A4 |
| | 2005 - 2011 | A6 |
| | 2001 - 2010 | A8 |
| | 2001 - 2005 | Allroad Quattro |
| | 2007 - 2012 | Q7 |
| | 2008 - 2012 | R8 |
| | 2014 | R8 |
| | 2007 - 2008 | RS4 |
| | 2004 - 2009 | S4 |
| | 2007 - 2011 | S6 |
| | 2001 - 2003 | S8 |
| | 2007 - 2009 | S8 |
| | Bentley | |
| | 2007 - 2009 | Azure |
| | 2012 - 2014 | Azure |
| | 2003 - 2014 | Continental |
| | 2011 - 2014 | Mulsanne |
| | BMW | |
| | 2008 - 2012 | 128I |
| | 2008 - 2013 | 135I |
| | 2013 | 135IS |
| | 2001 - 2005 | 320I |
| | 2000 | 323CI |
| | 2000 | 323I |
| 2006 - 2010 | 323I | |
| 2001 - 2006 | 325CI | |
| 2001 - 2006 | 325I | |
| 2001 - 2006 | 325XI | |
| 2000 | 328CI | |
| 2000 | 328I | |
| 2007 - 2014 | 328I | |
| 2007 - 2008 | 328XI | |
| 2001 - 2006 | 330CI | |
| 2001 - 2006 | 330I | |
| 2001 - 2006 | 330XI | |
| 2009 - 2012 | 335D | |
| 2007 - 2014 | 335I | |
| 2012 - 2014 | 335IS | |
| 2007 - 2008 | 335XI | |
| 2010 | 335XI | |
| 2001 - 2007 | 525I | |
| 2006 - 2007 | 525XI | |

| Part # | Year | Model |
|-------------------|--------------------|-----------|
| 20040 (cont.) | BMW (cont.) | |
| | 1997 - 2000 | 528I |
| | 2008 - 2013 | 528I |
| | 2008 - 2009 | 528XI |
| | 2001 - 2007 | 530I |
| | 2006 - 2007 | 530XI |
| | 2008 - 2014 | 535I |
| | 2008 | 535XI |
| | 2010 | 535XI |
| | 1997 - 2005 | 540I |
| | 2006 - 2013 | 550I |
| | 2012 - 2014 | 640I |
| | 2004 - 2005 | 645CI |
| | 2006 - 2014 | 650I |
| | 1997 - 2001 | 740I |
| | 2011 - 2013 | 740I |
| | 1997 - 2001 | 740IL |
| | 2011 - 2013 | 740LI |
| | 2002 - 2005 | 745I |
| | 2002 - 2005 | 745LI |
| | 2006 - 2013 | 750I |
| | 1997 - 2001 | 750IL |
| | 2006 - 2013 | 750LI |
| | 2004 - 2006 | 760I |
| | 2003 - 2008 | 760LI |
| | 2010 - 2011 | 760LI |
| | 2007 - 2008 | Alpina B7 |
| | 2011 | Alpina B7 |
| | 2012 | M1 |
| | 2001 - 2006 | M3 |
| | 2008 - 2013 | M3 |
| | 2000 - 2003 | M5 |
| | 2006 - 2013 | M5 |
| | 2006 - 2010 | M6 |
| | 2013 - 2014 | M6 |
| 2014 | M6 Gran Coupe | |
| 2012 - 2014 | X1 | |
| 2006 - 2014 | X3 | |
| 2000 - 2014 | X5 | |
| 2008 - 2014 | X6 | |
| 2000 - 2002 | Z3 | |
| 2003 - 2014 | Z4 | |
| 2000 - 2003 | Z8 | |
| Bugatti | | |
| 2006 | Veyron | |
| Ferrari | | |
| 2001 - 2002 | 550 Maranello | |
| 2002 - 2005 | 575M Maranello | |
| 2004 - 2009 | 612 Scaglietti | |
| 2003 - 2004 | Enzo | |
| 2005 - 2009 | F430 | |
| Land Rover | | |
| 2005 | LR3 | |
| 2002 - 2005 | Range Rover | |

| Part # | Year | Model |
|--------------------|----------------------|--------------|
| 20040 | Maserati | |
| | 2004 - 2006 | Coupe |
| | 2004 - 2006 | Gransport |
| | 2006 | MC12 |
| | 2004 - 2006 | Quattroporte |
| | 2004 - 2006 | Spyder |
| | Mercedes-Benz | |
| | 2000 - 2006 | CL500 |
| | 2001 - 2006 | CL55 |
| | 2001 - 2006 | CL600 |
| | 2005 - 2006 | CL65 |
| | 2001 - 2005 | E320 |
| | 2001 - 2002 | E430 |
| | 2003 - 2005 | E500 |
| | 1999 - 2005 | E55 |
| | 2008 | R550 |
| | 2006 | S350 |
| | 2000 - 2006 | S430 |
| | 2000 - 2006 | S500 |
| | 2001 - 2006 | S55 |
| | 2001 - 2005 | S600 |
| | 2006 | S600 |
| | 2006 | S65 |
| | 2001 - 2005 | SL500 |
| | 2003 - 2005 | SL55 |
| | 2001 - 2002 | SL600 |
| | 2004 - 2005 | SL600 |
| | 2005 | SL65 |
| | 2004 - 2007 | SLR McLaren |
| | Mini | |
| | 2008 - 2013 | Cooper |
| | Porsche | |
| | 2005 - 2011 | 911 |
| | 2005 - 2011 | Boxster |
| | 2004 - 2006 | Carrera GT |
| 2003 - 2006 | Cayenne | |
| 2008 - 2014 | Cayenne | |
| 2006 - 2011 | Cayman | |
| 2010 - 2011 | Panamera | |
| Rolls-Royce | Rolls-Royce | |
| 2007 - 2010 | Phantom | |
| Volkswagen | | |
| 2004 - 2006 | Phaeton | |
| 2004 - 2007 | Touareg | |
| 2011 - 2013 | Touareg | |
| 2008 - 2012 | Touareg 2 | |
| Dodge | | |
| 2012 - 2014 | Dart | |
| 2014 | Ram Series Pickup | |
| Jeep | | |
| 2014 | Cherokee | |

DILL 2014 TPMS APPLICATION GUIDE

DILL 2014 TPMS APPLICATION GUIDE

| Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. | |
|-------|--|---------------|------------------|---------------|-------------|--------------------|----------------------|-------------------|---------------------------------|------------------|
| Acura | CSX | 08-11 | 35 | 7002 | 7020K | 1212 | 2045K | Lt Blue | 42753-SNA-A83 | NO |
| | ILX | 13-14 | 71 | 7002 | 7020K | 5513 | 7000K | ◆ | 42753-TX6-A81 | VS70 |
| | MDX | 04-06 | 40 | — | — | 1057 | 2000K | Yellow | 06421-S3V-A04 | 1096 |
| | | 07-13 | 35 | — | — | 1209 | 1100K | Purple | 42753-STK-A04 | NO |
| | | 14 | 71 | — | — | 5512 | 7000K | ◆ | 42753-TX4-A51 | VS70 |
| | RDX | 07-12 | 35 | — | — | 1209 | 1100K | Purple | 42753-STK-A04 | NO |
| | | 13-14 | 71 | — | — | 5512 | 7000K | ◆ | 42753-TX4-A51 | VS70 |
| | RL | 05-08 | 40 | — | — | 1057 | 2000K | Yellow | 06421-S3V-A04 | 1096 |
| | | 09-12 | 35 or 40 | — | — | 1057 | 2045K or 2000K | Lt Blue Yellow | 42753-SHJ-A53 | NO OR 1096 |
| | RLX | 13-14 | 35 | — | — | 1214 | 2045K | Lt Blue | 42753-TY2-A51 | NO |
| | TL | 05-08 | 40 | — | — | 1057 | 2000K | Yellow | 06421-S3V-A04 | 1096 |
| | TL (Hi-Line) | 09-14 | 35 | — | — | 1214 | 2045K | Lt Blue | 42753-TK4-A01/ 42753-TY2-A51 | NO |
| | TSX | 07-14 | 35 | — | — | 1209 | 1100K | Purple | 42753-TL2-A52 | NO |
| | ZDX (Hi-Line) | 10-13 | 35 | — | — | 1214 | 2045K | Lt Blue | 42753-TK4-A01/ 42753-TY2-A51 | NO |
| Audi | Allroad (315 Mhz) | 01-05 | 35 | — | — | 9004 | 1090K | Gray | 4D0 907 275A | 1092 |
| | A6 Allroad (433 Mhz) | 01-06 | 35 | — | — | 9001 | 1090K | Gray | 4D0 907 275C | 1092 |
| | | 07-09 | 35 | — | — | 9007 or 9011 | 1090K | Gray | 4F0 907 275B | 1092 |
| | A6 Allroad (433 Mhz) Post-June 2009 | 10 | 40 | — | — | 9011 | 1096 | Gray | 4F0 907 275D | 1096 |
| | A3 (315 Mhz) | 06-11 | 71 | 7003 | 7020K | 1053 | 1030K | Orange | 1K0907253D | NO |
| | A4 (315 Mhz) | 09-11 | 71 | 7003 | 7020K | 1053 | 1030K | Orange | 1K0907253D | NO |
| | A4 (433 Mhz) | 05-08 | 35 | — | — | 9007 or 9011 | 1090K | Gray | 4F0 907 275B | 1092 |
| | A5 (315 Mhz) | 08-11 | 71 | 7003 | 7020K | 1053 | 1030K | Orange | 1K0907253D | NO |
| | A6 (315 Mhz) | 02-04 | 35 | — | — | 9004 | 1090K | Gray | 4D0 907 275A | 1092 |
| | A6 (433 Mhz) | 05-09 | 35 | — | — | 9007 or 9011 | 1090K | Gray | 4F0 907 275B | 1092 |
| | A6 (433 Mhz) Post-June 2009 | 10-12 | 40 | — | — | 9011 | 1096 | Gray | 4F0 907 275D | 1096 |
| | A8 (315 Mhz) | 00-07 | 35 | — | — | 9004 | 1090K | Gray | 4D0 907 275A | 1092 |
| | A8 (433 Mhz) | 00-12 | 35 | — | — | 9001 | 1090K | Gray | 4D0 907 275C | 1092 |
| | Q5 (315 Mhz) | 09 | 71 | 7003 | 7020K | 1053 | 1030K | Orange | 1K0907253D | NO |

1091-1099-1099L are valve options on some special wheel packages. ◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION GUIDE

| | Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. |
|--|--|------------|---------------|------------------|---------------|--------------|----------|-----------------|------------------|------------------|
| Audi (cont.) | Q7 (433 Mhz) | 06-09 | 35 | — | — | 9007 or 9011 | 1090K | Gray | 4F0 907 275B | 1092 |
| | Q7 (433 Mhz) <i>Post-June 2009</i> | 10-12 | 40 | — | — | 9011 | 1096 | Gray | 4F0 907 275D | 1096 |
| | R8 (433 Mhz) | 08-09 | 35 | — | — | 9007 or 9011 | 1090K | Gray | 4F0 907 275B | 1092 |
| | R8 (433 Mhz) <i>Post-June 2009</i> | 10-12 | 40 | — | — | 9011 | 1096 | Gray | 4F0 907 275D | 1096 |
| | RS4 (433 Mhz) | 07-08 | 35 | — | — | 9007 or 9011 | 1090K | Gray | 4F0 907 275B | 1092 |
| | RS6 (315 Mhz) | 01-05 | 35 | — | — | 9004 | 1090K | Gray | 4D0 907 275A | 1092 |
| | RS6 (433 Mhz) | 01-04 | 35 | — | — | 9001 | 1090K | Gray | 4D0 907 275C | 1092 |
| | S4 (315 Mhz) | 10-11 | 71 | 7003 | 7020K | 1053 | 1030K | Orange | 1K0907253D | NO |
| | S4 (433 Mhz) | 05-07 | 35 | — | — | 9007 or 9011 | 1090K | Gray | 4F0 907 275B | 1092 |
| | S5 (315 Mhz) | 08-11 | 71 | 7003 | 7020K | 1053 | 1030K | Orange | 1K0907253D | NO |
| | S6 (433 Mhz) | 05-09 | 35 | — | — | 9007 or 9011 | 1090K | Gray | 4F0 907 275B | 1092 |
| | S6 (433 Mhz) <i>Post-June 2009</i> | 10-12 | 40 | — | — | 9011 | 1096 | Gray | 4F0 907 275D | 1096 |
| | S8 (315 Mhz) | 00-08 | 35 | — | — | 9004 | 1090K | Gray | 4D0 907 275A | 1092 |
| | S8 (433 Mhz) | 00-09 | 35 | — | — | 9001 | 1090K | Gray | 4D0 907 275C | 1092 |
| | TT (315 Mhz) | 08-11 | 71 | 7003 | 7020K | 1053 | 1030K | Orange | 1K0907253D | NO |
| Bentley | Continental GT | 03-05 | 35 | — | — | 9001 | 1090K | Gray | 4D0 907 275C | 1092-1095 |
| | Continental GT <i>Post-May 2005</i> | 05-10 | 35 | — | — | 9007 or 9011 | 1090K | Gray | 4F0 907 275B | 1092-1095 |
| | Continental GT | 11-14 | 40 | — | — | 9011 | 1096 | — | 4F0 907 275B | 1096 |
| | Azure | 07-10 | 35 | — | — | 9007 or 9011 | 1090K | Gray | 4F0 907 275B | 1092-1095 |
| | | 11-14 | 40 | — | — | 9011 | 1096 | — | 4F0 907 275B | 1096 |
| | Mulsanne | 11-14 | 40 | — | — | 9011 | 1096 | — | 4F0 907 275B | 1096 |
| | Flying Spur | 06-10 | 35 | — | — | 9007 or 9011 | 1090K | Gray | 4F0 907 275B | 1092-1095 |
| | Flying Spur | 11-14 | 40 | — | — | 9011 | 1096 | — | 4F0 907 275B | 1096 |
| BMW | 1 Series (433 Mhz) | 07-10 | 35 | — | — | 1027 | 1090K | Gray | 36 23 6 781 847 | 1092-1095 |
| | 1 Series (433 Mhz) <i>Post-September 2010</i> | 11-13 | 40 | — | — | 9012 | 1096 | Yellow | 36 10 6 856 227 | 1096 |
| | 3 Series (315 Mhz) | 00-04 | 35 | — | — | 9004 | 1090K | Gray | 36 11 8 378 681 | 1092-1095 |
| | 3 Series (433 Mhz) | 00-04 | 35 | — | — | 9002 | 1090K | Gray | 36 11 8 378 682 | 1092-1095 |
| | | 07-10 | 35 | — | — | 1027 | 1090K | Gray | 36 23 6 781 847 | 1092-1095 |
| 3 Series (433 Mhz) <i>Post-September 2009</i> | 10-12 | 40 | — | — | 9012 | 1096 | Yellow | 36 10 6 856 227 | 1096 | |

1091-1099-1099L are valve options on some special wheel packages.

DILL 2014 TPMS APPLICATION GUIDE

| Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. |
|--|------------|---------------|------------------|---------------|-------------|----------|-----------|------------------|------------------|
| 3 Series (433 Mhz) <i>Post-October 2011</i> | 12-14 | 40 | — | — | 9017 | 1096 | Yellow | 36 10 6 798 872 | 1096 |
| 4 Series (433 Mhz) | 14 | 40 | — | — | 9017 | 1096 | Yellow | 36 10 6 798 872 | 1096 |
| 5 Series (315 Mhz) | 00-02 | 35 | — | — | 9004 | 1090K | Gray | 36 11 8 378 681 | 1092-1095 |
| 5 Series (433 Mhz) | 02-05 | 35 | — | — | 9002 | 1090K | Gray | 36 11 8 378 682 | 1092-1095 |
| | 06-10 | 35 | — | — | 1027 | 1090K | Gray | 36 23 6 781 847 | 1092-1095 |
| 5 Series (433 Mhz) <i>Post-September 2010</i> | 11-14 | 40 | — | — | 9012 | 1096 | Yellow | 36 10 6 856 227 | 1096 |
| 6 Series (433 Mhz) | 06-10 | 35 | — | — | 1027 | 1090K | Gray | 36 23 6 781 847 | 1092-1095 |
| 6 Series (433 Mhz) <i>Post-March 2011</i> | 12-14 | 40 | — | — | 9012 | 1096 | Yellow | 36 10 6 856 227 | 1096 |
| 7 Series (315 Mhz) | 00-01 | 35 | — | — | 9004 | 1090K | Gray | 36 11 8 378 681 | 1092-1095 |
| 7 Series (433 Mhz) | 02-05 | 35 | — | — | 9002 | 1090K | Gray | 36 11 8 378 682 | 1092-1095 |
| | 06-10 | 35 | — | — | 1027 | 1090K | Gray | 36 23 6 781 847 | 1092-1095 |
| 7 Series (433 Mhz) <i>Post-September 2010</i> | 11-14 | 40 | — | — | 9012 | 1096 | Yellow | 36 10 6 856 227 | 1096 |
| M Series (433 Mhz) | 06-10 | 35 | — | — | 1027 | 1090K | Gray | 36 23 6 781 847 | 1092-1095 |
| | 11-14 | 40 | — | — | 9012 | 1096 | Yellow | 36 10 6 856 227 | 1096 |
| X1 (433 Mhz) | 12-14 | 40 | — | — | 9012 | 1096 | Yellow | 36 10 6 856 227 | 1096 |
| X3 (433 Mhz) | 06-10 | 35 | — | — | 1027 | 1090K | Gray | 36 23 6 781 847 | 1092-1095 |
| X3 (433 Mhz) <i>Post-November 2010</i> | 11-14 | 40 | — | — | 9012 | 1096 | Yellow | 36 10 6 856 227 | 1096 |
| X5 (433 Mhz) | 01-04 | 35 | — | — | 9003 | 1090K | Gray | 36 14 6 752 128 | 1092-1095 |
| | 07-10 | 35 | — | — | 1027 | 1090K | Gray | 36 23 6 781 847 | 1092-1095 |
| X5 (433 Mhz) <i>Post-October 2010</i> | 11-14 | 40 | — | — | 9012 | 1096 | Yellow | 36 10 6 856 227 | 1096 |
| X6 (433 Mhz) | 08-11 | 35 | — | — | 1027 | 1090K | Gray | 36 23 6 781 847 | 1092-1095 |
| X6 (433 Mhz) <i>Post-October 2010</i> | 11-14 | 40 | — | — | 9012 | 1096 | Yellow | 36 10 6 856 227 | 1096 |
| Z Series (433 Mhz) | 06-10 | 35 | — | — | 1027 | 1090K | Gray | 36 23 6 781 847 | 1092-1095 |
| | 11-14 | 40 | — | — | 9012 | 1096 | Yellow | 36 10 6 856 227 | 1096 |
| Alpina (433 Mhz) | 07-08 | 35 | — | — | 9002 | 1090K | Gray | 36 11 8 378 682 | 1092-1095 |
| Veyron | 05-06 | NA | | | NA | 1090K | Gray | NA | 1092-1095 |
| Allure | 07-08 | 71 | 7001/HP | 7020K | NA | 1050K | White | 15921013 | NO |
| | 09 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 12768826 | VS950 |
| Enclave | 08 | 71 | 7001/HP | 7020K | NA | 1050K | White | 15921013 | NO |
| | 09-14 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 22853741 | VS950 |
| Encore | 13-14 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 22854866 | VS950 |
| | 07-08 | 71 | 7001/HP | 7020K | NA | 1050K | White | 15921013 | NO |
| LaCrosse | 09-14 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 22854866 | VS950 |
| | 07 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 25799331 | VS950 |
| Lucerne | 07-11 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 25920615 | VS950 |

1091-1099-1099L are valve options on some special wheel packages. The 1050K is to be used on the Siemens sensors and the 1070K is to be used on the Schrader sensors.

DILL 2014 TPMS APPLICATION
GUIDE

| | Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. |
|--------------------------|------------------|------------|-----------------|------------------|---------------|-------------|----------|------------------------|------------------|------------------|
| Burck (cont.) | Rainier | 06-07 | 62 | 7001/HP | 7020K | 9116 | 1070K | Blue | 25774006 | NO |
| | | 07 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 25799331 | VS950 |
| | Regal | 11-14 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 22854866 | VS950 |
| | Verano | 12-14 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 22854866 | VS950 |
| Cadillac | ATS | 13 | — | 7001-R/ HP-R | VS80 | NEW | VS90 | — | 22959744 | VS90 |
| | | 14 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 13581558 | VS950 |
| | ATS Sport | 13 | 71 | 7001/HP | 7020K | NEW | 7020K | ◆ | 22959748 | VS70 |
| | | 14 | 62 | 7001/HP | 7020K | 9158 | 1070K | — | 20964159 | NO |
| | CTS | 04-07 | 62 | 7001/HP | 7020K | 9116 | 1070K | Blue | 25774006 | NO |
| | | 08-14 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 13581558 | VS950 |
| | CTS-V | 09-10 | 71 | 7001/HP | 7020K | NA | 1050K | White | 15268606 | NO |
| | | 11-14 | 62 | 7001/HP | 7020K | 9158 | 1070K | White | 15268606 | NO |
| | Deville | 01-05 | 62 | | | 9117 | 1080K | Green | 25773946 | NO |
| | DTS | 06 | | 7001/HP | 7020K | 9158 | 1070K | White | 15268606 | NO |
| | | | | | | | | Blue | | |
| | | 07-11 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 25920615 | VS950 |
| | ELR | 14 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | — | 22854866 | VS950 |
| | Escalade-ESV-EXT | 04 | 62 | | | 9115 | 1070K | Blue | 15136883 | NO |
| | | 05-06 | 62 | 7003 | 7020K | 9107 | 1070K | Blue | 15114379 | NO |
| | | 07 | 62 | 7001/HP | 7020K | NA | 2020K | Pink | 15825475 | NO |
| Escalade-ESV-EXT (cont.) | 07 | 62 | 7001/HP | 7020K | 9158 | 1070K | White | TRW Sensor Replacement | NO | |
| | 07-14 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 13586335 | VS950 | |
| Seville | 01-04 | 62 | | — | 9117 | 1080K | Green | 25773946 | NO | |
| SRX | 04-06 | 62 | 7001/HP | 7020K | 9116 | 1070K | Blue | 25774006 | NO | |
| | 07-14 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 12768826 | VS950 | |
| STS | 05-09 | 62 | 7001/HP | 7020K | 9076 | 1070K | Blue | 25758220 | NO | |
| | | 62 | 7001/HP | 7020K | 9158 | 1070K | White | 15268606 | NO | |
| | 09-11 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 25920615 | VS950 | |
| XLR | 04-09 | 62 | 7001/HP | 7020K | 9076 | 1070K | Blue | 25758220 | NO | |
| XTS | 13-14 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 20922900 | VS950 | |

The 1050K is to be used on the Siemens sensors and the 1070K is to be used on the Schrader sensors.

◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION GUIDE

| Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. |
|-----------------------------|------------|---------------|------------------|---------------|-------------|----------|-----------|------------------------|------------------|
| Avalanche | 04 | 62 | — | — | 9115 | 1070K | Blue | 15136883 | NO |
| | 05-06 | 62 | 7003 | 7020K | 9107 | 1070K | Blue | 15114379 | NO |
| | 07 | 62 | 7001/HP | 7020K | NA | 2020K | Pink | 15825475 | NO |
| | 07 | 62 | 7001/HP | 7020K | 9158 | 1070K | White | TRW Sensor Replacement | NO |
| | 07-13 | — | 7001-R/HP-R | VS80 | 9153 | VS950 | NA | 20923680 | VS950 |
| Aveo | 07-11 | — | — | — | 9153 | VS950 | NA | 25920615 | VS950 |
| Camaro | 10-14 | — | 7001-R/HP-R | VS80 | 9153 | VS950 | NA | 22854866 | VS950 |
| Camaro-Sport | 12-14 | 62 | 7001/HP | 7020K | 9158 | 1070K | Blue | 20964159 | NO |
| Caprice | 11-12 | 62 | 7001/HP | 7020K | 9158 | 1070K | White | 15268606 | NO |
| Captiva | 12-13 | — | 7001-R/HP-R | VS80 | 9153 | VS950 | NA | 20923680 | VS950 |
| Cobalt | 08-10 | 71 | 7001/HP | 7020K | NA | 1050K | White | 15268606 | NO |
| | 08-10 | — | 7001-R/HP-R | VS80 | 9153 | VS950 | NA | 12768826 | VS950 |
| Colorado | 07-12 | 62 | 7003 | 7020K | 9131 | 1110K | Teal | 15122618 | NO |
| Corvette | 97-00 | 62 | — | — | 8006 | 1077K | Lt Blue | 10438853 | NO |
| | 10-14 | 62 | 7001/HP | 7020K | 9158 | 1070K | White | 20925924 | NO |
| | | | | | | | Blue | | |
| Corvette-C6 | 05-09 | 62 | 7001/HP | 7020K | 9076 | 1070K | Blue | 25758220 | NO |
| Cruze | 11-14 | — | 7001-R/HP-R | VS80 | 9153 | VS950 | NA | 20922900 | VS950 |
| Equinox | 07-09 | 71 | 7001/HP | 7020K | NA | 1050K | White | 15921013 | NO |
| | 10-14 | — | 7001-R/HP-R | VS80 | 9153 | VS950 | NA | 22854866 | VS950 |
| Express Series | 08-09 | 71 | 7001HP | 7020K | NA | 1050K | White | 15921013 | NO |
| Express Series-1500 | 10-14 | — | 7001-R/HP-R | VS80 | 9153 | VS950 | NA | 20923680 | VS950 |
| Express Series -2500/3500 | 10-14 | — | 7001HP-R | VS80 | 9153 | VS950 | NA | 20923680 | VS950 |
| G Series | 08 | 71 | 7001/HP | 7020K | NA | 1050K | White | 15921013 | NO |
| HHR | 08-09 | 62 | 7001/HP | 7020K | 9158 | 1070K | White | 15268606 | NO |
| | | | | | | | Blue | | |
| | 08-11 | — | 7001-R/HP-R | VS80 | 9153 | VS950 | NA | 25920615 | VS950 |
| Impala | 06-07 | 62 | 7001/HP | 7020K | 9158 | 1070K | White | 15268606 | NO |
| | | | | | | | Blue | | |
| | 07-14 | — | 7001-R/HP-R | VS80 | 9153 | VS950 | NA | 20923680 | VS950 |
| Malibu Pre-October 14, 2007 | 08 | 71 | 7001/HP | 7020K | NA | 1050K | White | 15921013 | NO |
| Malibu | 08-14 | — | 7001-R/HP-R | VS80 | 9153 | VS950 | NA | 13589255 | VS950 |
| Monte Carlo | 06-07 | 62 | 7001/HP | 7020K | 9158 | 1070K | White | 15268606 | NO |
| | | | | | | | Blue | | |
| | 07 | — | 7001-R/HP-R | VS80 | 9153 | VS950 | NA | 25920615 | VS950 |

The 1050K is to be used on the Siemens sensors and the 1070K is to be used on the Schrader sensors.

DILL 2014 TPMS APPLICATION
GUIDE

| Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. | |
|---------------------|---------------|---------------|------------------|---------------|-------------|----------|-----------|------------------------|------------------|-------|
| Orlando | 12 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 25920615 | VS950 | |
| Silverado (All) | 04 | 62 | 7001HP-R | — | 9115 | 1070K | Blue | 15136883 | NO | |
| | 05-06 | 62 | 7003 | 7020K | 9107 | 1070K | Blue | 15114379 | NO | |
| Silverado-1500 | 07 | 62 | 7001/HP | 7020K | NA | 2020K | Pink | 15825475 | NO | |
| | 07 | 62 | 7001/HP | 7020K | 9158 | 1070K | White | TRW Sensor Replacement | NO | |
| | 07-14 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 13589255 | VS950 | |
| Silverado-2500/3500 | 07 | — | 7001HP | 7020K | NA | 2020K | Pink | 15825475 | NO | |
| | 07 | 62 | 7001HP | 7020K | 9158 | 1070K | White | TRW Sensor Replacement | NO | |
| | 07-14 | — | 7001HP-R | VS80 | 9153 | VS950 | NA | 13589255 | VS950 | |
| Sonic | 12-14 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 20922900 | VS950 | |
| Spark | 13-14 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 22854866 | VS950 | |
| SS | 14 | 62 | 7001/HP | 7020K | 9158 | 1070K | Blue | 20964159 | NO | |
| SSR | 06-07 | 62 | 7001/HP | 7020K | 9116 | 1070K | Blue | 25774006 | NO | |
| Suburban | 04 | 62 | | | 9115 | 1070K | Blue | 15136883 | NO | |
| | 05-06 | 62 | 7003 | 7020K | 9107 | 1070K | Blue | 15114379 | NO | |
| Suburban-1500 | 07 | 62 | 7001/HP | 7020K | NA | 2020K | Pink | 15825475 | NO | |
| | 07 | 62 | 7001/HP | 7020K | 9158 | 1070K | White | TRW Sensor Replacement | NO | |
| | 07-14 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 20923680 | VS950 | |
| Suburban-2500 | 07 | 62 | 7001HP | 7020K | NA | 2020K | Pink | 15825475 | NO | |
| | 07 | 62 | 7001HP | 7020K | 9158 | 1070K | White | TRW Sensor Replacement | NO | |
| | 07-14 | — | 7001HP-R | VS80 | 9153 | VS950 | NA | 20923680 | VS950 | |
| Tahoe | 04 | 62 | — | — | 9115 | 1070K | Blue | 15136883 | NO | |
| | 05-06 | 62 | 7003 | 7020K | 9107 | 1070K | Blue | 15114379 | NO | |
| | 07 | 62 | 7001/HP | 7020K | NA | 2020K | Pink | 15825475 | NO | |
| | 07 | 62 | 7001/HP | 7020K | 9158 | 1070K | White | TRW Sensor Replacement | NO | |
| | 07-14 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 20923680 | VS950 | |
| Trailblazer | 06-09 | 62 | 7001/HP | 7020K | 9116 | 1070K | Blue | 25774006 | NO | |
| Traverse | 09-14 | 62 | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 20923680 | VS950 | |
| Uplander | 08-09 | 62 | 7001/HP | 7020K | 9158 | 1070K | White | 15268606 | NO | |
| | | | | | | | Blue | | | |
| Volt | 10-14 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 22854866 | VS950 | |
| Chrysler | 200 | 11-14 | 71 | 7001/HP | 7020K | 1051 | 7000K | ◆ | 68078861AA | VS70 |
| | 300 (315 Mhz) | 05-07 | 71 | 7001/HP | 7020K | 1051 | 1050K | White | 68111696AA | NO |
| | 300 (433 Mhz) | 08 | 71 | 7004 | 7020K | 1043 | 1050K | White | 68001698AB | NO |
| | | 09-10 | 58 | — | — | 9214 | 9066K | NA | 56029400AE | 9066K |
| | | 11-14 | 53 | — | — | 9398 | VS950 | NA | 56029398AB | VS950 |
| | 02-04 | 35 | 7004 | 7020K | 9028 | 1080K | Green | 52088990AC | NO | |

The 1050K is to be used on the Siemens sensors and the 1070K is to be used on the Schrader sensors. ◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION GUIDE

| | Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. | | | | | | | | |
|-------------------|--------------------|----------------|----------------|------------------|---------------|----------------------|----------------------|------------|------------------|------------------|-----------------|----------------|---------|-------|------------|----------------------|------------|------------|
| Chrysler (cont.) | Aspen | 07-09 | 71 or 58 | 7001/HP | 7020K | 1051 ** | 1050K or 9066K | White | 56029465AB | 9066K | | | | | | | | |
| | | | | | | | | Lt Grey | | | | | | | | | | |
| | Concorde (433 Mhz) | 02-04 | 35 | 7004 | 7020K | 9028 | 1080K | Green | 52088990AC | NO | | | | | | | | |
| | Crossfire | 04-08 | 35 | 7004 | 7020K | 9028 | 1080K | Green | 52088990AC | NO | | | | | | | | |
| | | | | | | | | | | | 05 | 71 or 58 | 7001/HP | 7020K | 1051 ** | 1050K or 9066K | White | 56053030AB |
| | Pacifica | 04 | 35 | 7004 | 7020K | 9028 | 1080K | Green | 52088990AC | NO | | | | | | | | |
| | | 04-05 | 71 | 7001/HP | 7020K | 1052 | 1050K | White | 04727392AB | NO | | | | | | | | |
| | | 06-08 | 71 | 7001/HP | 7020K | 1051 | 1050K | White | 68001696AB | NO | | | | | | | | |
| | Prowler | 01 | 35 | — | — | 8004 | 1080K | Green | 4815132AB | NO | | | | | | | | |
| | | 02 | 35 | 7004 | 7020K | 9028 | 1080K | Green | 52088990AC | NO | | | | | | | | |
| | PT Cruiser | 08-10 | 71 | 7001/HP | 7020K | 1051 | 1050K | White | 68001696AB | NO | | | | | | | | |
| | Sebring | 07-10 | 71 | 7001/HP | 7020K | 1051 | 1050K | White | 68001696AB | NO | | | | | | | | |
| | | | | | | | | 10 | | | 71 | 7001/HP | 7020K | 1051 | 7000K | ◆ | 68078861AA | VS70 |
| | Town and Country | 02-03 | 35 | 7004 | 7020K | 9028 | 1080K | Green | 52088990AC | NO | | | | | | | | |
| | | 04-05 | 71 | 7001/HP | 7020K | 1052 | 1050K | White | 04727392AB | NO | | | | | | | | |
| | | 06-07 | 71 | 7001/HP | 7020K | 1051 | 1050K | White | 56053030AB | NO | | | | | | | | |
| 08-10 | | 71 | 7004 | 7020K | 1043 | 1050K | White | 68001698AB | NO | | | | | | | | | |
| 10 | | 71 | 7004 | 7020K | 1043 | 7000K | ◆ | 68078768AA | VS70 | | | | | | | | | |
| 11-14 | — | — | — | — | 9398 | VS950 | NA | 56029398AB | VS950 | | | | | | | | | |
| Voyager (433 Mhz) | 02-03 | 35 | 7004 | 7020K | 9028 | 1080K | Green | 52088990AC | NO | | | | | | | | | |
| Dodge | Avenger | 08-10 | 71 | 7001/HP | 7020K | 1051 | 1050K | White | 68001696AB | NO | | | | | | | | |
| | | | | | | | | 10-14 | | | 71 | 7001/HP | 7020K | 1051 | 7000K | ◆ | 68078861AA | VS70 |
| | Caliber | 07-10 | 71 | 7001/HP | 7020K | 1051 | 1050K | White | 68001696AB | NO | | | | | | | | |
| | | | | | | | | 11-12 | | | 71 | 7001/HP | 7020K | 1051 | 7000K | ◆ | 68078861AA | VS70 |
| | Caliber-Export | 12 | 71 | 7004 | 7020K | 1043 | 7000K | ◆ | 68078768AA | VS70 | | | | | | | | |
| | Caravan | 02-03 | 35 | 7004 | 7020K | 9028 | 1080K | Green | 52088990AC | NO | | | | | | | | |
| | | | | | | | | 04-05 | | | 71 | 7001/HP | 7020K | 1052 | 1050K | White | 04727392AB | NO |
| | | | | | | | | 06-07 | | | 71 | 7001/HP | 7020K | 1051 | 1050K | White | 56053030AB | NO |
| | Challenger | 08 | 71 | 7004 | 7020K | 1043 | 1050K | White | 68078768AA | NO | | | | | | | | |
| | | | | | | | | 10-14 | | | — | — | — | 9398 | VS950 | NA | 56029398AB | VS950 |
| | Challenger SRT | 08-14 | 58 | — | — | 9214 | 9066K | Lt Grey | 56029400AE | 9066K | | | | | | | | |
| | Charger | 06-07 | 71 | 7001/HP | 7020K | 1051 | 1050K | White | 68001696AB | NO | | | | | | | | |
| | | | | | | | | 08 | | | 71 | 7004 | 7020K | 1043 | 1050K | White | 68001698AB | NO |
| | | | | | | | | 10-14 | | | — | — | — | 9398 | VS950 | NA | 56029398AB | VS950 |
| | Charger SRT | 09-14 | 58 | — | — | 9214 | 9066K | Lt Grey | 56029400AE | 9066K | | | | | | | | |
| | Dakota | 08-10 | 58 | 7001/HP | 7020K | 9154 | 9066K | Lt Grey | 56029319AC | 9066K | | | | | | | | |
| 11 | | | | | | | | — | | | 7001-R/ HP-R | VS80 | 9308 | VS950 | NA | 56029479AB | VS950 | |
| Dart | 13-14 | — | — | — | 5775 | VS90 | NA | 68193586AC | VS90 | | | | | | | | | |
| Durango | 07-09 | 71 or 58 | 7001/HP | 7020K | 1051 ** | 1050K or 9066K | White | 56029465AB | 9066K | | | | | | | | | |
| | | | | | | | Lt Grey | | | | | | | | | | | |
| Durango (433 Mhz) | 11-14 | — | — | — | 9398 | VS950 | NA | 56029398AB | VS950 | | | | | | | | | |

**The 1050K is to be used on the Siemens sensors and the 2030K is to be used on the Schrader sensors. ◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION
GUIDE

| Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. | |
|-------------------------------|--------------------------------------|---------------|------------------|---------------|-------------|----------------|------------------|------------------------|------------------|-------|
| Grand Caravan | 02-03 | 35 | 7004 | 7020K | 9028 | 1080K | Green | 52088990AC | NO | |
| | 04-05 | 71 | 7001/HP | 7020K | 1052 | 1050K | White | 04727392AB | NO | |
| | 06-07 | 71 | 7001/HP | 7020K | 1051 | 1050K | White | 56053030AB | NO | |
| | 08-10 | 71 | 7004 | 7020K | 1043 | 1050K | White | 68001698AB | NO | |
| | 10 | 71 | 7004 | 7020K | 1043 | 7000K | ◆ | 68078768AA | VS70 | |
| | 11-14 | — | — | — | — | 9398 | VS950 | NA | 56029398AB | VS950 |
| Intrepid (433 Mhz) | 02-04 | 35 | 7004 | 7020K | 9028 | 1080K | Green | 52088990AC | NO | |
| Journey (433 Mhz) | 09-10 | 71 | 7004 | 7020K | 1043 | 1050K | White | 68001698AB | NO | |
| | 10-14 | — | — | — | — | 9398 | VS950 | NA | 56029398AB | VS950 |
| Magnum | 05-07 | 71 | 7001/HP | 7020K | 1051 | 1050K | White | 68001696AB | NO | |
| | 08 | 71 | 7004 | 7020K | 1043 | 1050K | White | 68001698AB | NO | |
| Nitro | 07-09 | 71 or 58 | 7001/HP | 7020K | 1051** | 1050K or 9066K | White Lt Grey | 56029465AB | 9066K | |
| Nitro (433 Mhz) | 07-09 | — | 7004 | 7020K | 1043 | 1050K | White | 68001698AB | NO | |
| | 10-11 | — | — | — | — | 9481 | VS950 | NA | 56029481AB | VS950 |
| Ram Promaster | 14 | — | — | — | NEW | — | — | 5154876AA | | |
| Ram (HP-315 Mhz) -1500 | 08 | 58 | — | — | 9154 | 9066K | Lt Grey | 56029319AC (Check VIN) | 9066K | |
| Ram (HP-315 Mhz) -2500 | 08-09 | 58 | 7001HP | 7020K | 9154 | 9066K | Lt Grey | 56029319AC (Check VIN) | 9066K | |
| Ram (433 Mhz) -1500 | 09 | 71 | 7004 | 7020K | 1043 | 1050K | White | 56029359AC | NO | |
| Ram (433 Mhz) -1500/2500 | 13-14 | — | — | — | 6815 | NEW | — | 68157568AB | NEW | |
| Ram (433 Mhz) -1500/2500/3500 | 10-13 | — | — | — | 9398 | VS950 | NA | 56029398AB | VS950 | |
| Stratus | 07 | 71 | 7001/HP | 7020K | 1051 | 1050K | White | 56053030AB | NO | |
| Viper | 08-14 | — | — | — | 9214 | 9066K | Lt Grey | 56029400AE | 9066K | |
| Viper (433 Mhz) | 03-07 | 35 | 7004 | 7020K | 9028 | 1080K | Green | 52088990AD | NO | |
| Ferrari | F430/Spider (433 Mhz) | 06-07 | 35 | — | — | 9001 | 1090K | Gray | 22 45 49 | 1092 |
| | F430/Spider (433 Mhz) Post-July 2007 | 08-10 | 35 | — | — | 9007 or 9011 | 1090K | Gray | 23 92 98 | 1092 |
| | 458 (433 Mhz) | 10-14 | 40 | — | — | 9011 | 1096 | Gray | 23 92 98 | 1096 |
| | 550 (433 Mhz) | 02-14 | 35 | — | — | 9001 | 1090K | Gray | 22 45 49 | 1092 |
| | 575 (315 Mhz) | 02-05 | 35 | — | — | 9004 | 1090K | Gray | 22 45 48 | 1092 |
| | 575M (433 Mhz) | 02-06 | 35 | — | — | 9001 | 1090K | Gray | 22 45 49 | 1092 |
| | 599 (433 Mhz) | 04-14 | 35 | — | — | 9001 | 1090K | Gray | 22 45 49 | 1092 |
| | 612 Scaglietta (433 Mhz) | 04-12 | 35 | — | — | 9001 | 1090K | Gray | 22 45 49 | 1092 |
| | California (433 Mhz) | 09-10 | 35 | — | — | 9008 or 9011 | 1090K | Gray | 22 88 87 | 1092 |
| | | 11-14 | 40 | — | — | 9011 | 1096 | — | 23 92 98 | 1096 |
| | Enzo (433 Mhz) | 03-04 | 35 | — | — | 9005 | 1090K | Gray | 22 45 51 | 1092 |
| | F12 Berlinetta (433 Mhz) | 13-14 | — | — | — | 9011 | 1096 | — | 23 92 98 | 1096 |
| | FF (433 Mhz) | 12-14 | — | — | — | 9011 | 1096 | — | 23 92 98 | 1096 |
| | FXX (433 Mhz) | 05-06 | 35 | — | — | 9005 | 1090K | Gray | 22 45 51 | 1092 |

**The 1050K is to be used on the Siemens sensors and the 2030K is to be used on the Schrader sensors. ◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION GUIDE

| Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. |
|---------------------|------------|---------------|------------------|---------------|-------------|----------|------------|-----------------------------|------------------|
| 500 (433 Mhz) | 11-14 | — | — | — | 9398 | VS950 | — | 56029398AB | VS950 |
| Crown Victoria | 06-11 | — | 7001-R/ HP-R | VS80 | 1048 | NA | NA | 6F2Z-1A189A | NO |
| C-Max | 12-14 | — | 7001-R/ HP-R | VS80 | 9315 | VS950 | NA | DE8T-1A180-AA | VS950 |
| E Series | 07-09 | — | 7001HP-R | VS80 | 1048-HP | NA | NA | 8C2Z-1A189A | NO |
| E Series (HP) | 10-14 | — | 7001HP-R | VS80 | 9315 | VS950 | NA | 9L3Z-1A-189A | VS950 |
| Edge | 07-10 | — | 7001-R/ HP-R | VS80 | 1048 | NA | NA | 7L1Z-1A189A | NO |
| | 11-14 | — | 7001-R/ HP-R | VS80 | 9315 | VS950 | NA | DE8T-1A180-AA | VS950 |
| Escape | 06-08 | — | 7001-R/ HP-R | VS80 | 1048 | NA | NA | 6F2Z-1A189A | NO |
| | 09-14 | — | 7001-R/ HP-R | VS80 | 9315 | VS950 | NA | 9L3Z-1A-189A | VS950 |
| Expedition | 03-04 | 44 | 7004 | 7020K | 9096 | 1060K | Rubine Red | 4L2T1A150BA | NO |
| | 05-06 | 44 | 7001/HP | 7020K | 9135 | 1060K | Rubine Red | 5L1ZA150AB | NO |
| | 07-10 | — | 7001-R/ HP-R | VS80 | 1048 | NA | NA | 7L1Z-1A189A | NO |
| | 11-14 | — | 7001-R/ HP-R | VS80 | 9315 | VS950 | NA | 9L3Z-1A-189A | VS950 |
| Explorer | 02-05 | 44 | 7004 | 7020K | 9096 | 1060K | Rubine Red | 4L2T1A150BA | NO |
| | 06-10 | — | 7001-R/ HP-R | VS80 | 1048 | NA | NA | 6F2Z-1A189A | NO |
| | 11-14 | — | 7001-R/ HP-R | VS80 | 9315 | VS950 | NA | 9L3Z-1A-189A | VS950 |
| Explorer Sport Trac | 07-10 | — | 7001-R/ HP-R | VS80 | 1048 | NA | NA | 6F2Z-1A189A | NO |
| F-150 | 07-08 | — | 7001-R/ HP-R | VS80 | 1048 | NA | NA | 6F2Z-1A189A | NO |
| | 09-14 | — | 7001-R/ HP-R | VS80 | 9315 | VS950 | NA | 9L3Z-1A-189A | VS950 |
| Fiesta | 11-14 | — | 7001-R/ HP-R | VS80 | 9315 | VS950 | NA | 9L3Z-1A-189A | VS950 |
| 500 | 08-09 | — | 7001-R/ HP-R | VS80 | 1048 | NA | NA | 6F2Z-1A189A | NO |
| Flex | 09-10 | — | 7001-R/ HP-R | VS80 | 1048 | NA | NA | 7L1Z-1A189A | NO |
| | 11-14 | — | 7001-R/ HP-R | VS80 | 9315 | VS950 | NA | 9L3Z-1A-189A | VS950 |
| Focus | 07-09 | — | 7001-R/ HP-R | VS80 | 1048 | NA | NA | 6F2Z-1A189A/ 7L1Z-1A189A | NO |
| | 10-14 | — | 7001-R/ HP-R | VS80 | 9315 | VS950 | NA | 9L3Z-1A-189A | VS950 |
| Freestar | 04-05 | 44 | 7001/HP | 7020K | 9135 | 1060K | Rubine Red | 5L1ZA150AB | NO |
| | 06-07 | — | 7001-R/ HP-R | VS80 | 1048 | NA | NA | 6F2Z-1A189A | NO |
| Fusion | 07-09 | — | 7001-R/ HP-R | VS80 | 1048 | NA | NA | 6F2Z-1A189A | NO |
| | 10-14 | — | 7001-R/ HP-R | VS80 | 9315 | VS950 | NA | 9L3Z-1A-189A | VS950 |

*Redi-Sensor relearn must be performed with scan tool and not magnet.

DILL 2014 TPMS APPLICATION GUIDE

| | Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. |
|--------------|------------------------------|------------|-----------------|------------------|---------------|-------------|----------|--------------|------------------------|------------------|
| Ford (cont.) | Mustang | 07-09 | — | 7001-R/ HP-R | VS80 | 1048 | NA | NA | 6F2Z-1A189A | NO |
| | | 10-14 | — | 7001-R/ HP-R | VS80 | 9315 | VS950 | NA | 9L3Z-1A-189A | VS950 |
| | | 14 | — | 7004 | 7020K | NEW | VS950 | — | BB5Z-1A189A | |
| | Ranger | 07-11 | — | 7001-R/ HP-R | VS80 | 1048 | NA | NA | 6F2Z-1A189A | NO |
| | | 12 | — | 7001-R/ HP-R | VS80 | 9315 | VS950 | NA | 9L3Z-1A-189A | VS950 |
| | Shelby GT Post-April 2012 | 13 | — | 7001-R/ HP-R | VS80 | 9315 | VS925C | NA | DR3Z-1A189A | VS925C |
| | Super Duty Pre-June 2009 | 07-10 | — | 7001HP-R | VS80 | 1048-HP | NA | NA | 8C2Z-1A189A | NO |
| | Super Duty Post-June 2009 | 10-14 | — | 7001HP-R | VS80 | 9315 | VS950 | NA | 9L3Z-1A-189A | VS950 |
| | Taurus Pre-May 2010 | 08-10 | — | 7001-R/ HP-R | VS80 | 1048 | NA | NA | 7L1Z-1A189A | NO |
| | Taurus Post-May 2010 | 11-14 | — | 7001-R/ HP-R | VS80 | 9315 | VS950 | NA | 9L3Z-1A-189A | VS950 |
| Taurus X | 08-09 | — | 7001-R/ HP-R | VS80 | 1048 | NA | NA | 7L1Z-1A189A | NO | |
| Transit | 10-14 | — | 7001-R/ HP-R | VS80 | 9315 | VS950 | NA | 9L3Z-1A-189A | VS950 | |
| GMC | Acadia | 07-08 | 71 | 7001/HP | 7020K | NA | 1050K | White | 15921013 | NO |
| | | 09-14 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 20923680 | VS950 |
| | Canyon | 07-12 | 62 | 7003 | 7020K | 9131 | 1110K | Teal | 15122618 | NO |
| | Envoy | 05-07 | 62 | 7001/HP | 7020K | 9116 | 1070K | Blue | 25774006 | NO |
| | | 07-09 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 25920615 | VS950 |
| | Savana | 08-09 | 71 | 7001/HP | 7020K | NA | 1050K | White | 15921013 | NO |
| | | 10-14 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 20923680 | VS950 |
| | Sierra (All) | 04 | 62 | — | — | 9115 | 1070K | Blue | 15136883 | NO |
| | | 05-06 | 62 | 7003 | 7020K | 9107 | 1070K | Blue | 15114379 | NO |
| | Sierra-1500 | 07 | 62 | 7001/HP | 7020K | NA | 2020K | Pink | 15825475 | NO |
| | | 07 | 62 | 7001/HP | 7020K | 9158 | 1070K | White | TRW Sensor Replacement | NO |
| | | 07-14 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 13589255 | VS950 |
| | Sierra-2500/3500 | 07 | — | 7001HP | 7020K | NA | 2020K | Pink | 15825475 | NO |
| | | 07 | — | 7001HP | 7020K | 9158 | 1070K | White | TRW Sensor Replacement | NO |
| | | 07-14 | — | 7001HP-R | VS80 | 9153 | VS950 | NA | 13589255 | VS950 |
| Terrain | 10-14 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 20923680 | VS950 | |
| Yukon (All) | 04 | 62 | — | — | 9115 | 1070K | Blue | 15136883 | NO | |
| | 05-06 | 62 | 7003 | 7020K | 9107 | 1070K | Blue | 15114379 | NO | |

*Redi-Sensor relearn must be performed with scan tool and not magnet.

Note: Use "TRW LoLine Fxd Dly" function on BarTec 400 or 400P to program the sensors.

DILL 2014 TPMS APPLICATION GUIDE

| | Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. |
|--------------------------|----------------------|------------|---------------|------------------|---------------|----------------|----------------|---------------|------------------------|------------------|
| GMC (cont.) | Yukon | 07 | 62 | 7001/HP | 7020K | NA | 2020K | Pink | 15825475 | NO |
| | | 07 | 62 | 7001/HP | 7020K | 9158 | 1070K | White | TRW Sensor Replacement | NO |
| | | 07-14 | — | 7001-R/HP-R | VS80 | 9153 | VS950 | NA | 20923680 | VS950 |
| | Yukon-2500 | 07 | — | 7001HP | 7020K | NA | 2020K | Pink | 15825475 | NO |
| | | 07 | — | 7001HP | 7020K | 9158 | 1070K | White | TRW Sensor Replacement | NO |
| | | 07-14 | — | 7001HP-R | VS80 | 9153 | VS950 | NA | 13589255 | VS950 |
| Honda | Accord | 08-12 | 35 | 7002 | 7020K | 1208 | 1100K | Purple | 42753-SWA-315/316 | NO |
| | Civic | 08-11 | 35 | 7002 | 7020K | 1212 | 2045K | Lt Blue | 42753-TR3-A81 | NO |
| | | 12-13 | 35 | 7002 | 7020K | 1212 | 2045K | Lt Blue | 42753-TR3-A81 | NO |
| | CR-V | 07-11 | 35 | 7002 | 7020K | 1208 | 1100K | Purple | 42753-SWA-315/316 | NO |
| | CR-V | 12-13 | 71 | 7002 | 7020K | 5511 | 7020K | ◆ | 42753-TP6-A82 | VS70 |
| | CR-Z | 11-12 | 35 | 7002 | 7020K | 1212 | 2045K | Lt Blue | 42753-TR3-A81 | NO |
| | Crosstour | 10-14 | 71 | 7002 | 7020K | 5511 | 7020K | ◆ | 42753-TP6-A82 | VS70 |
| | Element | 06-07 | 40 | 7002 | 7020K | 1058 | 2000K | Yellow | 06421-SCV-A01 | 1096 |
| | | 08 | 35 or 40 | 7002 | 7020K | 1058 | 2045K or 2000K | Lt Blue | 42753-SHJ-A82 | NO or 1096 |
| | | | | | | | | Yellow | | |
| | 09-11 | 35 | 7002 | 7020K | 1212 | 2045K | Lt Blue | 42753-TR3-A81 | NO | |
| | Fit | 08 | 35 | 7002 | 7020K | 1208 | 1100K | Purple | 42753-SWA-315/316 | NO |
| | | 09-13 | 35 | 7002 | 7020K | 1212 | 2045K | Lt Blue | 42753-TR3-A81 | NO |
| | Insight | 10-13 | 35 | 7002 | 7020K | 1212 | 2045K | Lt Blue | 42753-TR3-A81 | NO |
| | Odyssey EX, EX-L, LX | 06-07 | 40 | 7002 | 7020K | 1058 | 2000K | Yellow | 06421-SCV-A00 | 1096 |
| | | 08-10 | 35 or 40 | 7002 | 7020K | 1058 | 2045K or 2000K | Lt Blue | 42753-SHJ-A82 | NO or 1096 |
| | Yellow | | | | | | | | | |
| | Odyssey Touring | 05-07 | 40 | — | — | 1057 | 2000K | Yellow | 06421-S3V-A04 | 1096 |
| | | 08-10 | 35 or 40 | — | — | 1057 | 2045K or 2000K | Lt Blue | 42753-SHJ-A53 | NO or 1096 |
| Yellow | | | | | | | | | | |
| 11-14 | 35 | 7002 | 7020K | 1212 | 2045K | Lt Blue | 42753-TR3-A81 | NO | | |
| Pilot (Alloy Wheels) | 05-08 | 40 | — | — | 1057 | 2000K | Yellow | 06421-S3V-A04 | 1096 | |
| | 09-14 | 35 | — | — | 1209 | 1100K | Purple | 42753-STK-A04 | NO | |
| Pilot (Steel Wheels) | 05 | 40 | — | — | 1059 | 2000K | Yellow | 06421-S9V-A02 | 1097 | |
| | 09-14 | 35 | — | — | 1219 | 1100K | Purple | 42753-SZA-A13 | NO | |
| Ridgeline (Alloy Wheels) | 06-08 | 40 | — | — | 1057 | 2000K | Yellow | 06421-S3V-A04 | 1096 | |
| | 09-14 | 35 or 40 | — | — | 1057 | 2045K or 2000K | Lt Blue | 42753-SHJ-A53 | NO or 1096 | |
| Yellow | | | | | | | | | | |
| Ridgeline (Steel Wheels) | 06-08 | 40 | — | — | 1059 | 2000K | Yellow | 06421-S9V-A02 | 1097 | |
| S2000 | 08-09 | 35 | 7002 | 7020K | 1208 | 1100K | Purple | 42753-S2A-315 | NO | |
| Hummer | H2 | 08-09 | — | 7001-R/HP-R | VS80 | 9153 | VS950 | NA | 25920615 | VS950 |
| | H3 | 06-10 | 62 | 7003 | 7020K | 9131 | 1110K | Teal | 15122618 | NO |
| | H3T | 09-10 | 62 | 7003 | 7020K | 9131 | 1110K | Teal | 15122618 | NO |

◆ The 7020K Service Kit is used.

Note: Use "TRW LoLine Fxd Dly" function on BarTec 400 or 400P to program the sensors.

DILL 2014 TPMS APPLICATION GUIDE

| Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. |
|------------------------------------|------------|---------------|------------------|----------------|-------------|----------------|------------|------------------|------------------|
| Accent | 12-13 | 71 | 7001/HP | 7020K | 5507 | 7020K | — | 52933-2M000 | VS70 |
| | 14 | | 7001/HP | 7020K | 5507 | 7020K | — | 52933-2M550 | VS70 |
| Accent (Lo-Line) | 08-11 | 31-40 | 7002 or 1206A | 7020K or 1100K | 1029** | 2040K | Lt Blue | 52933-2F000 | NO |
| Azera | 06-12 | 40 | 7002 | 7020K | 1068 | 2000K | Yellow | 52933-2G200 | 1096 |
| | 13-14 | — | | | 9505 | VS950 | NA | 52933-2V000 | VS950 |
| Elantra | 07-10 | 40 | 7002 | 7020K | 1068 | 2000K | Yellow | 52933-2G200 | 1096 |
| | 11-14 | — | 7002 | 7020K | NEW | VS965 | Lt Blue | 52933-3X200 | VS965 |
| Elantra (Touring) | 09-12 | 71 | 7001/HP | 7020K | 5507 | 1050K or 7020K | White ◆ | 52933-2L700 | VS70 |
| Elantra GT | 13 | 71 | 7001/HP | 7020K | 5507 | 7020K | ◆ | 52933-A5000 | VS70 |
| Entourage | 07-09 | 40 | — | — | 1028 | 2000K | Yellow | 52933-4D200 | 1096 |
| Equus (Hi-Line) | 11-13 | 31-40 | — | — | 1029 | 2040K | Lt Blue | 52933-2F000 | NO |
| | 14 | | 7001/HP | 7020K | 5507 | 7020K | — | 52933-A5000 | VS70 |
| Genesis (Hi-line) | 09-14 | 31-40 | — | — | 1029 | 2040K | Lt Blue | 52933-2F000 | NO |
| Genesis Coupe | 10-14 | 71 | 7001/HP | 7020K | 5507 | 7020K | ◆ | 52933-2M550 | VS70 |
| Santa Fe Thru July 2007 | 07-08 | 40 | — | — | 1028 | 2000K | Yellow | 52933-4D200 | 1096 |
| Santa Fe Thru September 2009 | 08-10 | 40 | 7002 | 7020K | 1068 | 2000K | Yellow | 52933-2G200 | 1096 |
| Santa Fe Post-October 2009 | 10-12 | 11 | 7002 | 7020K | 1068 | VS1010 | — | 52933-0W100 | VS1010 |
| Santa Fe | 13-14 | 71 | 7001/HP | 7020K | 5507 | 7020K | ◆ | 52933-A5000 | VS70 |
| Sonata | 07-08 | 40 | | | 1058 | 2000K | Yellow | 52933-3E000 | 1096 |
| Sonata | 11-14 | 71 | 7001/HP | 7020K | 5507 | 7020K | ◆ | 52933-A5000 | VS70 |
| Sonata (Lo-Line) Late 2008-2010 | 08-10 | 31-40 | 7002 or 1206A | 7020K or 1100K | 1029** | 2040K | Lt Blue | 52933-2F000 | NO |
| Tiburon | 07-08 | 40 | — | — | 1058 | 2000K | Yellow | 52933-3E000 | 1096 |
| Tucson | 06-07 | 40 | — | — | 1058 | 2000K | Yellow | 52933-3E000 | 1096 |
| | 08-10 | — | 7002 | 7020K | 1058 | 2000K | Yellow | 52933-3E000 | 1096 |
| | 10-13 | 31-40 | 7002 or 1206A | 7020K or 1100K | 1029** | 2040K | Lt Blue | 52933-2F000 | NO |
| | 14 | — | 7002 | 7020K | NEW | VS965 | — | 52933-2S500 | VS965 |
| Veloster | 12-14 | — | — | — | 9505 | VS950 | NA | 52933-2V000 | VS950 |
| Veracruz | 07-08 | 40 | — | — | 1028 | 2000K | Yellow | 52933-4D200 | 1096 |
| | 08-12 | 40 | 7002 | 7020K | 1068 | 2000K | Yellow | 52933-2G200 | 1096 |
| EX35 | 08-10 | 35 | 7001/HP | 7020K | 9204 | 1100K | Purple | 40700-JK00C | NO |
| | 11-12 | 35 | 7003 | 7020K | 1216 | 1100K | Purple | 40700-1LA0E | NO |
| EX37 | 13 | | 7003 | 7020K | 1216 | 1100K | Purple | 40700-1LA0E | NO |
| FX35 | 03-08 | 45-60 | 7001/HP | 7020K | 9064 | 1080K | Green | 40700-CD001 | NO |
| | 11-12 | 35 | 7003 | 7020K | 1216 | 1100K | Purple | 40700-1LA0E | NO |
| FX35 Post-June 2008 | 09-10 | 35 | 7001/HP | 7020K | 9204 | 1100K | Lt Grey | 40700-JK00C | NO |
| FX37 | 13 | 35 | 7003 | 7020K | 1216 | 1100K | Purple | 40700-1LA0E | NO |

**The 1050K is to be used on the Siemens sensors and the 2030K is to be used on the Schrader sensors. ◆ The 7020K Service Kit is used.
 Note: Use "TRW LoLine Fxd Dly" function on BarTec 400 or 400P to program the sensors.

DILL 2014 TPMS APPLICATION GUIDE

| Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. | |
|--------------------------------|-----------------|---------------|------------------|---------------|-------------|------------------------|-----------|------------------|------------------------|----|
| FX45 <i>Pre-June 2007</i> | 03-07 | 45-60 | 7001/HP | 7020K | 9064 | 1080K | Green | 40700-CD001 | NO | |
| FX45 <i>Post-June 2007</i> | 07-08 | 66 | 7001/HP | 7020K | 9204 | 2030K | Lt Grey | 40700-JA00C | NO | |
| FX50 | 09-10 | 35 | 7001/HP | 7020K | 9204 | 1100K | Lt Grey | 40700-JK00C | NO | |
| | 11-13 | 35 | 7003 | 7020K | 1216 | 1100K | Purple | 40700-1LA0E | NO | |
| G25 | 11-12 | 35 | 7003 | 7020K | 1216 | 1100K | Purple | 40700-1LA0E | NO | |
| G35 | 03-06 | 45-60 | 7001/HP | 7020K | 9064 | 1080K | Green | 40700-CD001 | NO | |
| G35 (Sedan) | 07-08 | 35 | 7001/HP | 7020K | 9204 | 1100K | Lt Grey | 40700-JK00C | NO | |
| G35 (Coupe) | 08 | 66 | 7001/HP | 7020K | 9204 | 2030K | Lt Grey | 40700-1AA0C | NO | |
| G37 | 08-10 | 35 | 7001/HP | 7020K | 9204 | 1100K | Lt Grey | 40700-JK00C | NO | |
| | 11-13 | 35 | 7003 | 7020K | 1216 | 1100K | Purple | 40700-1LA0E | NO | |
| JX35 (433 Mhz) | 13 | 71 | — | — | 5556 | 7020K | ◆ | 40700-3JA0A | VS70 | |
| M35 | 06-07 | 45-60 | 7001/HP | 7020K | 9064 | 1080K | Green | 40700-CD001 | NO | |
| | 08-10 | 66 | 7001/HP | 7020K | 9204 | 2030K | Lt Grey | 40700-1AA0C | NO | |
| M35h | 13 | — | 7003 | 7020K | 1216 | 1100K | — | 40700-1LA0E | NO | |
| M37 | 11-13 | 35 | 7003 | 7020K | 1216 | 1100K | — | 40700-1LA0E | NO | |
| M45 | 03-07 | 45-60 | 7001/HP | 7020K | 9064 | 1080K | Green | 40700-CD001 | NO | |
| | 08-10 | 66 | 7001/HP | 7020K | 9204 | 2030K | Lt Grey | 40700-1AA0C | NO | |
| M56 | 11-13 | 35 | 7003 | 7020K | 1216 | 1100K | Purple | 40700-1LA0E | NO | |
| Q45 <i>Pre-July 2006</i> | 03-06 | 45-60 | 7001/HP | 7020K | 9064 | 1080K | Green | 40700-CD001 | NO | |
| Q45 <i>Post-August 2006</i> | 06 | 66 | 7001/HP | 7020K | 9204 | 2030K | Lt Grey | 40700-JA01B | NO | |
| Q50 | 14 | 71 | — | — | NEW | 7020K | — | 40700-4GA0A | VS70 | |
| Q60 | 14 | 35 | 7003 | 7020K | 1216 | 1100K | — | 40700-1LA0E | NO | |
| QX4 | 03 | 45-60 | 7001/HP | 7020K | 9064 | 1080K | Green | 40700-CD001 | NO | |
| QX50 | 14 | 35 | 7003 | 7020K | 1216 | 1100K | — | 40700-1LA0E | NO | |
| QX56 | 11-13 | 35 | 7003 | 7020K | 1216 | 1100K | Purple | 40700-1LA0E | NO | |
| QX56 <i>Post-April 2007</i> | 07-10 | 66 | 7001/HP | 7020K | 9204 | 2030K | Lt Grey | 40700-JA00C | NO | |
| QX56 (Steel) | 05-06 | 49 | 7001/HP | 7020K | 9069 | 1130K | Burgundy | 40700-CK002 | NO | |
| QX56 (Alloy) | 04-07 | 49 | 7001/HP | 7020K | 9161 | 1080K | Green | 40700-CK001 | NO | |
| QX60 (433 Mhz) | 14 | 71 | — | — | 5556 | 7020K | ◆ | 40700-3JA0A | VS70 | |
| QX70 | 14 | 35 | 7003 | 7020K | 1216 | 1100K | — | 40700-1LA0E | NO | |
| QX80 | 14 | 35 | 7003 | 7020K | 1216 | 1100K | — | 40700-1LA0E | NO | |
| ITEC Trucks (433 Mhz) | — | — | — | — | 9010 | VS9013 or VS9980 | — | — | VS9013 or VS9980 | |
| ISUZU Ascender | 06-08 | 62 | 7001/HP | 7020K | 9116 | 1070K | Blue | 25774006 | NO | |
| | I-290 | 07-08 | 62 | 7003 | 7020K | 9131 | 1110K | Teal | 15122618 | NO |
| | I-370 | 07-08 | 62 | 7003 | 7020K | 9131 | 1110K | Teal | 15122618 | NO |
| | Rodeo (433 Mhz) | 04 | 35 | 7004 | 7020K | 9028 | 1080K | Green | 52088990AC | NO |

**The 1050K is to be used on the Siemens sensors and the 2030K is to be used on the Schrader sensors. ◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION **GUIDE**

| Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. | |
|--------|-----------------------|---------------|------------------|-----------------|-------------|------------|----------------------|------------------|------------------|-------|
| Jaguar | F (315 Mhz) | 14 | 71 | — | — | 1045 | 7020K | — | CSD21601 | VS70 |
| | F (433 Mhz) | 14 | 71 | — | — | 1046 | 7020K | — | C2D21599 | VS70 |
| | Super V8 (315 Mhz) | 05-09 | 71 | — | 7020K | 1055 | 1050K | — | C2Z15017 | NO |
| | Super V8 (433 Mhz) | 05-09 | 71 | — | 7020K | 1046 | 1050K | White | C2Z15016 | NO |
| | Vanden Plas (315 Mhz) | 04-09 | 71 | — | 7020K | 1055 | 1050K | — | C2Z15017 | NO |
| | Vanden Plas (433 Mhz) | 04-09 | 71 | — | 7020K | 1046 | 1050K | White | C2Z15016 | NO |
| | X Type (315 Mhz) | 08 | 71 | — | 7020K | 1055 | 1050K | — | C2Z15017 | NO |
| | X Type (433 Mhz) | 08 | 71 | — | 7020K | 1046 | 1050K | White | C2Z15016 | NO |
| | XF (315 Mhz) | 09-10 | 71 | — | 7020K | 1055 | 1050K | White | C2Z15017 | NO |
| | | 11-14 | 71 | — | 7020K | 1055 | 7020K | ◆ | C2C41656 | VS70 |
| | XF (433 Mhz) | 09-10 | 71 | — | 7020K | 1046 | 1050K | White | C2Z15016 | NO |
| | | 11-14 | 71 | — | 7020K | 1046 | 7020K | ◆ | C2C41655 | NO |
| | XJ (315 Mhz) | 04-09 | 71 | — | 7020K | 1055 | 1050K | White | C2Z15017 | NO |
| | | 10-11 | 71 | — | 7020K | 1055 | 7020K | ◆ | C2Z15017 | VS70 |
| | | 12-14 | 71 | — | 7020K | 1045 | 7020K | White | C2D21601 | NO |
| | XJ (433 Mhz) | 04-09 | 71 | — | 7020K | 1046 | 1050K | White | C2Z15016 | NO |
| | | 10-13 | 71 | — | 7020K | 1046 | 7020K | ◆ | C2D21599 | NO |
| | XK (315 Mhz) | 05-10 | 71 | — | 7020K | 1055 | 1050K | ◆ | C2Z15017 | NO |
| | | 10-14 | 71 | — | 7020K | 1055 | 7020K | ◆ | C2C41656 | VS70 |
| | XK (433 Mhz) | 05-10 | 71 | — | 7020K | 1046 | 1050K | White | C2Z15016 | NO |
| 10-14 | | 71 | — | 7020K | 1046 | 7020K | ◆ | C2C41655 | NO | |
| Jeep | Cherokee | 14 | — | — | — | 6815 | NEW | — | 68157568AB | NEW |
| | Commander | 06 | 71 | 7001/HP | 7020K | 1051 | 1050K | White | 56029465AB | NO |
| | | 07 | 71 or 58 | 7001/HP | 7020K | 1051 ** | 1050K or 9066K | White Lt Grey | 56029465AB | 9066K |
| | | 07-10 | 71 or | 7004 | 7020K | 1043 ** | 1050K or | White Lt Grey | 56029359AB | 9066K |
| | Compass | 07-09 | 71 | 7001/HP | 7020K | 1051 | 1050K | White | 68001696AB | NO |
| | | 10 | 71 or 58 | 7001/HP | 7020K | 1051 ** | 1050K or 9066K | ◆ L | 68078861AA | 9066K |
| | | 11-12 | 71 or 58 | 7001/HP | 7020K | 1051 ** | 7000K or 9066K | ◆ Lt Grey | 68078861AA | 9066K |
| | | 13-14 | — | 7001-R/ HP-R | VS80 | 9308 | VS950 | — | 56029479AB | VS950 |
| | | 13-14 | — | — | — | 9481 | VS950 | NA | 56029481AB | VS950 |
| | Grand Cherokee | 02-04 | 64 | 7004 | 7020K | 9028 | 1080K | Green | 52088990AC | NO |
| | | 05-06 | 71 | 7001/HP | 7020K | 1051 | 1050K | White | 68001696AB | NO |
| | | 07 | 71 or 58 | 7001/HP | 7020K | 1051 | 1050K or 9066K | White Lt Grey | 56029465AB | 9066K |
| | | 08-10 | 71 or 58 | 7004 | 7020K | 1043 ** | 1050K or 9066K | White Lt Grey | 56029359AB | 9066K |
| | | 11-14 | — | — | — | 9398 | VS950 | NA | 56029398AB | VS950 |

**The 1050K is to be used on the Siemens sensors and the 2030K is to be used on the Schrader sensors. ◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION GUIDE

| Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. | |
|--------------------|--------------------|---------------|------------------|---------------|----------------|----------------|----------------|------------------|-----------------------------|-------|
| Jeep (cont.) | Grand Cherokee SRT | 12-14 | 53 | — | — | 9214 | 9066K | Lt Grey | 56029400AE | 9066K |
| | Liberty | 02-04 | 64 | 7004 | 7020K | 9028 | 1080K | Green | 52088990AC | NO |
| | | 05-07 | 71 | 7001/HP | 7020K | 1051 | 1050K | White | 56029465AB | NO |
| | | 08-10 | 71 or 58 | 7001/HP | 7020K | 1051** | 1050K or 9066K | White | 56029465AB | 9066K |
| | | | | | | | | Lt Grey | | |
| | 11-12 | — | 7001-R/HP-R | VS80 | 9308 | VS950 | NA | 56029479AB | VS950 | |
| | Liberty (433 Mhz) | 07-09 | 71 or 58 | 7004 | 7020K | 1043** | 1050K or 9066K | White | 56029359AB | 9066K |
| | | | | | | | | Lt Grey | | |
| | | 10-12 | — | — | — | 9481 | VS950 | NA | 56029481AB | VS950 |
| | Patriot | 07-09 | 71 | 7001/HP | 7020K | 1051 | 1050K | White | 68001696AB | NO |
| | | 10-12 | 71 or 58 | 7001/HP | 7020K | 1051** | 1050K or 9066K | White | 56029465AB | 9066K |
| | | | | | | | | Lt Grey | | |
| | 13-14 | — | 7001-R/HP-R | VS80 | 9308 | VS950 | NA | 56029479AB | VS950 | |
| | Patriot (433 Mhz) | 12-14 | — | — | — | 9481 | VS950 | NA | 56029481AB | VS950 |
| | Wrangler | 07-10 | 71 or 58 | 7001/HP | 7020K | 1051** | 1050K or 9066K | White | 56029465AB | 9066K |
| Lt Grey | | | | | | | | | | |
| 10-12 | | — | 7001-R/HP-R | VS80 | 9308 | VS950 | NA | 56029479AB | VS950 | |
| Wrangler (433 Mhz) | 08-10 | 71 or 58 | 7004 | 7020K | 1043** | 1050K or 9066K | White | 56029359AB | 9066K | |
| | | | | | | | Lt Grey | | | |
| | 11-12 | — | — | — | 9481 | VS950 | NA | 56029481AB | VS950 | |
| 13-14 | — | — | — | 9398 | VS950 | NA | 56029398AB | VS950 | | |
| KIA | Amanti | 07-08 | 40 | — | — | 1058 | 2000K | Yellow | 52933-3E000 | 1096 |
| | | 09 | — | 7002 | 7020K | 1058 | 2000K | Yellow | 52933-3E000 | 1096 |
| | Borrego (Lo-Line) | 09 | 31-40 | 7002 or 1206A | 7020K or 1100K | 1029** | 2040K | Lt Blue | 52933-2F000 | NO |
| | Cadenza | 14 | 71 | 7001/HP | 7020K | 5507 | 7020K | — | 52933-A5000 | VS70 |
| | Forte | 10-13 | 71 | 7001/HP | 7020K | 5507 | 7020K | ◆ | 52933-2M000 | VS70 |
| | | 14 | — | — | — | NEW | VS965 | — | 52933-A7000 | VS965 |
| | Magentis | 08-10 | 40 | 7002 | 7020K | 1068 | 2000K | Yellow | 52933-2G200 | 1096 |
| | Mohave | 09 | 31-40 | 7002 or 1206A | 7020K or 1100K | 1029** | 2040K | Lt Blue | 52933-2F000 | NO |
| | Optima | 11-14 | 71 | 7001/HP | 7020K | 5507 | 7020K | ◆ | 52933-2M000/ 52933-2M550 | VS70 |
| | Optima (Lo-Line) | 06-10 | 40 | 7002 | 7020K | 1068 | 2000K | Yellow | 52933-2G200 | 1096 |
| | Rio5 (Lo-Line) | 08-11 | 31-40 | 7002 or 1206A | 7020K or 1100K | 1029** | 2040K | Lt Blue | 52933-2F000 | NO |
| | | 12-14 | — | 7002 | 7020K | NEW | VS965 | Lt Blue | 52933-3X200 | VS965 |
| | Rondo (Lo-Line) | 07-09 | 40 | 7002 | 7020K | 1068 | 2000K | Yellow | 52933-2G200 | 1096 |
| | Sedona (Hi-Line) | 06-08 | 40 | — | — | 1028 | 2000K | Yellow | 52933-4D200 | 1096 |
| | Sedona (Lo-Line) | 09-14 | 40 | 7002 | 7020K | 1068 | 2000K | Yellow | 52933-2G200 | 1096 |

**The 1050K is to be used on the Siemens sensors and the 2030K is to be used on the Schrader sensors. ◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION GUIDE

| | Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. |
|-----------------------------|-----------------------------|------------|---------------|------------------|----------------|-------------|----------|----------------|------------------|------------------|
| KIA (cont.) | Sorento | 05-07 | 40 | | | 1058 | 2000K | Yellow | 52933-3E000 | 1096 |
| | | 08-09 | | 7002 | 7020K | 1058 | 2000K | Yellow | 52933-3E000 | 1096 |
| | | 11-14 | 71 | 7001/HP | 7020K | 5507 | 7020K | ◆ | 52933-2M000 | VS70 |
| | Soul | 10-13 | 71 | 7001/HP | 7020K | 5507 | 7020K | ◆ | 52933-2M000 | VS70 |
| | Soul (433 Mhz) | 14 | — | — | — | NEW | — | — | 52933-B2100 | — |
| | Spectra-5 (Lo-Line) | 07-09 | 31-40 | 7002 or 1206A | 7020K or 1100K | 1029** | 2040K | Lt Blue | 52933-2F000 | NO |
| | Sportage | 06-07 | 40 | — | — | 1058 | 2000K | Yellow | 52933-3E000 | 1096 |
| | | 08 | | 7002 | 7020K | 1058 | 2000K | Yellow | 52933-3E000 | 1096 |
| | | 14 | — | — | — | NEW | VS965 | — | 52933-2S500 | VS965 |
| | Sportage(Lo-Line) | 09-13 | 31-40 | 7002 or 1206A | 7020K or 1100K | 1029** | 2040K | Lt Blue | 52933-2F000 | NO |
| Tuscany | 07-08 | 40 | — | — | 1058 | 2000K | Yellow | Enhanced/Basic | 1096 | |
| Land Rover | LR2 (315 Mhz) | 08-10 | 71 | — | — | 1045 | 1050K | White | LR032833 | NO |
| | | 10-14 | 71 | — | — | 1045 | 7020K | ◆ | LR032833 | VS70 |
| | LR2 (433 Mhz) | 10-12 | 71 | — | — | 1046 | 7020K | ◆ | LR018861 | VS70 |
| | LR3 (315 Mhz) | 06-09 | 71 | — | — | 1055 | 1050K | White | LR018860 | NO |
| | LR3 (433 Mhz) | 02-05 | 58 | — | — | 9003 | 1090K | Gray | YDB 0000 60 | 1092-1095 |
| | | 06-09 | 71 | — | — | 1046 | 1050K | White | LR018861 | NO |
| | LR4 (315 Mhz) | 10-13 | 71 | — | — | 1045* | 7020K | ◆ | LR032833 | VS70 |
| | LR4 (433 Mhz) | 10-14 | 71 | — | — | 1046* | 7020K | ◆ | LR018861 | VS70 |
| | Evoque (315 Mhz) | 11-14 | 71 | — | — | 1045 | 7020K | ◆ | LR032833 | NO |
| | Range Rover (315 Mhz) | 06-09 | 71 | — | — | 1055 | 1050K | White | LR018860 | NO |
| | | 10-14 | 71 | — | — | 1045* | 7020K | ◆ | LR032833 | VS70 |
| | Range Rover (433 Mhz) | 06-09 | 71 | — | — | 1046 | 1050K | White | LR018861 | NO |
| | | 10-14 | 71 | — | — | 1046* | 7020K | ◆ | LR018861 | VS70 |
| | Range Rover Sport (315 Mhz) | 06-09 | 71 | — | — | 1055 | 1050K | White | LR021936 | NO |
| | | 10-14 | 71 | — | — | 1045* | 7020K | ◆ | LR032833 | VS70 |
| Range Rover Sport (433 Mhz) | 06-09 | 71 | — | — | 1046 | 1050K | White | LR018861 | NO | |
| | 10-14 | 71 | — | — | 1046* | 7020K | ◆ | LR018861 | VS70 | |
| Lexus | CT | 11-13 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-33021 | NO |
| | ES | 07-12 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-33021 | NO |
| | | 13-14 | 35 | 7003 | 7020K | 1218 | 1100K | Purple | 42607-30060 | NO |
| | GS | 05-12 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-33021 | NO |
| | | 13-14 | 35 | 7003 | 7020K | 1218 | 1100K | Purple | 42607-30060 | NO |
| | GX | 07-14 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-33021 | NO |
| | GX470 | 04-06 | 35 | 7002 or 1204A | 7020K | 1204 | 1110K | Teal | 42607-35010 | NO |

*Utilize the VIN on MY 2013-14 vehicles in determining the correct sensor frequency. ◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION GUIDE

| | Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. |
|---------------|-------------------|------------|-----------------|------------------|---------------|--|----------|-------------|--|------------------|
| Lexus (cont.) | HS Series | 11-12 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-75010 | NO |
| | IS Series | 06-14 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-33021 | NO |
| | LFA | 12 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-33021 | NO |
| | LS | 07-12 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-33021 | NO |
| | LS | 13-14 | 35 | 7003 | 7020K | 1218 | 1100K | Purple | 42607-30060 | NO |
| | LX | 05-14 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-33021 | NO |
| | RX | 06-14 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-33021 | NO |
| | SC | 07-10 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-33021 | NO |
| | SC430 | 02-06 | 27 | — | — | 1217-WH 1217-BL 1217-RD 1217-YL | 1120K | Gold | 42607-24010 42607-24020 42607-24030 42607-24040 | NO |
| Lincoln | Aviator (433 Mhz) | 03-05 | 44 | *7004 | 7020K | 9096 | 1060K | Rubine Red | 4L2T1A150-BA | NO |
| | Mark LT | 07-08 | — | 7001-R/ HP-R | VS80 | 1048 | NA | NA | 6F2Z-1A189A | NO |
| | MKS | 09-10 | — | 7001-R/ HP-R | VS80 | 1048 | NA | NA | 7L1Z-1A189A | NO |
| | | 11-14 | — | 7001-R/ HP-R | VS80 | 9315 | VS950 | NA | CM5T-1A150AA | VS950 |
| | MKT | 10 | — | 7001-R/ HP-R | VS80 | 1048 | NA | NA | 7L1Z-1A189A | NO |
| | | 11-14 | — | 7001-R/ HP-R | VS80 | 9315 | VS950 | NA | CM5T-1A150AA | VS950 |
| | MKT (433 Mhz) | 14 | — | 7004 | 7020K | NEW | VS950 | — | BB5Z-1A189A | VS950 |
| | MKX | 07-10 | — | 7001-R/ HP-R | VS80 | 1048 | NA | NA | 7L1Z-1A189A | NO |
| | | 11-13 | — | 7001-R/ HP-R | VS80 | 9315 | VS950 | NA | 9L3Z-1A189A | VS950 |
| | MKZ | 07-09 | — | 7001-R/ HP-R | VS80 | 1048 | NA | NA | 6F2Z-1A189A | NO |
| | | 10-14 | — | 7001-R/ HP-R | VS80 | 9315 | VS950 | NA | CM5T-1A150AA | VS950 |
| | Navigator | 03-04 | 44 | *7004 | 7020K | 9096 | 1060K | Rubine Red | 4L2T1A150-BA | NO |
| | | 05-06 | 44 | 7001/HP | 7020K | 9135 | 1060K | Rubine Red | 5L1Z1A150-AB | NO |
| | | 07-10 | — | 7001-R/ HP-R | VS80 | 1048 | NA | NA | 7L1Z-1A189A | NO |
| | | 11-14 | — | 7001-R/ HP-R | VS80 | 9315 | VS950 | NA | CM5T-1A150AA | VS950 |
| Town Car | 06-11 | — | 7001-R/ HP-R | VS80 | 1048 | NA | NA | 6F2Z-1A189A | NO | |

*Redi-Sensor relearn must be performed with scan tool and not magnet.

DILL 2014 TPMS APPLICATION **GUIDE**

| | Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. |
|---------------|------------------------------------|------------|-----------------|------------------|---------------|-------------|----------|---------------|-------------------------------|------------------|
| Maserati | Quattroporte Thru December 2009 | 04-09 | 35 | — | — | 9001 | 1090K | — | 22 45 49 | 1092 |
| | Quattroporte Post-January 2010 | 10-14 | 40 | — | — | 9011 | 1096 | — | 24 88 87 | 1096 |
| | Coupe Thru June 2009 | 09 | 35 | — | — | 9001 | 1090K | — | 22 45 49 | 1092 |
| | Coupe Post-July 2009 | 09-14 | 40 | — | — | 9011 | 1096 | — | 24 88 87 | 1096 |
| Mazda | B Series | 07-09 | — | 7001/HP | 7020K | 1048 | NA | NA | 6F2Z-1A189A | NO |
| | 2 | 11-14 | 71 | 7001/HP | 7020K | 1056 | 7020K | ◆ | BHA4-37-140 | VS70 |
| | 3 | 04 | 71 | 7001/HP | 7020K | 1056 | NA | NA | FE01-37-140A/ GN3A-37-140B | NO |
| | | 05-09 | 71 | 7001/HP | 7020K | 1056 | 1050K | White | BBM2-37-140B | NO |
| | | 10-13 | 71 | 7001/HP | 7020K | 1056 | 7020K | ◆ | BHA4-37-140 | VS70 |
| | 5 | 06-09 | 71 | 7001/HP | 7020K | 1056 | 1050K | White | BBM2-37-140B | NO |
| | | 10-12 | 71 | 7001/HP | 7020K | 1056 | 7020K | ◆ | BHA4-37-140 | VS70 |
| | 6 | 05-10 | 71 | 7001/HP | 7020K | 1056 | 1050K | White | BBM2-37-140B | NO |
| | | 10-13 | 71 | 7001/HP | 7020K | 1056 | 7020K | ◆ | BHA4-37-140 | VS70 |
| | CX-7 | 07-09 | 71 | 7001/HP | 7020K | 1056 | 1050K | White | BBM2-37-140B | NO |
| | | 10-12 | 71 | 7001/HP | 7020K | 1056 | 7020K | ◆ | BHA4-37-140 | VS70 |
| | CX-9 | 07-09 | 71 | 7001/HP | 7020K | 1056 | 1050K | White | BBM2-37-140B | NO |
| | | 10-14 | 71 | 7001/HP | 7020K | 1056 | 7020K | ◆ | BHA4-37-140 | VS70 |
| | MX-5 Miata | 06-09 | 71 | 7001/HP | 7020K | 1056 | 1050K | White | BBM2-37-140B | NO |
| | | 10-14 | 71 | 7001/HP | 7020K | 1056 | 7020K | ◆ | BHA4-37-140 | VS70 |
| | RX8 | 04 | 71 | 7001/HP | 7020K | 1056 | NA | NA | FE01-37-140A/ GN3A-37-140B | NO |
| | | 05-09 | 71 | 7001/HP | 7020K | 1056 | 1050K | White | BBM2-37-140B | NO |
| | | 10-11 | 71 | 7001/HP | 7020K | 1056 | 7020K | ◆ | BHA4-37-140 | VS70 |
| | Speed 3 | 10-12 | 71 | 7001/HP | 7020K | 1056 | 7020K | ◆ | BHA4-37-140 | VS70 |
| | Speed 6 | 07-08 | 71 | 7001/HP | 7020K | 1056 | 1050K | White | BBM2-37-140B | NO |
| Tribute | 06-08 | — | 7001/HP | 7020K | 1048 | NA | NA | 6F2Z-1A189A | NO | |
| | 09-11 | — | 7001-R/ HP-R | VS80 | 9315 | VS950 | NA | 9L3Z-1A189A | VS950 | |
| Mercedes-Benz | C Class (433 Mhz) | 07-14 | 53 | — | — | 9214 | 2030K | Lt Grey | 000 905 7200 | 9066K |
| | CLA | 14 | 53 | — | — | 9214 | 2030K | — | 000 905 7200 | 9066K |
| | CL Class (315 Mhz) | 00-06 | 35 | — | — | 9004 | 1090K | Gray | 000 822 34 06 | 1094 |
| | CL Class (433 Mhz) | 00-06 | 35 | — | — | 9001 | 1090K | Gray | 000 822 3306 | 1094 |
| | | 09-14 | 53 | — | — | 9214 | 2030K | Lt Grey | 000 905 7200 | 9066K |
| | CL 63-65-550-600 (315 Mhz) | 07-11 | 53 | 7003 | 7020K | 1054 | 1040K | Pantone Brown | 002 540 7917 | 1040K |
| | CL 63-65-550-600 (433 Mhz) | 07-11 | 53 | — | — | 1049 | 1040K | Pantone Brown | 002 540 8017 | 1040K |
| | CLK Class (315 Mhz) | 06-07 | 35 | — | — | 9004 | 1090K | Gray | 000 822 34 06 | 1094 |
| | CLK Class (433 Mhz) | 08-09 | 53 | — | — | 9214 | 2030K | Lt Grey | 000 905 4100 | 9066K |
| | CLS 55-63-500-550 (315 Mhz) | 06-11 | 53 | 7003 | 7020K | 1054 | 1040K | Pantone Brown | 002 540 7917 | 1040K |

*Redi-Sensor relearn must be performed with scan tool and not magnet. ◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION GUIDE

| Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. |
|-----------------------------|------------|---------------|------------------|---------------|-------------|----------|---------------|------------------|------------------|
| CLS 55-63-500-550 (433 Mhz) | 06-09 | 53 | — | — | 1049 | 1040K | Pantone Brown | 002 540 8017 | 1040K |
| CLS Class (433 Mhz) | 08-14 | 53 | — | — | 9214 | 2030K | Lt Grey | 000 905 4100 | 9066K |
| | 11 | 53 | — | — | 1049 | 1040K | Pantone Brown | 002 540 8017 | 1040K |
| E Class (315 Mhz) | 00-05 | 35 | — | — | 9004 | 1090K | Gray | 000 822 34 06 | 1094 |
| | 06-10 | 53 | 7003 | 7020K | 1054 | 1040K | Pantone Brown | 002 540 7917 | 1040K |
| E Class (433 Mhz) | 00-05 | 35 | — | — | 9001 | 1090K | Gray | 000 822 33 06 | 1094 |
| | 06-10 | 53 | — | — | 1049 | 1040K | Pantone Brown | 002 540 8017 | 1040K |
| | 10-14 | 53 | — | — | 9214 | 2030K | Lt Grey | 000 905 7200 | 9066K |
| G Class (433 Mhz) | 07-14 | 53 | — | — | 9214 | 2030K | Lt Grey | 000 905 4100 | 9066K |
| GL (433 Mhz) | 10-14 | 53 | — | — | 9214 | 2030K | Lt Grey | 000 905 7200 | 9066K |
| GL Class (315 Mhz) | 07-09 | 53 | 7003 | 7020K | 1054 | 1040K | Pantone Brown | 002 540 7917 | 1040K |
| GL Class (433 Mhz) | 07-09 | 53 | — | — | 1049 | 1040K | Pantone Brown | 002 540 8017 | 1040K |
| GLK (433 Mhz) | 10-14 | 53 | — | — | 9214 | 2030K | Lt Grey | 000 905 7200 | 9066K |
| ML Class (315 Mhz) | 06-10 | 53 | 7003 | 7020K | 1054 | 1040K | Pantone Brown | 002 540 7917 | 1040K |
| ML Class (433 Mhz) | 06-10 | 53 | — | — | 1049 | 1040K | Pantone Brown | 002 540 8017 | 1040K |
| | 10-14 | 53 | — | — | 9214 | 2030K | Lt Grey | 000 905 7200 | 9066K |
| | 12 | 35 | — | — | 9214 | 2030K | Lt Grey | 000 905 4100 | 9066K |
| R Class (315 Mhz) | 06-09 | 53 | 7003 | 7020K | 1054 | 1040K | Pantone Brown | 002 540 7917 | 1040K |
| R Class (433 Mhz) | 06-09 | 53 | — | — | 1049 | 1040K | Pantone Brown | 002 540 8017 | 1040K |
| | 10 | 35 | — | — | 9214 | 2030K | Lt Grey | 000 905 4100 | 9066K |
| | 11 | 53 | — | — | 1049 | 1040K | Pantone Brown | 002 540 8017 | 1040K |
| | 12 | 35 | — | — | 9214 | 2030K | Lt Grey | 000 905 4100 | 9066K |
| S (433 Mhz) | 10-14 | 53 | — | — | 9214 | 2030K | Lt Grey | 000 905 4100 | 9066K |
| S Class (315 Mhz) | 00-06 | 35 | — | — | 9004 | 1090K | Gray | 000 822 34 06 | 1094 |
| | 07-11 | 53 | 7003 | 7020K | 1054 | 1040K | Pantone Brown | 002 540 7917 | 1040K |
| S Class (433 Mhz) | 00-06 | 35 | — | — | 9001 | 1090K | Gray | 000 822 33 06 | 1094 |
| | 07-10 | 53 | — | — | 1049 | 1040K | Pantone Brown | 002 540 8017 | 1040K |
| SL Class (315 Mhz) | 00-05 | 35 | — | — | 9004 | 1090K | Gray | 000 822 34 06 | 1094 |
| | 06-12 | 53 | 7003 | 7020K | 1054 | 1040K | Pantone Brown | 002 540 7917 | 1040K |
| SL Class (433 Mhz) | 00-05 | 35 | — | — | 9001 | 1090K | Gray | 000 822 33 06 | 1094 |
| | 06-09 | 53 | — | — | 1049 | 1040K | Pantone Brown | 002 540 8017 | 1040K |
| | 13-14 | 53 | — | — | 9214 | 2030K | Lt Grey | 000 905 7200 | 9066K |
| SLK Class (433 Mhz) | 08-14 | 53 | — | — | 9214 | 2030K | Lt Grey | 000 905 7200 | 9066K |
| SLR Class (315 Mhz) | 04-06 | 35 | — | — | 9004 | 1090K | Gray | 000 822 34 06 | 1094 |
| | 08-09 | 53 | 7003 | 7020K | 1054 | 1040K | Pantone Brown | 002 540 7917 | 1040K |

*Redi-Sensor relearn must be performed with scan tool and not magnet.

DILL 2014 TPMS APPLICATION GUIDE

| | Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. |
|------------------------------|------------------------------|---------------|---------------|------------------|---------------|-------------|----------|------------------|------------------|------------------|
| Mercedes-Benz (cont.) | SLR Class (433 Mhz) | 00-06 | 35 | — | — | 9001 | 1090K | Gray | 000 822 33 06 | 1094 |
| | | 08-09 | 53 | — | — | 1049 | 1040K | Pantone Brown | 002 540 8017 | 1040K |
| | SLS (433 mhz) | 11-14 | 53 | — | — | 9214 | 2030K | Lt Grey | 000 905 7200 | 9066K |
| | Sprinter | 07-13 | 54 | — | — | 1042 | 1098K | Reddish / Purple | 68038945AA | 1098K |
| | | 14 | — | — | — | 9214 | 2030K | Lt Grey | 000 905 7200 | 9066K |
| Mercury | Grand Marquis | 07-10 | — | 7001-R/HP-R | VS80 | 1048 | NA | NA | 6F2Z-1A189A | NO |
| | Mariner | 06-08 | — | 7001-R/HP-R | VS80 | 1048 | NA | NA | 6F2Z-1A189A | NO |
| | | 09-11 | — | 7001-R/HP-R | VS80 | 9315 | VS950 | NA | 9L3Z-1A189-A | VS950 |
| | Milan | 08-09 | — | 7001-R/HP-R | VS80 | 1048 | NA | NA | 6F2Z-1A189A | NO |
| | | 10-11 | — | 7001-R/HP-R | VS80 | 9315 | VS950 | NA | 9L3Z-1A189-A | VS950 |
| | Montego | 06-07 | — | 7001-R/HP-R | VS80 | 1048 | NA | NA | 6F2Z-1A189A | NO |
| | Monterey | 04-05 | 44 | 7001/HP | 7020K | 9135 | 1060K | Rubine Red | 5L1Z1A150-AB | NO |
| | | 06-07 | — | 7001-R/HP-R | VS80 | 1048 | NA | NA | 6F2Z-1A189A | NO |
| | Mountaineer | 02-05 | 44 | 7004 | 7020K | 9096 | 1060K | Rubine Red | 4L2T1A150-BA | NO |
| | | 06-10 | — | 7001-R/HP-R | VS80 | 1048 | NA | NA | 6F2Z-1A189A | NO |
| | Sable | 08-09 | — | 7001-R/HP-R | VS80 | 1048 | NA | NA | 7L1Z-1A189A | NO |
| | Mini | All (433 Mhz) | 07-09 | 35 | — | — | 1027 | 1090K | Gray | 36 23 6 781 847 |
| All (433 Mhz) September 2009 | | 10-14 | 40 | — | — | 9012 | 1096 | Yellow | 36 10 6 856 227 | 1096 |
| Mitsubishi | Eclipse (Alloy) | 06-12 | 45-53 | 7001HP | 7020K | 9034 | 1080K | Green | 425 0B 877 | NO |
| | Eclipse (Steel) | 06-07 | 45-53 | 7001/HP | 7020K | 9069 | 1130K | Burgundy | 4250A030 | NO |
| | Endeavor Pre-September 2006 | 04-06 | 45-53 | 7004 | 7020K | 9028 | 1080K | Green | MN103033 | NO |
| | Endeavor Post-September 2006 | 06-12 | 45-53 | 7001/HP | 7020K | 9034 | 1080K | Green | 425 0B 877 | NO |
| | Galant | 04-06 | 45-53 | 7004 | 7020K | 9028 | 1080K | Green | MN103033 | NO |
| | Galant (Alloy) | 07-12 | 45-53 | 7001/HP | 7020K | 9034 | 1080K | Green | 425 0B 877 | NO |
| | Galant (Steel) | 07-12 | 45-53 | 7001/HP | 7020K | 9069 | 1130K | Burgundy | 425 0B 875 | NO |
| | i-MiEV | 12-13 | — | — | — | ** | 7020K | White | 425 0B 975 | VS70 |
| | Lancer** | 08-10 | 71 | — | — | ** | 1050K | White | 425 0B 975 | NO |
| | | 10-14 | 71 | — | — | ** | 7020K | ◆ | 425 0B 975 | VS70 |
| | Mirage | 14 | — | — | — | NEW | VS90 | — | 425 0C 276 | VS90 |
| | Mirage Post-September 2013 | 14 | — | — | — | ** | 7020K | — | 425 0B 975 | VS70 |
| Montero | 03-05 | 45-53 | 7001/HP | 7020K | 9034 | 1080K | Green | MN103081 | NO | |

*Redi-Sensor relearn must be performed with scan tool and not magnet. **See dealer for replacement sensor and relearn. ◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION GUIDE

| | Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. |
|---|---|------------|---------------|------------------|---------------|-------------|----------|-------------|------------------|------------------|
| Mitsubishi (cont.) | Outlander** | 07-10 | 71 | — | — | ** | 1050K | White | 425 0B 975 | NO |
| | | 10-14 | 71 | — | — | ** | 7020K | ◆ | 425 0B 975 | VS70 |
| | Outlander Sport | 14 | — | — | — | ** | 7020K | ◆ | 425 0B 975 | VS70 |
| | Raider | 08-09 | 53 | 7001/HP | 7020K | 9154 | 9066K | Lt Grey | 56029319AB | 9066K |
| Nissan | 350Z | 04-06 | 45-60 | 7001/HP | 7020K | 9064 | 1080K | Green | 40700-CD001 | NO |
| | | 07-09 | 50-70 | 7001/HP | 7020K | 9204 | 2030K | Lt Grey | 40700-JA00C | NO |
| | 370Z | 08-10 | 35 | 7001/HP | 7020K | 9204 | 1100K | Lt Grey | 40700-JK00C | NO |
| | | 11-14 | 35 | 7003 | 7020K | 1216 | 1100K | Purple | 40700-1LA0E | NO |
| | Altima | 06-11 | 50-70 | 7001/HP | 7020K | 9204 | 2030K | Lt Grey | 40700-1AA0D | NO |
| | | 12 | 71 | 7001/HP | 7020K | 5555 | 7020K | ◆ | 40700-3AN0A | VS70 |
| | Altima (433 Mhz) | 13-14 | 71 | — | — | 5556 | 7020K | ◆ | 40700-3JA0A | VS70 |
| | Altima Coupe | 13 | 71 | 7001/HP | 7020K | 5555 | 7020K | ◆ | 40700-3AN0A | VS70 |
| | Armada (Alloy-SE) | 05-08 | 49 | 7001/HP | 7020K | 9161 | 1080K | Green | 40700-CK001 | NO |
| | Armada (Steel) | 05-06 | 49 | 7001/HP | 7020K | 9069 | 1130K | Burgundy | 40700-CK002 | NO |
| | Armada-LE | 09-14 | 50-70 | 7001/HP | 7020K | 9204 | 2030K | Lt Grey | 40700-1AA0D | NO |
| | Cube Pre-November 2011 | 09-12 | 50-70 | 7001/HP | 7020K | 9204 | 2030K | Lt Grey | 40700-1AA0D | NO |
| | Cube-1.8 & 1.8 S CVT 11/11-3/12 | 12 | — | 7001/HP | 7020K | 9204 | 2030K | Lt Grey | 40700-1AA0D | NO |
| | Cube-1.8 SL 10/10-11/11 | 11-12 | — | — | — | 5557 | 7020K | ◆ | 40700-3AN1A | VS70 |
| | Cube-1.8 & 1.8S 3/12-9/13 | 12-13 | 35 | 7001/HP | 7020K | 9204 | 1100K | — | 40700-JK01B | NO |
| | Cube-1.8 S CVT Post-November 2011 | 12-14 | — | 7003 | 7020K | 1216 | 1100K | Purple | 40700-1LA0E | NO |
| | Frontier | 03-04 | 45-60 | 7001/HP | 7020K | 9064 | 1080K | Green | 40700-CD001 | NO |
| | Frontier (Alloy) | 05-08 | 49 | 7001/HP | 7020K | 9161 | 1080K | Green | 40700-CK001 | NO |
| | Frontier (Steel) | 05-07 | 49 | 7001/HP | 7020K | 9069 | 1130K | Burgundy | 40700-CK002 | NO |
| | Frontier 5/08-10/13 | 09-13 | 50-70 | 7001/HP | 7020K | 9204 | 2030K | Lt Grey | 40700-1AA0D | NO |
| | Frontier 1/12-10/13 | 11-13 | 71 | 7001/HP | 7020K | 5555 | 7020K | ◆ | 40700-3AN0A | VS70 |
| | GT-R | 09-14 | 50-70 | 7001/HP | 7020K | 9204 | 2030K | Lt Grey | 40700-1AA0D | NO |
| | Juke (With I-Key) 7/11-9/11 | 11 | — | — | — | 5557 | 7020K | ◆ | 40700-3AN1A | VS70 |
| | Juke (With I-Key) Post-February 2012 | 12-14 | — | 7003 | 7020K | 1216 | 1100K | Purple | 40700-1LA0E | NO |
| | Juke Base (Without I-Key) Pre-March 2012 | 11 | 50-70 | 7001/HP | 7020K | 9204 | 2030K | Lt Grey | 40700-1AA0D | NO |
| | Juke Base (Without I-Key) Post-March 2012 | 12-14 | 35 | 7001/HP | 7020K | 9204 | 1100K | — | 40700-JK01B | NO |
| Juke SV & SL (With I-Key) 7/10-7/11 | 11 | — | 7003 | 7020K | 1216 | 1100K | Purple | 40700-1LA0E | NO | |
| Leaf | 11-13 | 35 | 7003 | 7020K | 1216 | 1100K | Purple | 40700-1LA0E | NO | |
| Leaf Post-December 2012 | 13-14 | 71 | — | — | 5557 | 7020K | ◆ | 40700-3AN1A | VS70 | |

The 1050K is to be used on the Siemens sensors and the 1070K is to be used on the Schrader sensors. **See dealer for replacement sensor and relearn. ◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION GUIDE

| Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. |
|--|------------|---------------|------------------|---------------|-------------|----------|-----------|------------------|------------------|
| Maxima | 06-07 | 49 | 7001/HP | 7020K | 9161 | 1080K | Green | 40700-CK001 | NO |
| | 07-12 | 50-70 | 7001/HP | 7020K | 9204 | 2030K | Lt Grey | 40700-1AA0D | NO |
| | 12-14 | 71 | 7001/HP | 7020K | 5555 | 7020K | ◆ | 4070-3AN0A | VS70 |
| Murano | 03-06 | 45-60 | 7001/HP | 7020K | 9064 | 1080K | Green | 40700-CD001 | NO |
| | 07-12 | 50-70 | 7001/HP | 7020K | 9204 | 2030K | Lt Grey | 40700-1AA0D | NO |
| Murano <i>Pre-November 2011</i> | 12-14 | 35 | 7001/HP | 7020K | 9204 | 1100K | — | 40700-JK01B | NO |
| NV200 | 13-14 | 50-70 | 7001/HP | 7020K | 9204 | 2030K | — | 40700-1AA0D | NO |
| NV -1500/2500HD/3500HD | 12-14 | 50-70 | — | — | NEW | 2030K | Lt Grey | 40700-1PA0A | |
| Pathfinder | 03-04 | 45-60 | 7001/HP | 7020K | 9064 | 1080K | Green | 40700-CD001 | NO |
| | 05-06 | 49 | 7001/HP | 7020K | 9161 | 1080K | Green | 40700-CK001 | NO |
| | 07-12 | 50-70 | 7001/HP | 7020K | 9204 | 2030K | Lt Grey | 40700-1AA0D | NO |
| Pathfinder (433 Mhz) | 13-14 | 71 | — | — | 5556 | 7020K | ◆ | 40700-3JA0A | VS70 |
| Pathfinder (Steel) | 04 | 49 | 7001/HP | 7020K | 9069 | 1130K | Burgundy | 40700-CK002 | NO |
| Quest | 07-09 | 50-70 | 7001/HP | 7020K | 9204 | 2030K | Lt Grey | 40700-1AA0D | NO |
| | 11-14 | 35 | 7003 | 7020K | 1216 | 1100K | Purple | 40700-1LA0E | NO |
| Quest (Steel) | 04-07 | 49 | 7001/HP | 7020K | 9069 | 1130K | Burgundy | 40700-CK002 | NO |
| Quest (Alloy) | 05-06 | 78 | 7001/HP | 7020K | 9161 | 1080K | Green | 40700-CK001 | NO |
| Rogue | 08-11 | 50-70 | 7001/HP | 7020K | 9204 | 2030K | Lt Grey | 40700-1AA0D | NO |
| Rogue <i>Post-November 2011</i> | 12-13 | 35 | 7001/HP | 7020K | 9204 | 1100K | — | 40700-JK01B | NO |
| Rogue (433 Mhz) | 14 | — | — | — | NEW | 7020K | — | 40700-3VU0A | VS70 |
| Sentra | 07-12 | 50-70 | 7001/HP | 7020K | 9204 | 2030K | Lt Grey | 40700-1AA0D | NO |
| Sentra <i>Post-January 2012</i> | 12-13 | 35 | 7001/HP | 7020K | 9204 | 1100K | — | 40700-JK01B | NO |
| Sentra (Without I-Key) <i>Post-September 2012</i> | 13-14 | 71 | 7001/HP | 7020K | 5555 | 7020K | ◆ | 40700-3AN0A | VS70 |
| Sentra (With I-Key) <i>Post-December 2012</i> | 13-14 | 71 | — | — | 5557 | 7020K | — | 40700-3AN1A | VS70 |
| Sentra (Alloy) | 07-08 | 75 | 7001/HP | 7020K | 9161 | 1080K | Green | 40700-CK001 | NO |
| Titan <i>Post-April</i> | 07-14 | 50-70 | 7001/HP | 7020K | 9204 | 2030K | Lt Grey | 40700-1AA0D | NO |
| Titan (Alloy) | 05-07 | 49 | 7001/HP | 7020K | 9161 | 1080K | Green | 40700-CK001 | NO |
| Titan (Steel) | 04-05 | 49 | 7001/HP | 7020K | 9069 | 1130K | Burgundy | 40700-CK002 | NO |
| Versa <i>December 2011</i> | 07-11 | 50-70 | 7001/HP | 7020K | 9204 | 2030K | Lt Grey | 40700-1AA0D | NO |
| Versa Sedan | 12 | 71 | 7001/HP | 7020K | 5555 | 7020K | ◆ | 40700-3AN0A | VS70 |
| Versa Sedan-Low/Base | 13-14 | — | 7001/HP | 7020K | 5555 | 7020K | ◆ | 40700-3AN0A | VS70 |
| Versa Sedan-Mid | 13-14 | — | — | — | 5557 | 7020K | — | 40700-3AN1A | VS70 |
| Versa Hatchback <i>Post-January 2012</i> | 12 | — | 7001/HP | 7020K | 9204 | 1100K | — | 40700-JK01B | NO |
| Versa Note-S & SV | 14 | — | 7001/HP | 7020K | 5555 | 7020K | ◆ | 40700-3AN0A | VS70 |
| Versa Note-SL | 14 | — | — | — | 5557 | 7020K | — | 40700-3AN1A | VS70 |
| Xterra | 03-04 | 45-60 | 7001/HP | 7020K | 9064 | 1080K | Green | 40700-CD001 | NO |
| | 05-06 | 49 | 7001/HP | 7020K | 9161 | 1080K | Green | 40700-CK001 | NO |

Nissan (cont.)

DILL 2014 TPMS APPLICATION GUIDE

| | Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. | |
|---|---------------------------------------|-----------------------|---------------|------------------|---------------|--------------------|----------|----------------|------------------|------------------|-------|
| Nissan (cont.) | Xterra <i>Pre-October 2013</i> | 07-12 | 50-70 | 7001/HP | 7020K | 9204 | 2030K | Lt Grey | 40700-1AA0D | NO | |
| | Xterra (Steel) | 06-07 | 49 | 7001/HP | 7020K | 9069 | 1130K | Burgundy | 40700-CK002 | NO | |
| | Xterra Pro-S-4X <i>12/12-10/13</i> | 13 | 71 | 7001/HP | 7020K | 5555 | 7020K | ◆ | 40700-3AN0A | VS70 | |
| Pontiac | G3 | 09 | — | — | — | 9153 | VS950 | NA | 25920615 | VS950 | |
| | G5 | 08 | 71 | 7001/HP | 7020K | NA | 1050K | White | 15921013 | NO | |
| | | 09-10 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 25920615 | VS950 | |
| | G6 <i>Pre-October 15, 2007</i> | 08 | 71 | 7001/HP | 7020K | NA | 1050K | White | 15921013 | NO | |
| | G6 <i>Post-October 15, 2007</i> | 08-10 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 25920615 | VS950 | |
| | G8 | 08-09 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 25920615 | VS950 | |
| | Grand Prix | 07-08 | 71 | 7001/HP | 7020K | NA | 1050K | White | 15921013 | NO | |
| | | 08 | — | 7001-R/ HP-R | VS80 | 9153 | VS950 | NA | 259220615 | VS950 | |
| | Montana | 08 | 62 | 7001/HP | 7020K | 9158 | 1070K | White | 15268606 | NO | |
| | | | | | | | | Blue | | | |
| | Solstice | 08-09 | 71 | 7001/HP | 7020K | NA | 1050K | White | 15921013 | NO | |
| | Torrent | 07-09 | 71 | 7001/HP | 7020K | NA | 1050K | White | 10394110 | NO | |
| | Vibe | 08-10 | 35 | 1204A | 1100K | 1204 | 1100K | Purple | 88974915 | NO | |
| | Wave | 08 | — | — | — | — | 9153 | VS950 | NA | 25920615 | VS950 |
| | Porsche | 911 Carrera (315 Mhz) | 05-08 | 31-40 | — | — | 9004 | 1090K | Gray | 997 606 023 21 | 1092 |
| 911 Carrera (433 Mhz) | | 05-08 | 31-40 | — | — | 9001 | 1090K | Gray | 997 606 021 01 | 1092 | |
| | | 12-14 | 40 | — | — | 9011 | 1096 | Yellow | 958 361 661 00 | 1096 | |
| 911 Carrera (433 Mhz) <i>Post-April 2008</i> | | 09-11 | 31-40 | — | — | 9008 or 9011 | 1090K | Gray | 997 606 021 20 | 1092 | |
| 911 Turbo (315 Mhz) | | 07-09 | 31-40 | — | — | 9004 | 1090K | Gray | 997 606 023 21 | 1092 | |
| | | 10-14 | — | — | — | NEW | — | — | — | — | |
| 911 Turbo (433 Mhz) | | 07-09 | 31-40 | — | — | 9001 | 1090K | Gray | 997 606 021 01 | 1092 | |
| | | 10-14 | 40 | — | — | 9011 | 1096 | Yellow | 958 361 661 00 | 1096 | |
| Boxster (315 Mhz) | | 05-08 | 31-40 | — | — | 9004 | 1090K | Gray | 997 606 023 21 | 1092 | |
| Boxster (315 Mhz) <i>Post-November 2008</i> | | | | | | NEW | — | — | — | — | |
| Boxster (433 Mhz) | | 05-08 | 31-40 | — | — | 9001 | 1090K | Gray | 997 606 021 01 | 1092 | |
| | | 12-14 | 40 | — | — | 9011 | 1096 | Yellow | 958 361 661 00 | 1096 | |
| Boxster (433 Mhz) <i>Thru July 2011</i> | | 09-11 | 31-40 | — | — | 9008 or 9011 | 1090K | Gray | 997 606 021 20 | 1092 | |
| Carrera GT (315 Mhz) | | 04-06 | 31-40 | — | — | 9004 | 1090K | Gray | 997 606 023 21 | 1092 | |
| Carrera GT (433 Mhz) | | 03-06 | 31-40 | — | — | 9001 | 1090K | Gray | 997 606 021 01 | 1092 | |
| Cayenne (315 Mhz) | 09-10 | 31-40 | — | — | 9004 | 1090K | Gray | 955 606 023 01 | 1092 | | |

The 1050K is to be used on the Siemens sensors and the 1070K is to be used on the Schrader sensors. ◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION GUIDE

| | Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. |
|--------------------|----------------------------|------------|---------------|------------------|---------------|--------------|----------|-----------------|------------------|------------------|
| Porsche (cont.) | Cayenne (433 Mhz) | 03-06 | 31-40 | — | — | 9005 | 1090K | Gray | 955 361 661 01 | 1092 |
| | | 07-10 | 31-40 | — | — | 9007 or 9011 | 1090K | Gray | 955 606 021 00 | 1092 |
| | | 11-14 | 40 | — | — | 9011 | 1096 | Yellow | 958 361 661 00 | 1096 |
| | Cayman (315 Mhz) | 05-08 | 31-40 | — | — | 9004 | 1090K | Gray | 997 606 023 21 | 1092 |
| | | 09-14 | | | — | — | NEW | — | | |
| | Cayman (433 Mhz) | 05-08 | 31-40 | — | — | 9001 | 1090K | Gray | 997 606 021 01 | 1092 |
| | | 09-10 | 31-40 | — | — | 9008 or 9011 | 1090K | Gray | 997 606 021 20 | 1092 |
| | | 11-14 | 40 | — | — | 9011 | 1096 | Yellow | 958 361 661 00 | 1096 |
| | 997 GT3 (315 Mhz) | 07-09 | 31-40 | — | — | 9004 | 1090K | Gray | 997 606 023 21 | 1092 |
| | | 10-14 | | | — | — | NEW | — | | |
| | 997 GT3 (433 Mhz) | 07-09 | 31-40 | — | — | 9001 | 1090K | Gray | 997 606 021 01 | 1092 |
| | | 10-14 | 40 | — | — | 9011 | 1096 | Gray | 958 361 661 00 | 1096 |
| | Panamera (315 Mhz) | 10-14 | 31-40 | — | — | 9004 | 1090K | Gray | 997 606 023 21 | 1092 |
| Panamera (433 Mhz) | 10-11 | 31-40 | — | — | 9008 or 9011 | 1090K | Gray | 997 606 021 20 | 1092 | |
| | 12-13 | 40 | — | — | 9011 | 1096 | Gray | 958 361 661 00 | 1096 | |
| | 14 | — | — | — | 9018 | 1096 | — | 500 907 275 | 1096 | |
| Rolls Royce | Cabrio (433 Mhz) | 10-12 | 31-40 | — | — | 1027 | 1090K | Gray | NA | 1092 or 1094 |
| | | 07-11 | 31-40 | — | — | 1027 | 1090K | Gray | NA | 1092 or 1094 |
| | 12-14 | 40 | — | — | 9012 | 1096 | Yellow | 36 10 6 856 227 | 1096 | |
| Saab | 9-3 (433 Mhz) | 04-07 | 62 | — | — | 9078 | 2010K | Lt Brown | 13172567 | NO |
| | | 08-12 | 88 | — | — | | 2010K | Lt Brown | 13227143 | NO |
| | 9-5 (433 Mhz) | 04-07 | 62 | — | — | 9078 | 2010K | Lt Brown | 13172567 | NO |
| | | 08-12 | 88 | — | — | — | 2010K | Lt Brown | 13227143 | NO |
| | 9-7X (315 Mhz) | 05-09 | 62 | 7001/HP | 7020K | 9116 | 1070K | Blue | 25774006 | NO |
| Saturn | Astra (433 Mhz) | 08-09 | 62 | | | 9078 | 2010K | Lt Brown | 13172567 | NO |
| | Aura Pre-October 14, 2007 | 07-08 | 71 | 7001/HP | 7020K | NA | 1050K | White | 15921013 | NO |
| | Aura Post-October 14, 2007 | 08-09 | — | 7001-R/HP-R | VS80 | 9153 | VS950 | NA | 25920615 | VS950 |
| | Lamda Crossover | 07-08 | 80 | 7001/HP | 7020K | 9158 | 1070K | White | 15268606 | NO |
| | | | | | | | | Blue | | |
| | Outlook | 07-08 | 71 | 7001/HP | 7020K | NA | 1050K | White | 15921013 | NO |
| | | 09-10 | — | 7001-R/HP-R | VS80 | 9153 | VS950 | NA | 25920615 | VS950 |
| | Sky | 08-09 | 71 | 7001/HP | 7020K | NA | 1050K | White | 15921013 | NO |
| Vue | 07-10 | — | 7001-R/HP-R | VS80 | 9153 | VS950 | NA | 25920615 | VS950 | |

The 1050K is to be used on the Siemens sensors and the 1070K is to be used on the Schrader sensors.

DILL 2014 TPMS APPLICATION GUIDE

| | Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. |
|--------------|---------------------------|------------|---------------|------------------|---------------|-------------|----------|---------------|-------------------|------------------|
| Scion | tC | 06-14 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-33011 | NO |
| | FR-S | 13-14 | 35 | 7003 | 7020K | 1218 | 1100K | Purple | SU003-00754 | NO |
| | iQ | 12-14 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-33011 | NO |
| | xB | 08-14 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-33011 | NO |
| | xD | 08-14 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-33011 | NO |
| Smart | Fortwo (433 Mhz) | 08 | 53 | — | — | 1049 | 1040K | Pantone Brown | 004 542 1518 | 1040K |
| | | 08-14 | 53 | — | — | 9214 | 2030K | Lt Grey | 000 905 7200 | 9066K |
| Subaru | B9 Tribeca | 06-07 | 66 | 7003 | 7020K | 9081 | 1080K | Green | 28103AG00A | NO |
| | BRZ | 13-14 | 35 | 7003 | 7020K | 1218 | 1100K | Purple | 28103-CA000 | NO |
| | Forester | 08-14 | — | 7003 | 7020K | 9203 | VS950 | NA | 28103AG01C | VS950 |
| | Impreza | 08-13 | — | 7003 | 7020K | 9203 | VS950 | NA | 28103AG01C | VS950 |
| | Legacy | 04-07 | 66 | 7003 | 7020K | 9081 | 1080K | Green | 28103AG00A | NO |
| | | 08-14 | — | 7003 | 7020K | 9203 | VS950 | NA | 28103AG01C | VS950 |
| | Outback | 04-07 | 66 | 7003 | 7020K | 9081 | 1080K | Green | 28103AG00A | NO |
| | | 08-14 | — | 7003 | 7020K | 9203 | VS950 | NA | 28103AG01C | VS950 |
| | Tribeca | 08-14 | — | 7003 | 7020K | 9203 | VS950 | NA | 28103AG01C | VS950 |
| | XV Crosstrek | 13-14 | — | 7003 | 7020K | 9203 | VS950 | NA | 28103AG01C | VS950 |
| | Suzuki | Equator | 09-13 | 68 | 7001/HP | 7020K | 9204 | 2030K | Lt Grey | 43211-82Z10 |
| Forenza | | 07-08 | — | 7001-R/HP-R | VS80 | 9153 | VS950 | NA | 43130-85Z03 | VS950 |
| Grand Vitara | | 07-13 | 80 | — | — | 9087 | 2010K | Lt Brown | 43130-54J21 | NO |
| Kizashi | | 10-13 | 71 | 7001/HP | 7020K | 1051 | 7020K | ◆ | 43130-57L00 | VS70 |
| Reno | | 07-08 | — | 7001-R/HP-R | VS80 | 9153 | VS950 | NA | 43130-85Z00 | VS950 |
| SX4 | | 07-13 | 80 | — | — | 9087 | 2010K | Lt Brown | 43130-54J21 | NO |
| Verona | | 05-06 | 80 | — | — | 9082 | 2010K | Lt Brown | 43130-86Z20 | NO |
| XL-7 | | 05-06 | 80 | — | — | 9087 | 2010K | Lt Brown | 43130-54J21 | NO |
| | 07-09 | 71 | 7001/HP | 7020K | NA | 1050K | White | 43130-78J10 | NO | |
| Tesla | ALL** | 10-13 | 40-50 | — | — | 2112 | 2020K | Pink | 6004985 | TP416 |
| Toyota | 4 Runner | 03-14 | 35 | 7002 or 1204A | 7020K | 1204 | 1110K | Teal | 42607-33021 | NO |
| | Avalon | 07-13 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-06011/33011 | NO |
| | Avalon Post-November 2012 | 13 | 35 | 7003 | 7020K | 1218 | 1100K | Purple | 42607-06020 | NO |
| | Camry | 07-11 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-06011/33011 | NO |
| | | 12-14 | 35 | 7003 | 7020K | 1218 | 1100K | Purple | 42607-06020 | NO |

**For vehicle relearns, must utilize a Tesla relearn tool. ◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION
GUIDE

| Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. |
|--|------------|---------------|------------------|---------------|-------------|----------|-----------|-----------------------------|------------------|
| Corolla | 07-13 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-06011/ 33011/33021 | NO |
| Corolla <i>Post-August 2013</i> | 13-14 | 35 | 7003 | 7020K | 1218 | 1100K | Purple | 42607-06020 | NO |
| FJ Cruiser | 08-14 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-33011 | NO |
| Highlander | 07-14 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-06011 | NO |
| Highlander (Smart Key) <i>Post-January 2014</i> | 14 | 35 | 7003 | 7020K | 1218 | 1100K | Purple | 42607-06020 | NO |
| Highlander-RKE (Made in Canada) <i>Post-January 2014</i> | 14 | 35 | — | — | NEW | — | — | 42607-0R010 | — |
| Land Cruiser | 05-14 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-33011 | NO |
| Matrix | 07-13 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607- 06011/33011 | NO |
| Prius | 06-13 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-06011 | NO |
| Prius C | 12-14 | 35 | 7003 | 7020K | 1218 | 1100K | Purple | 42607-06020 | NO |
| Prius V | 12-14 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-33011 | NO |
| RAV 4 | 06-13 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-06011 | NO |
| RAV 4 (Smart Key) <i>Post-January 2014</i> | 13-14 | 35 | 7003 | 7020K | 1218 | 1100K | Purple | 42607-06020 | NO |
| RAV 4-RKE (Made in Canada) <i>Post-January 2013</i> | 13-14 | 35 | — | — | NEW | — | — | 42607-0R010 | — |
| Sequoia (20 Degrees) | 04-07 | 35 | 7002 or 1204A | 7020K | 1204 | 1110K | Teal | 42607-0C020 | NO |
| | 08-14 | 35 | 7002 or 1206A | 7020K | 1206 | 1110K | Teal | 42607- 0C070/08010 | NO |
| Sequoia (40 Degrees) | 04-07 | 35 | 7002 or 1204A | 7020K | 1203 | 1110K | Teal | 42607-0C010 | NO |
| | 08 | 35 | 7002 or 1206A | 7020K | 1206 | 1110K | Teal | 42607-0C060 | NO |
| Sienna (20 Degrees) | 06-14 | 35 | 7002 or 1206A | 7020K | 1206 | 1110K | Teal | 42607- 0C070/08010 | NO |
| Solara | 06-08 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-06011 | NO |

Toyota (cont.)

DILL 2014 TPMS APPLICATION GUIDE

| | Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. |
|----------------|-------------------------------------|------------|---------------|---------------------|---------------|--------------------|----------|-------------|-----------------------------|------------------|
| Toyota (cont.) | Tacoma (20 Degrees) | 05-06 | 35 | 7002 or 1204A | 7020K | 1204 | 1110K | Teal | 42607-0C020/ AD020 | NO |
| | | 07-14 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-06011 | NO |
| | Tacoma (40 Degrees) | 05-14 | 35 | 7002 or 1204A | 7020K | 1203 | 1110K | Teal | 42607-0C010/ AD010/04010 | NO |
| | Tundra (20 Degrees) | 05-06 | 35 | 7002 or 1204A | 7020K | 1204 | 1110K | Teal | 42607-0C020 | NO |
| | | 06-14 | 35 | 7002 or 1206A | 7020K | 1206 | 1110K | Teal | 42607- 0C070/08010 | NO |
| | Tundra (40 Degrees) | 05-06 | 35 | 7002 or 1204A | 7020K | 1203 | 1110K | Teal | 42607-0C010 | NO |
| | | 06-11 | 35 | 7002 or 1206A | 7020K | 1206 | 1110K | Teal | 42607-0C060 | NO |
| | Venza | 09-14 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-06011 | NO |
| | Yaris | 07-11 | 35 | 7002 or 1204A | 7020K | 1204 | 1100K | Purple | 42607-33011 | NO |
| Yaris | 12-14 | 35 | 7003 | 7020K | 1218 | 1100K | Purple | 42607-06020 | NO | |
| Volkswagen | Beetle | 08-10 | 71 | 7003 | 7020K | 1053 | 1030K | Orange | 1K0907253D | NO |
| | CC | 09-10 | 71 | 7003 | 7020K | 1053 | 1030K | Orange | 1K0907253D | NO |
| | | 11-14 | 40 | — | — | 9013 | 1096 | Yellow | 3AA 907 275D | 1096 |
| | EOS | 07-14 | 71 | 7003 | 7020K | 1053 | 1030K | Orange | 1K0907253D | NO |
| | GLI | 08-09 | 71 | 7003 | 7020K | 1053 | 1030K | Orange | 1K0907253D | NO |
| | Golf | 10-11 | 71 | 7003 | 7020K | 1053 | 1030K | Orange | 1K0907253D | NO |
| | GTI (Standard Hex) | 06-11 | 71 | 7003 | 7020K | 1053 | 1030K | Orange | 1K0907253D | NO |
| | GTI (O-ring Hex) | 06-07 | 71 | 7003 | 7020K | 1041 | 1031K | Lt Green | 1K0907253E | NO |
| | Jetta (Standard Hex) | 06-11 | 71 | 7003 | 7020K | 1053 | 1030K | Orange | 1K0907253D | NO |
| | Jetta Sportwagen | 13 | 40 | — | — | 9018 | 1096 | Yellow | 5Q0 907 275 | 1096 |
| | Passat CC (Standard Hex) | 06-10 | 71 | 7003 | 7020K | 1053 | 1030K | Orange | 1K0907253D | NO |
| | Passat (433 Mhz) | 12-13 | 40 | — | — | 9013 | 1096 | Yellow | 3AA 907 275D | 1096 |
| | Passat (O-ring Hex) | 06-08 | 71 | 7003 | 7020K | 1041 | 1031K | Lt Green | 1K0907253E | NO |
| | Phaeton (315 Mhz) | 03 -07 | 35 | — | — | 9004 | 1090K | Gray | 4D0 907 275A | 1092 |
| | Phaeton (433 Mhz) Thru May 2007 | 02-07 | 35 | — | — | 9001 | 1090K | Gray | 4D0 907 275C | 1092 |
| | Phaeton (433 Mhz) June 2007 | 07-10 | 35 | — | — | 9007 or 9011 | 1090K | Gray | 4F0 907 275B | 1092 |
| | Phaeton (433 Mhz) Post-June 2010 | 11-13 | 40 | — | — | 9011 | 1096 | Yellow | 4F0 907 275D | 1096 |
| | R32 | 08 | 71 | 7003 | 7020K | 1053 | 1030K | Orange | 1K0907253D | NO |
| | Rabbit (Standard Hex) | 06-09 | 71 | 7003 | 7020K | 1053 | 1030K | Orange | 1K0907253D | NO |
| | Rabbit (O-ring Hex) | 06-07 | 71 | 7003 | 7020K | 1041 | 1031K | Lt Green | 1K0907253E | NO |

DILL 2014 TPMS APPLICATION GUIDE

| | Model | Model Year | Torque In-Lbs | Multi-App Sensor | Multi-App Kit | Dill Sensor | Dill Kit | Kit Color | OE Sensor Part # | Valve Stem Repl. |
|-----------------------------------|------------------------------------|------------|-----------------|------------------|--------------------|------------------------|----------|--------------|------------------------|------------------|
| Volkswagen (cont.) | Routan (433 Mhz) | 09-10 | 71 | 7004 | 7020K | 1043 | 1050K | White | 7B0907253A | NO |
| | | 11-12 | — | — | — | 9398 | VS950 | — | 7B0907253C | VS950 |
| | Tiguan | 09-11 | 71 | 7003 | 7020K | 1053 | 1030K | Orange | 1K0907253D | NO |
| | | 12-13 | 40 | — | — | 9013 | 1096 | Yellow | 3AA 907 275D | 1096 |
| | Touareg | 11-14 | 40 | — | — | 9011 | 1096 | Yellow | 4F0 907 275D | 1096 |
| | Touareg (433 Mhz) December 2006 | 03-07 | 35 | — | — | 9005 | 1090K | Gray | 7L0 907 275B | 1092 |
| Touareg (433 Mhz) January 2007 | 07-10 | 35 | — | — | 9007 or 9011 | 1090K | Gray | 4F0 907 275B | 1092 | |
| Volvo | C30 (433 Mhz) | 07-10 | 71 | — | 7020K | 1044 | 1050K | White | 31302096 | NO |
| | | 11-13 | 71 | — | 7020K | 1044 | 7020K | ◆ | 31302096 | VS70 |
| | C70 (433 Mhz) | 07-10 | 71 | — | 7020K | 1044 | 1050K | White | 31302096 | NO |
| | | 11-13 | 71 | — | 7020K | 1044 | 7020K | ◆ | 31302096 | VS70 |
| | S40 (433 Mhz) | 07-10 | 71 | — | 7020K | 1044 | 1050K | White | 31302096 | NO |
| | | 11 | 71 | — | 7020K | 1044 | 7020K | ◆ | 31302096 | VS70 |
| | S60 (315 Mhz) | 04-08 | 44 | 7003 | 7020K | 9156 | 2010K | Lt Brown | 86517000 | NO |
| | | 09-10 | — | 7003 | 7020K | NEW | VS950 | NA | 31200923 | VS950 |
| | | 09-10 | 44 | 7003 | 7020K | 9156 | 2010K | Lt Brown | OE Sensor Replacement | NO |
| | S60 (433 Mhz) | 11-14 | 71 | — | 7020K | 1044 | 7020K | White | 31302096 | VS70 |
| | S80 (315 Mhz) | 04-06 | 44 | 7003 | 7020K | 9156 | 2010K | Lt Brown | 86517000 | NO |
| | S80 (433 Mhz) | 07-10 | 71 | — | 7020K | 1044 | 1050K | White | 31302096 | NO |
| | | 11-14 | 71 | — | 7020K | 1044 | 7020K | ◆ | 31302096 | VS70 |
| | V50 (433 Mhz) | 08-10 | 71 | — | 7020K | 1044 | 1050K | White | 31302096 | NO |
| | | 11 | 71 | — | 7020K | 1044 | 7020K | ◆ | 31302096 | VS70 |
| | V70 (315 Mhz) | 04-07 | 44 | 7003 | 7020K | 9156 | 2010K | Lt Brown | 86517000 | NO |
| | V70 (433 Mhz) | 08-10 | 71 | — | 7020K | 1044 | 1050K | White | 31302096 | NO |
| | XC60 | 10-14 | 71 | — | 7020K | 1044 | 7020K | ◆ | 31302096 | VS70 |
| | XC70 (315 Mhz) | 04-07 | 44 | 7003 | 7020K | 9156 | 2010K | Lt Brown | 86517000 | NO |
| | XC70 (433 Mhz) | 08-10 | 71 | — | 7020K | 1044 | 1050K | White | 31302096 | NO |
| | | 11-14 | 71 | — | 7020K | 1044 | 7020K | ◆ | 31302096 | VS70 |
| | XC90 (315 Mhz) | 05-11 | 44 | 7003 | 7020K | 9156 | 2010K | Lt Brown | 86517000 | NO |
| | | 12-14 | — | 7003 | 7020K | NEW | VS950 | — | 31200923 | VS950 |
| | | 12-14 | 44 | 7003 | 7020K | 9156 | 2010K | Lt Brown | OE Sensor Replacement | NO |
| XC90 (433 Mhz) | 08 | 71 | — | 7020K | 1044 | 1050K | White | 31302096 | NO | |
| MV-1 | 11-13 | — | 7001-R/ HP-R | VS80 | 9315 | VS950 | NA | SP000437 | VS950 | |
| Volvo Bus | — | — | — | — | 9010 | VS9013 or VS9980 | — | — | VS9013 or VS9980 | |
| Prevost Bus | — | — | — | — | 9010 | VS9013 or VS9980 | — | — | VS9013 or VS9980 | |
| Nova Bus | — | — | — | — | 9010 | VS9013 or VS9980 | — | — | VS9013 or VS9980 | |

◆ The 7020K Service Kit is used.

Application guides subject to change without notice. Please refer to the manufacturer's websites for the most up-to-date application data.

ALPHABETICAL INDEX

| | | | |
|---|----|--|----|
| 1/4" Socket Driver _____ | 30 | Multipro Multi-Protocol TPMS Sensors _____ | 21 |
| 315MHz Redi-Sensor Universal Transmitter (Clamp-In Style) _____ | 14 | Nissan Reset Tool _____ | 9 |
| Aftermarket TPMS Accessory Kits _____ | 26 | REDI-Sensor Universal Transmitter _____ | 14 |
| Ateq VT55 OBDII TPMS Tool Kit _____ | 12 | REDI-Sensor Valve Stems _____ | 15 |
| Ateq VT56 OBDII TPMS Tool Kit _____ | 12 | Replacement Rubber Valve & Screw for 7001HP-R Redi-Sensor _____ | 15 |
| Band Transmitter for Ford _____ | 32 | Replacement Sensors and Replacement Stems for the Smart Sensor Pro+ Programming/Scanning Tool _____ | 20 |
| Bartec EZ-Sensor Starter Kits _____ | 9 | Replacement Snap-In Valve for Schrader Snap-In Transmitters _____ | 13 |
| Bartec Mechanical Tool Kit _____ | 31 | Replacement Stem for Chrysler/Dodge TPMS Applications _____ | 25 |
| Bartec Mitsubishi OBDII Relearn Adapter _____ | 5 | Rubber TPMS Snap-In Replacement Valves _____ | 15 |
| Bartec Programming Fixture _____ | 7 | Rubber TPMS Snap-In Replacement Valves _____ | 25 |
| Bartec Tech200 Base Activation Tool _____ | 5 | Schrader Accessory Kit Assortments _____ | 22 |
| Bartec Tech400 Smart Sensor Programming Fixture _____ | 6 | Schrader Accessory Kits _____ | 22 |
| Bartec Tech500 Smart Sensor Programming Fixture _____ | 6 | Schrader TPMS Retrofit Kits _____ | 35 |
| Bartec Wheelrite Tech300SD _____ | 8 | Schrader TPMS Training DVD _____ | 33 |
| Bartec Wheelrite Tech400SD TPMS Tool _____ | 7 | Schrader TPMS Transmitters _____ | 16 |
| Bartec Wheelrite Tech500 All-In-One TPMS Service Tool w/ OBD and Wireless Connectivity _____ | 5 | Schrader TPMS Valve Caps _____ | 25 |
| Beru TPMS Valve Inserts _____ | 27 | Schrader TPMS Valve Core _____ | 27 |
| Complete Dill Universal Sensor Package _____ | 24 | Smart Sensor Pro+ Programming/Scanning Tool _____ | 20 |
| Complete Replacement Kit for Chrysler/Dodge TPMS Applications _____ | 25 | Speed Torque Tools for TPMS _____ | 29 |
| Consumer Awareness Counter Mat _____ | 34 | T-10 Torque Tools _____ | 28 |
| Core/Cap Removal Tool _____ | 30 | T-20 Torque Tool with Replaceable Tip _____ | 28 |
| Digital Tire Inflator Gauge _____ | 31 | TIA TPMS Relearn Chart _____ | 4 |
| Dill Aluminum Replacement TPMS Stems _____ | 15 | Tire Deflator/Valve Core Remover _____ | 29 |
| Dill OEM Replacement Bands _____ | 32 | Tire Deflator Set for TPMS Valve Stems _____ | 28 |
| Dill TPMS Accessory Kits _____ | 23 | Tire Pressure Monitoring System Reset Tool _____ | 10 |
| Dill TPMS Cabinets _____ | 34 | Tire Pressure Monitoring System Reset Tool Master Kit _____ | 10 |
| Dill TPMS Master Tool Kit _____ | 31 | Toyota Loop Reset Tool _____ | 9 |
| Dill TPMS Replacement Stem Assortment _____ | 24 | TPMS Band Transmitter Accessories _____ | 32 |
| Dill TPMS Startup Assortment _____ | 24 | TPMS Consumer Kit _____ | 33 |
| Dill TPMS Transmitters _____ | 18 | TPMS Countertop Displays _____ | 34 |
| Dill TPMS Valve Caps & Cores _____ | 27 | TPMS Hub _____ | 6 |
| Dill Trailer TPMS System _____ | 35 | TPMS Kit for REDI-Sensor _____ | 15 |
| Electronic TPMS Torque Wrench _____ | 29 | TPMS Pad _____ | 6 |
| EZ-Sensor Programmable TPMS Sensors _____ | 13 | TPMS Torque Wrenches and Sockets _____ | 27 |
| EZ-Sensor Replacement Aluminum Valve Stem _____ | 13 | TPMS Training Package _____ | 33 |
| EZ Tire TPMS Sensor Kit _____ | 13 | TPMS Transmitter Check Box _____ | 12 |
| Ford Complete Banded High Pressure Sensor Package _____ | 32 | TPMS Tri-Fold Consumer Brochure, Brochure Holder _____ | 34 |
| Ford Complete Banded Transmitter Package _____ | 32 | TPMS Valve System Fishing Tool _____ | 30 |
| Genisys EVO® USA 2012 Kit with Tire Pressure Reset Tool _____ | 11 | TPR Tool with EZ-Sensor™ Programming _____ | 11 |
| Grommet Installation/Removal Tool _____ | 30 | Universal Master TPMS Transmitter Hardware & Tool Service Set _____ | 24 |
| Grommet Removal Tool _____ | 30 | Valve Core Tools: Screwdriver Type & Standard Bore Long Valve _____ | 29 |
| High Pressure Ford Banded Transmitter _____ | 32 | Valve Core Torque Tool _____ | 28 |
| HUF Tire Pressure Monitoring System (TPMS) Transmitters _____ | 19 | | |
| Mitsubishi TPMS Reset Tool _____ | 9 | | |

VT56 Diagnostic TPMS Tool

ATEQ

The **VT56** is a fully updateable, universal TPMS tool. Designed to activate all TPMS sensors and store the sensor data.

Using the OBDII connector this data can then be transferred to the vehicle to reset the ECU when a sensor is replaced or wheel positions are changed.

All popular programmable sensors can be programmed with the VT56.

VT56 OBDII Kit includes:

- VT56 Diagnostic Tool
- OBDII Interface Connector
- Docking Station with Thermal Printer (Optional)
- OBDII to VT56 Ethernet Cable
- USB PC Cable
- Power Adaptor
- Update Software
- Quickstart User Manual
- ATEQ Hard Kit Carry Case



Part# TS56-1000



**TRIGGERS
ALL KNOWN
SENSORS**

VT56 Features

- Full Color 4" Screen
- Icon Driven Intuitive Learning
- Part Number Lookup
- OBD II for ECU Reset
- Dated History File
- Programs all Popular Programmable Sensors
- OBD II Position
- Key Fob Tester
- RF Signal Tester
- Help Screens
- WIFI Connection to PC
- WIFI Updates
- Barcode Scanner for Vehicle Identification
- Bluetooth Connection for Printing
- Docking Cradle with Thermal Printer
- Update via USB, WIFI & SD Card
- TPMS DTC Retriever
- US / European / Asian Vehicles
- Full Relearn Procedures



Scan VIN



Trigger Sensors



Relearn TPMS



Flashlight on OBDII Module



ASCOTTM
SUPPLY CORPORATION



TPMS CATALOG 2014

Ask Your Sales Representative For Your Copy of the **Complete Ascot Buyer's Guide!**

Your ASCOT TPMS One Stop Shop Distributor:
Attention Service Manager:



©Ascot Supply Corporation
TPMS0414



Ascot Supply Corporation is not responsible for
inadvertent typographical errors or omissions.